
INDESIT company

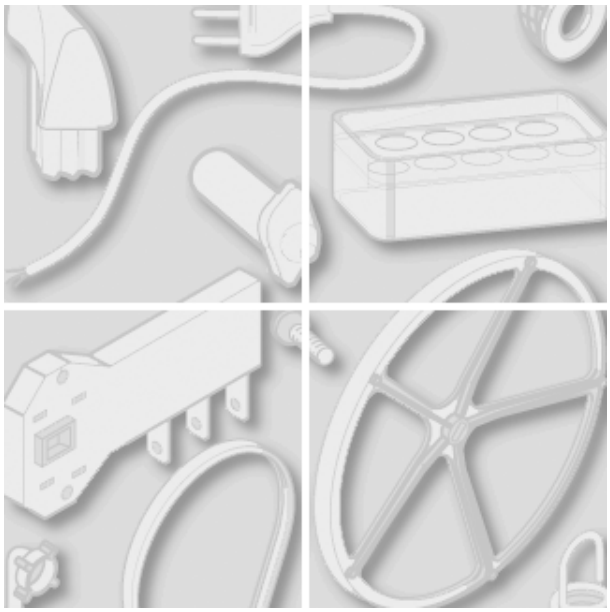

Model type:
DV620IX

Commercial code:
F029929

General notes

Technical Documentation guidelines

You can find herewith some generic information to simplify cunsulting of technical documentation:

1. Models of same range share the same exploded views, which report the richest set of spare parts:generally, a model does not necessarly have a related spare part for each particular shown on exploded views.

2. Some spare parts can not be represented directly on the exploded views (instruction booklets, specific kit, etc...). You can find those codes in the spare parts list with the same reference of particular where spares are installed or with references 099, 999. Instruction booklets, once managed, appear with 000 reference.

3. On the higher right site of each exploded view there is a serial number which indicates the beginning of the production of certain range:some models might have more than an exploded view for a given category, each distinguished by a different serial no.and linked to another spare parts list, In this case, serial no. is required to supply the right spare part code. Exploded view to be considered is the one with a more recent serial no. but previous than the one of the model that needs assistance.

4.Exploded views might require further updates even after publishing. Addition of new spares will go on following the already existing numeration references. Revision number of an exploded view is shown into last four digits of serial number into upper right hand corner.

5.The spare parts list associated to an exploded view shows related codes of spares managed for a certain model; for each spare part other informations are available:


REF: reference no of spare into a table; SUBSTITUTE: list of spare(s) which can replace a code but that keeps same functional characteristics

INDUSTRIAL CODE: list of variables of a model (shown into model label) where such spare is used; NOTICE: code of information(s) to refer to complete technical intervention, track for changes or to find correct spare part code.

6. Some notices, into a same section are generic therefore cannot be directly linked to a spare part. In order to assist a model in the best way as possible, it is helpful to pay attention to all notices and constantly verify documentation updates

7.Technical documentation cover shows model name and its commercial codes

2210160 Exploded views

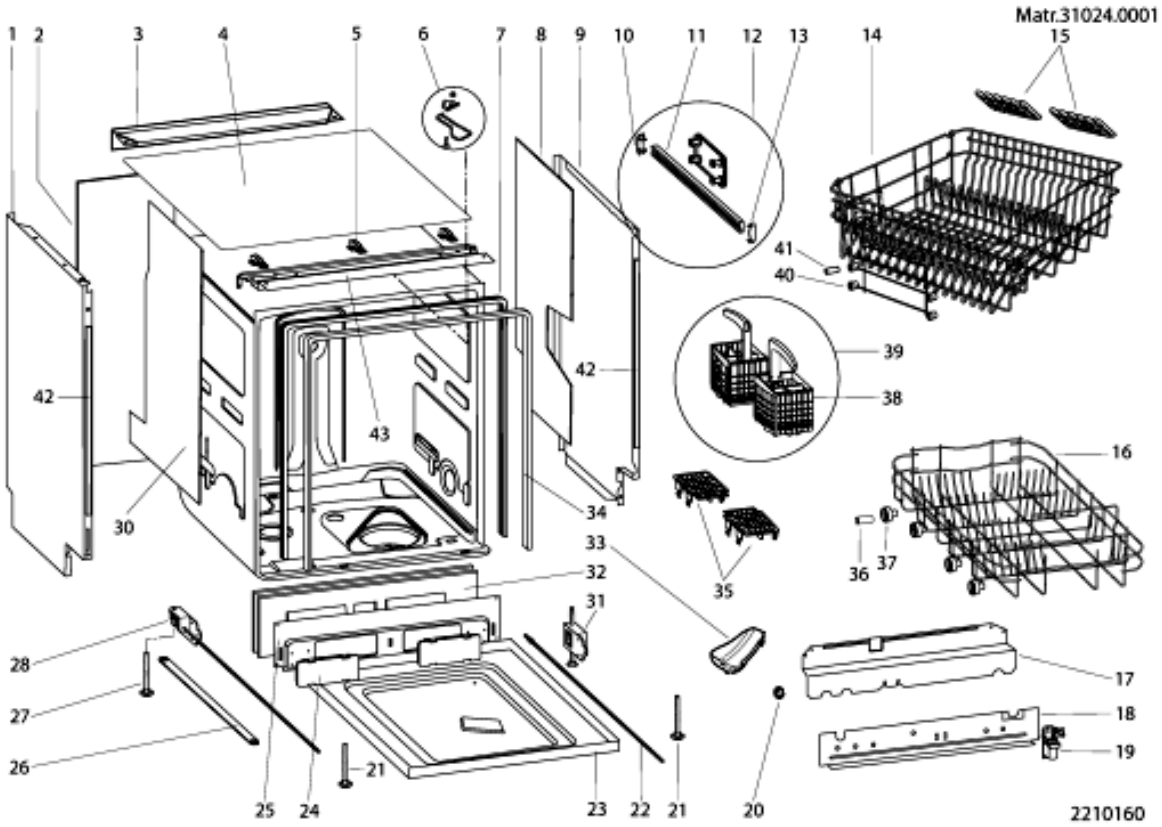


2210160 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
000	C00097095				instruction book it-gb-fr-de-nl-es-		
001	C00092827			1 x C00092835	left side panel lh zinc		
003	C00033591				rear support - top		
004	C00141310				upper panel polionda 60cm evo3	n1045127	
006	C00085024			1 x C00037135	catch plate (cabinet)		
				1 x C00297907			
				1 x C00297909			
				1 x C00297910			
007	C00116110			1 x C00141317	door seal - top and sides mm1608	n1045127	
007	C00141317				top and side door seal (1638mm)	n1045127	
009	C00092828			1 x C00092835	right side panel lh zinc		
010	C00094117				rail back stop evo3		
011	C00094116			1 x C00094112	basket runner - upper evo3		
012	C00094112				runner assembly		
013	C00094118				runner end stop		
014	C00097164		41101...		upper basket noclik/clak evo3	n1045069	37299290000
						n1045098	
014	C00109659	41102...		1 x C00110518	upper basket noclik/clak markii		37299290100
015	C00097098				flap upper basket light blu 278		
016	C00056397			1 x C00054825	lower basket 'lsv61ix'		
017	C00091600				rear support - middle		
018	C00091601				lower rear support hot or cold		
019	C00078395			1 x C00076659	radio interference suppressor		
				1 x C00143383			
020	C00054830				drain hose fastener		
021	C00092555				foot 155mm		
022	C00082476				rear foot adjustment assembly	n1045073	
023	C00092554			1 x C00118842	tray on bottom of tub 60cm		
024	C00054833				top for front support		
025	C00091599			1 x C00119016	front support lower 60cm		
026	C00076656				slide for foot		
027	C00092822				adjustable back foot	n1045073	
028	C00092820				left rear foot adjustment assembly	n1045073	
031	C00092821				rear foot adjustment assembly	n1045073	
034	C00054932				frame support for tub seal 60cm	n1045047	

2210160 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
035	C00078869				cutlery basket divider		
036	C00104638				basket roller axis		
037	C00056347				lower basket wheel		
039	C00097097				cutlery basket		
040	C00094191			1 x C00109840	upper basket roller evo3		
041	C00094189				roller axle upper basket		
042	C00086602				edge cover right		
042	C00086603				edge cover left		
043	C00079013				door spring adjuster		
099	C00036547				anti condensation strip - worktop		
099	C00094138				lower basket buffer evo3		

2210230 Exploded views

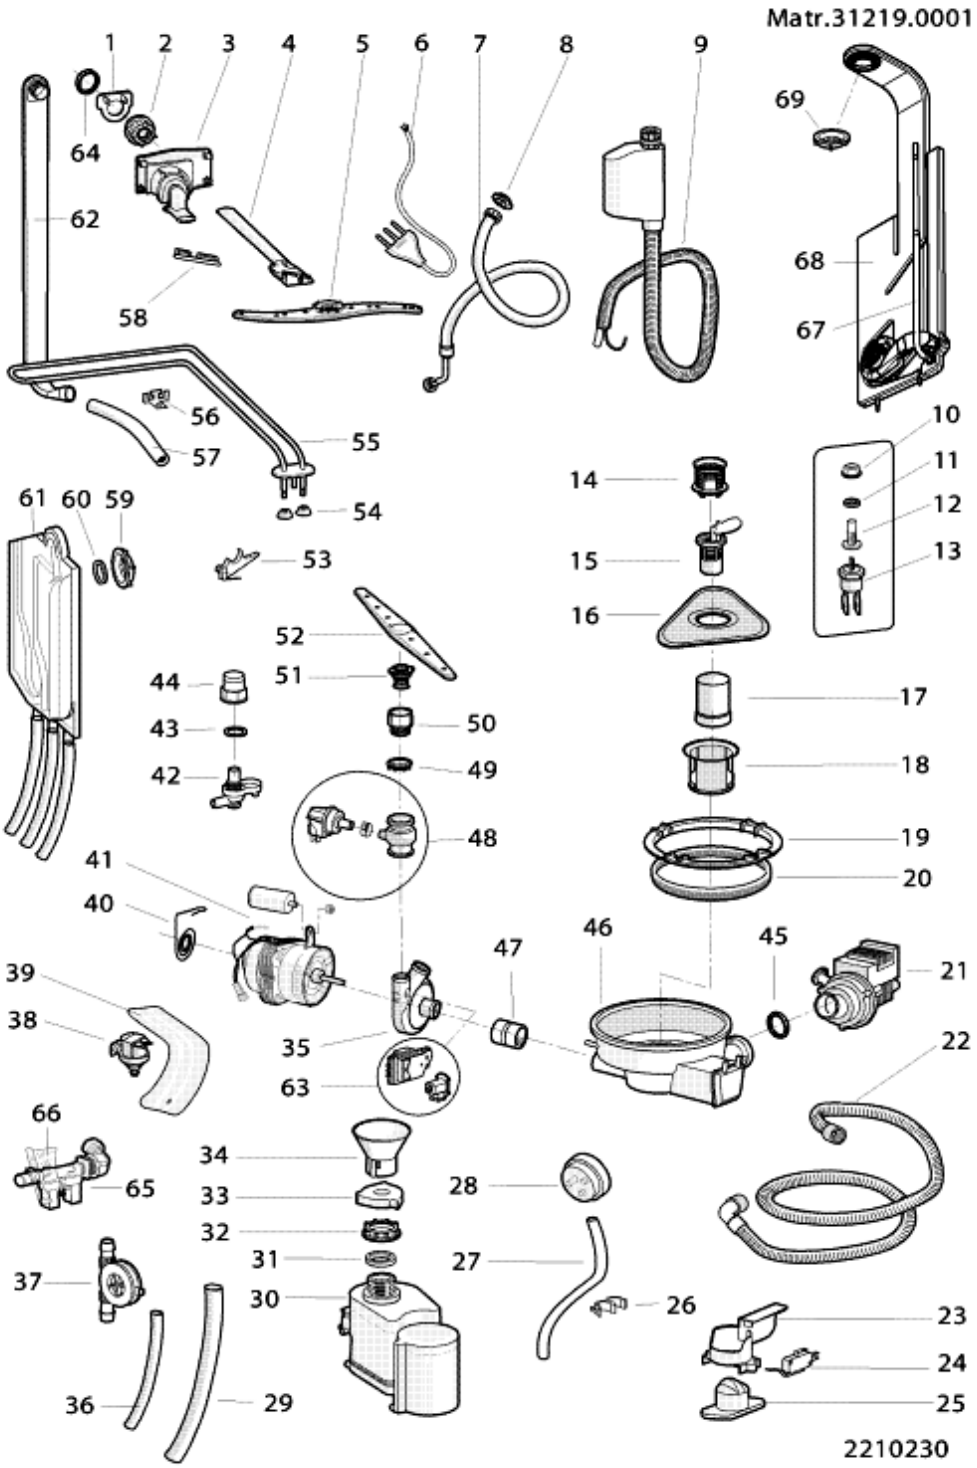

2210230 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
001	C00054925				upper was basket guide casing		
002	C00054862			1 x C00144315	ring-nut fasten.external hose top		
003	C00094134			1 x C00110526	water supply distribution assembly	n1045084	
				1 x C00110527			
003	C00110526				water supply distribution assembly		
004	C00054926			1 x C00110526	upper wash arm feed pipe	n1045084	
				1 x C00110527			
004	C00110527				upper wash arm feed pipe		
005	C00075746				upper wash arm curved set		
006	C00083706			1 x C00143371	supply cable schuko		
				1 x C00144229			
007	C00009415			1 x C00144176	mains inlet hose hot 1500mm		
008	C00018315			1 x C00005781	sealing washer+filter - mains inlet		
010	C00097871				lock nut m8 + washer 'lvs'		
011	C00063792				seal o-ring		
012	C00063791				temperature sensor		
013	C00041086				thermostat safety 78ønc (dw)		
013	C00063788			1 x C00097871	lock nut m8 inox		
013	C00063790				washer d.8 mm inox		
014	C00094158			1 x C00142344	filter grid evo3	n1045083	
015	C00054863			1 x C00142344	central filter		
015	C00094156			1 x C00142344	central filter basket/retainer evo3	n1045083	
016	C00054851			1 x C00145075	outlet filter stainless lvs2000		
017	C00081164			1 x C00142344	filter cylindrical		
017	C00094164			1 x C00142344	filter cylindrical evo3	n1045083	
018	C00061929				outer fine rotating polyester filter		
019	C00054854				sump fixing ferrule		
020	C00054828				gasket - sump fixing ring		
021	C00096072			1 x C00112306	drain pump 230v 50hz evo3		
022	C00054869				drain hose		
023	C00081162				container - overflow unit		
024	C00037205			1 x C00143107	microswitch		
025	C00058843				float - overflow unit		
026	C00095801				pressure hose clip evo3		
027	C00094154				pipe pressostat lvs evo3		


2210230 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
028	C00094151			1 x C00143740	pressure switch 90 71 evo3		
029	C00094267				tube water inlet air-break/turbine	n1045085	
029	C00110612			1 x C00111855	tube water inlet electrovalve/air-	n1045085	
				1 x C00115348			
030	C00098501				water softener steady evo3		
031	C00103610				seal - softener/wash chamber		
032	C00041090			1 x C00144235	retaining ring - softener		
033	C00041088				salt cap		
034	C00005819				salt funnel		
035	C00055005				pump cover		
036	C00054868				tube - softener/sump l.(480mm)		
037	C00094172				turbine evo3	n1045085	
038	C00094227				electrovalve 1e 1u evo3	n1045085	
038	C00110611				inlet valve	n1045085	
039	C00094160				protection electrovalve evo3		
040	C00076628				tub spring		
041	C00076627				wash motor/pump assy 220v-60w		
042	C00094159		60903...		overflow connector evo3		
042	C00196353	60904...			overflow connector evo3		
043	C00075695				connection gasket overflow		
044	C00143580		60903...		bodytop overflow evo3 rohs		
044	C00196352	60904...		1 x C00094159	bodytop overflow evo3 rohs		
				1 x C00143580			
045	C00054917				seal 'o'ring (23,81x2,62)		
046	C00094143			1 x C00141158	set sump evo3		
047	C00079016				pipe rubber sump-pump		
048	C00094157			1 x C00142435	high pressure sensor assembly		
				1 x C00144125			
049	C00075057			1 x C00075111	cap corner for support washing		
050	C00066643			1 x C00075111	support - lower wash arm bush		
051	C00066642			1 x C00075111	ring-nut for fastening bottom		
052	C00075108				lower wash arm inox 60cm		
054	C00074714				terminal protection - heating		
055	C00066598			1 x C00144898	heating element 2000w/230v		
056	C00054872				support bracket - heating element		

2210230 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
057	C00076233				pump junction pipe		
058	C00056342				steel pin fixing upper wash arm	n1045084	
059	C00054927			1 x C00144335	ring-nut for air-flow body		
060	C00084600				o ring seal 38 mm		
061	C00094174				water inlet air break evo3	n1045085	
061	C00110610			1 x C00115360	air break + turbine evo3	n1045085 n1045127	
061	C00141308			1 x C00141655	air break + turbine evo3	n1045127	
062	C00056001				upper wash arm feed pipe		
070	C00098769				upper wash arm seal		
099	C00033026			1 x C00292523	ambljgon grease ta 100 gr.		
099	C00073917				clamp for pump cover		
099	C00075879				clamp		
099	C00084479				hose clamp		
099	C00094150				clip pressure sensor evo3		
099	C00094162				pipe fixing band on turbine		

2210390 Exploded views

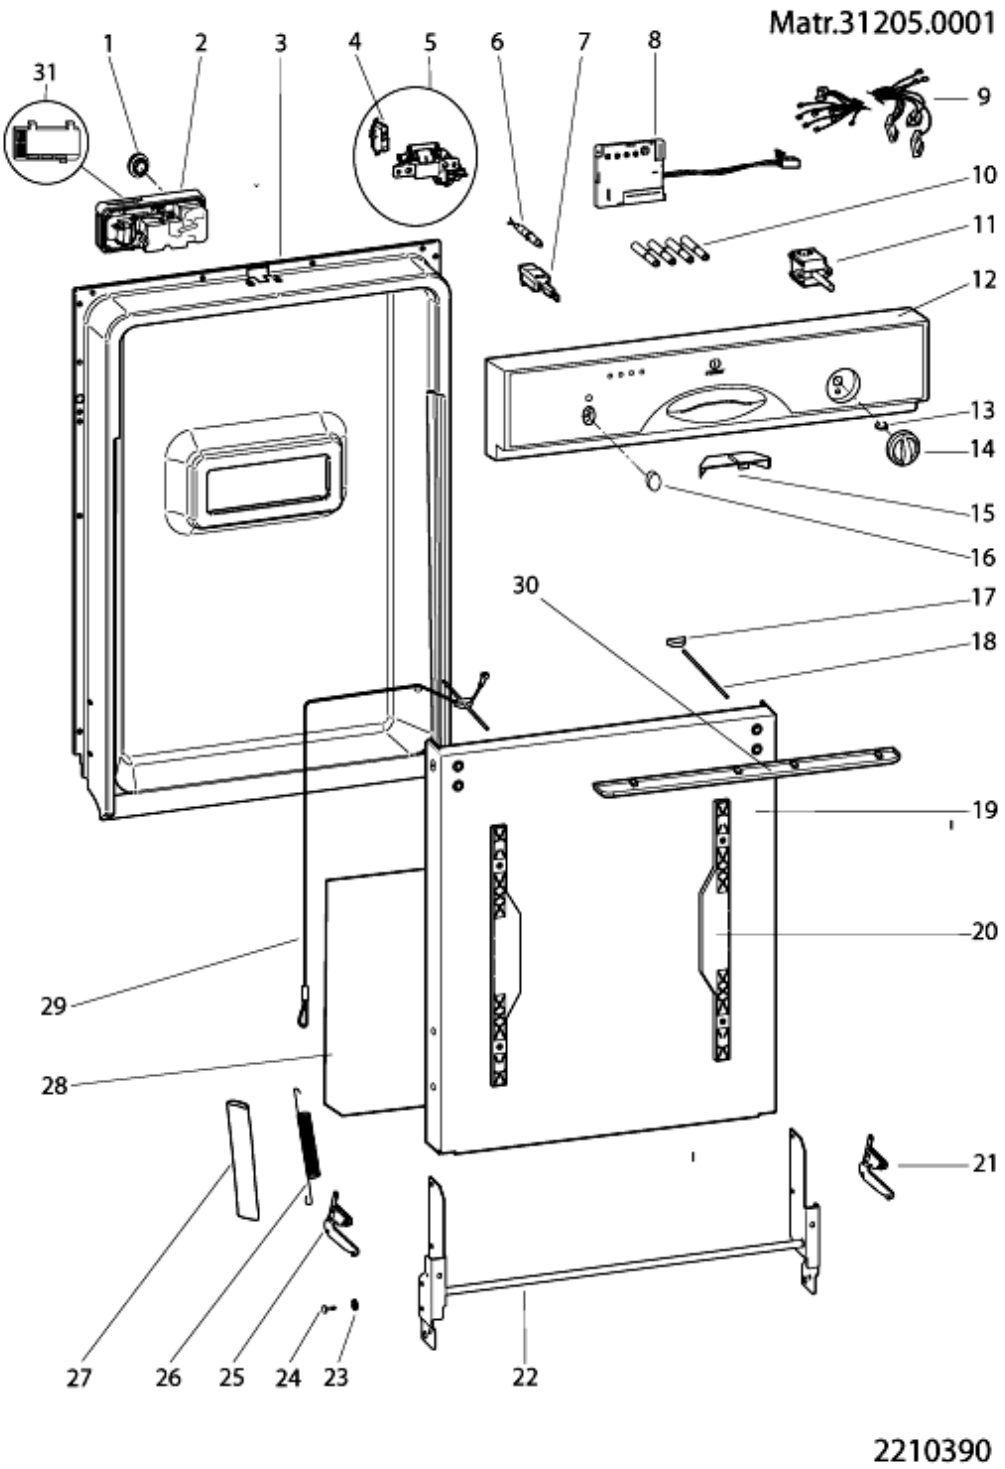

2210390 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
001	C00051755				rinse aid cap (pair) raised & flush		
002	C00094133			1 x C00143377	electrodispenser(lamp rinseaid-no		
003	C00091543			1 x C00290247	door seal lower 60cm		
003	C00095276		41101...		inner door panel stainless evo3	n1045098 n4509a00	37299290000
003	C00109659	41102...		1 x C00110518	upper basket noclik/clak markii		37299290100
004	C00085358				microswitch		
005	C00094128			1 x C00195887	locking assembly evo3		
006	C00085359				pilot light red 230v		
007	C00096884			1 x C00142650	on-off switch (double pole)		
008	C00096235			1 x C00097890	control card bit100.1 'p1' +	n1045079	
008	C00108957				bracket for timer bit 100		
008	C00143211				timer bit100.1 's1' rohs +	n1045079	
009	C00097091				wiring harness assembly	n1045079	
009	C00110292			1 x C00111174	wiring harness assembly	n1045079	
010	C00087407				pilot lamp lens		
011	C00084910			1 x C00084912	8 functions selector		
012	C00097365			1 x C00098745	black dash board + plat band inox		
013	C00034319			1 x C00104581	knob plate		
014	C00097343			1 x C00108943	knob black evo3		
015	C00097344				black protection lid handle		
016	C00097345				black push button evo3		
017	C00054933				spring adjustment piece		
018	C00055000			1 x C00143736	special screw for spring		
019	C00095269				door panel zinc		
021	C00065127			1 x C00054815	hinge item, right		
022	C00096996				hinge assembly 'lvs evo3'		
023	C00058776				washer d = 6 mm		
024	C00048504				hinge pin		
025	C00065128			1 x C00054817	hinge item, left		
026	C00086467				door spring		
027	C00066426				tube hinge spring		
028	C00095273				door spacer	n1045088	
029	C00054936				spring adjustment wire		
030	C00029540				facia spacer - black		

2210390 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
031	C00098134				door detergent electrodispenser	n1045069	
032	C00140679				seal spring	n1045127	
099	C00076108			1 x C00012687	screw canoe klip		
099	C00084911			1 x C00304782	screw 3.5x9.5		
099	C00094120				fixing bolt inner door/dashboard		
099	C00094141				fixing screw inner/outer door		
099	C00095275			1 x C00256870	installation kit		
099	C00111286				transparent door lvs evo3 60cm ##		

Notices

n1045048: BIT 100 CARD INITIALIZATION

Free-standing dishwasher

1- Close the door and switch the dishwasher on.
2- Wait for the test cycle to start (2 LEDs light up or "ROD" appears on dishwashers with display).
3- Wait 10 seconds (dishwasher will start to fill water...)
N.B. If the cycle fails to start the card has probably already initialized, so proceed to point 5.
4- To reset the test cycle turn the programme button to reset or hold down the start/reset button for 5 seconds. (Wait for the buzzer to beep three times or if the dishwasher does not have a buzzer, wait for the programme LEDs to switch off.)
5- To check the aforementioned steps have completed successfully, select a programme and see if it starts; (reset it after this check).
6- The dishwasher is ready for the customer.

Built-in dishwashers

1- Close the door and switch the dishwasher on.
2- Wait for the test cycle to start
3- Wait 10 seconds (the dishwasher will start to fill...)
N.B. If the cycle fails to start the card has probably already initialized, so proceed to point 5.
4- To reset the cycle, open the door (2 LEDs lit up) and press the programme button for three bips of the buzzer (or until the programme LEDs go off for dishwashers with no buzzer).
5- To check the aforementioned steps have completed successfully, press the select programme button and check that the indicator light beside the corresponding programme comes on.
6- The dishwasher is ready for thecustomer.

n1045069: Modification of racks and dispenser lid on EVO3 dishwashers


---

To obtain better dissolving of the detergent during the wash cycle, the following modifications have been made to EVO3 dishwashers:
- new dispenser lid, replacement code 098134 (see figure N1045069FIG4) created;
- upper racks modified with lid catch angle changed from 9° to 16° (see figure N1045069FIG5);
- MultiSystem lower racks modified with insertion of a spacer wire at the electric dispenser (see figure N1045069FIG6).

The upper and lower racks have the same spare part codes as the premodification items; Replacements Warehouse stocks have been replaced.


Lid installation instructions:
1) prise the lid out of the dispenser seat using a small screwdriver at point A (figure N1045069FIG1);
2) replace the lid, checking that release spring B (figure N1045069FIG2) is in place; before fitting the new lid load the spring from position 1 to position 2 (figure N1045069FIG2);
3) fit the lid in its special seat and check for correct operation (figure N1045069FIG3).
Lid closing may be harder for the first few cycles after replacement, due to settling of the material.


N1045069FIG1

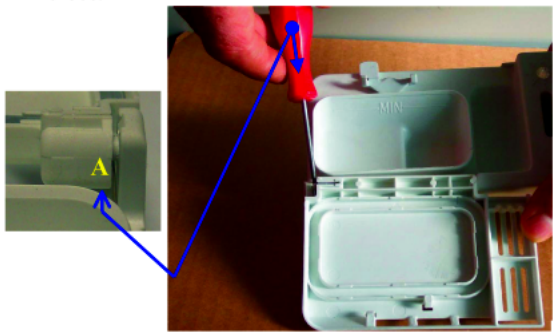



N1045069FIG2

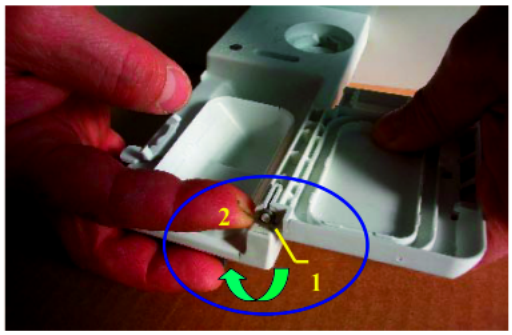


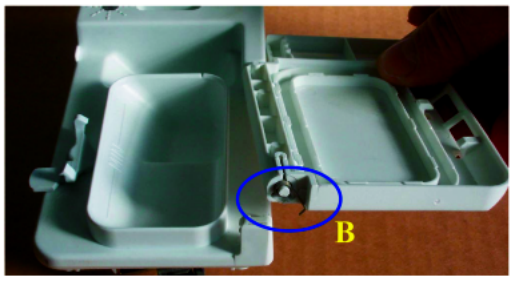


N1045069FIG3




N1045069FIG4

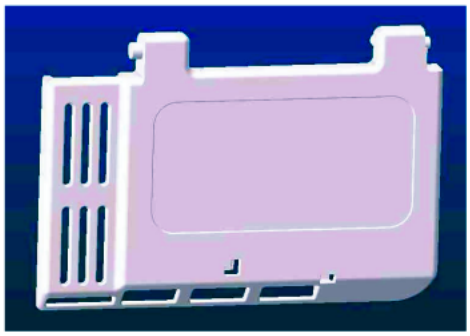

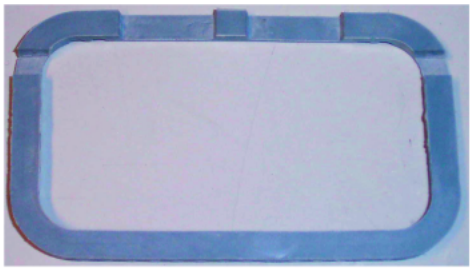


N1045069FIG5

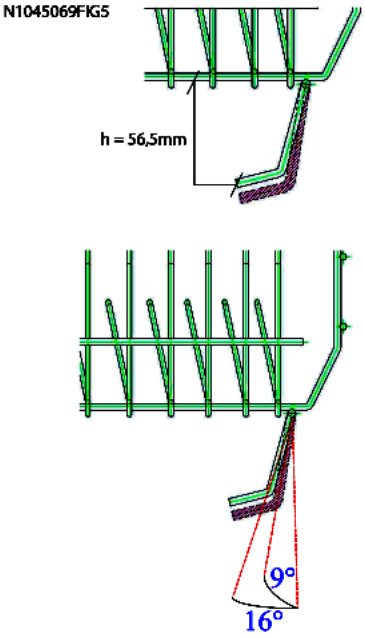

n1045073: Elimination of adjustable rear feet on DV620.

From serial no. 31001.0001, the adjustable rear feet have been eliminated on models DV620BK - DV620IX - DV620WH.
This modification involved the introduction of two rear feet H=155mm Service code 092555.
The Service codes of the eliminated parts are:
092820 LH ADJUSTABLE FOOT ASSEMBLY;

N1045069FIG6

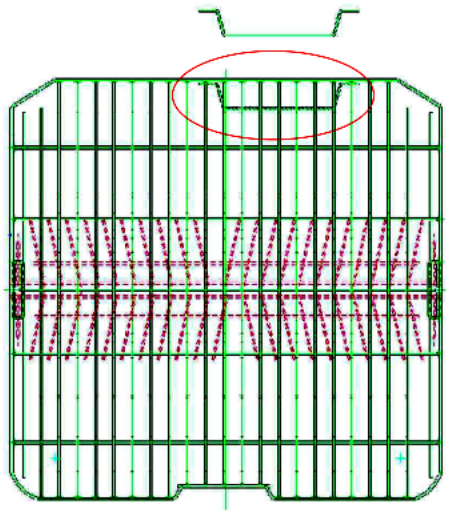

092821 RH ADJUSTABLE FOOT ASSEMBLY;
092822 ADJUSTABLE FOOT H=140;
082476 FOOT ADJUSTING DEVICE ASSEMBLY.

n1045079: Introduction of timer BIT100 'S1'

All models affected by this note have been equipped with timer BIT100 S1 spare part code 109875, which is not interchangeable with the premodification item.
The wiring assemblies have been modified with the introduction of a model recognition resistance. The new wiring assemblies are not interchangeable with the old ones.
All INDESIT FREE-STANDING models have maintained the same wiring assembly, as it is already provided with the model recognition resistance.

Given below is the list of affected models with related modification introduction serial numbers and spare part codes of modified items:

IDL505SUK.2 commercial code 32001 (S/n 40423.0001);
IDL500UK.2 commercial code 31984 (S/n 40423.0001);
IDL500UK.2T commercial code 32554 (S/n 40423.0001);
IDL50EU.2 commercial code 32006 (S/n 40423.0001);
IDL50SK.2 commercial code 32221 (S/n 40423.0001);
IDL51EU.2 commercial code 32217 (S/n 40423.0001);
IDL61EU.2 commercial code 32218 (S/n 40423.0001);
IDL500FR commercial code 30014 (S/n 40423.0001);
IDL50EU commercial code 30217 (S/n 40423.0001);
Timer: premodification 097481 (rohs 143207), new 109875 (rohs 143211).

L63EU commercial code 29544 (S/n 40423.0001);

DWF40P.2 commercial code 32229 (S/n 40427.0001);
Timer: premodification 097890 (rohs 143206), new 109875 (rohs 143211);
Wiring : premodification 094729, new 109952.

DV640AIX commercial code 30368 (S/n 40423.0001);
Timer: premodification 097890 (rohs 143206), new 109875 (rohs 143211);
Wiring: premodification 099260, new 109953.

DV620WH commercial code 29928 (S/n 40505.0001);
DV620WHUK commercial code 30348 (S/n 40505.0001);
DV620BK commercial code 29927 (S/n 40505.0001);
DV620BKUK commercial code 30349 (S/n 40505.0001);
DV620IX commercial code 29929 (S/n 40505.0001);
DV620KIXUK commercial code 30350 (S/n 40512.0001);
Timer: premodification 097890 (rohs 143206), new 109875 (rohs 143211);
Wiring: premodification 097091, new 110292.

DV630AIX commercial code 30693 (S/n 40602.0001);
DV630AWH commercial code 30694 (S/n 40602.0001);
DV630ABR commercial code 30695 (S/n 40602.0001);
DV650AIX commercial code 30696 (S/n 40602.0001);
DV650AWH commercial code 30697 (S/n 40602.0001);
DV650ABR commercial code 30698 (S/n 40602.0001);
Timer: premodification 097890 (rohs 143206), new 109875 (rohs 143211);
Wiring: premodification 099606, new 111098.

L61EU commercial code 28470 (S/n 40506.0001);
L61IT commercial code 28169 (S/n 40506.0001);
L61AG commercial code 29907 (S/n 40506.0001);
Timer: premodification 097890 (rohs 143206), new 109875 (rohs 143211);
Wiring: premodification 094237, new 110293.

LVI12-44AN commercial code 29564 (S/n 40510.0001);
LVI12-44IX commercial code 29562 (S/n 40510.0001);
LVI12-44WH commercial code 29563 (S/n 40510.0001);
Timer: premodification 097890 (rohs 143206), new 109875 (rohs 143211);
Wiring: premodification 096883, new 110498.

n1045082: Timer Bit 100 programmes for Evo3 60cm dishwashers

Table N1045082FIG1 shows information relevant to the programmes of the following Timer Bit 100 for Evo 3 60 cm dishwashers:
Timer BIT 100 - E1 - Service code 097890 (rohs 143206);
Timer BIT 100 - E2 - Service code 097481 (rohs 143207);
Timer BIT 100 - E3 - Service code 099892 (rohs 143208);
Timer BIT 100 - S1 - Service code 109875 (rohs 143211).

PROGRAMMES:
1) Energico or Super Wash or Intensive
2) Normal or Daily
3) Eco (Ciclo per Istituti)
4) Rapido

5) Ammollo
6) Cristalli
7) Special Guest
8) Just you
9) Duo-Wash o Crystal and Pot

PROGRAMME PHASES:
A) Pre-wash
B) Pre-wash
C) Wash
D) Rinse
E) Rinse
F) Rinse
G) Drying

PROGRAMME MODIFICATIONS ARE INDICATED IN RED.

TIMER BIT 100 - EVO 3

PROGRAMS	PROGRAM PHASES										
	A	B	C	D	E	F	G	Time	Effective Time	Kwh	L
1	X	40°C	65°C	cold	cold	65°C	✓	120'	125'	1,4	23,0
2	X	X (ex:cold)	55°C	cold	X	70°C	✓	72'	85'	1,25	16,0
3	cold	cold	50°C	X	X	65°C	✓	130'	138'	1,05	18,0
4	X	X	47°C (ex:40°C)	62°C	X	X	extradry	24'	38'	0,7	10,0
5	cold	X	X	X	X	X	X	12'	12'	0,01	4,0
6	X	X	52°C (ex:55°C)	45°C	X	65°C	✓	96'	98'	1,16	16,0
7	X	X	X	X	X	65°C	✓	36'	38'	0,8	6,0
8	X	X	50°C	67°C	X	X	✓	40'	40'	0,9	10,0
9	cold	X	52°C (ex:55°C)	45°C	X	65°C	✓	108'	110	1,18	18,0

n1045083: Modification of filters on EVO3 60 cm dishwashers


All dishwasher models affected by this modification have been equipped with the items listed below, in order to solve the drain pump clooging problem.

Introduction of:
Cylindrical plastic filter code 081164
Central filter code 054863

Elimination of:
Cylindrical plastic filter code 094164
Central filter code 094156
Central filter grid code 094158

The modification has been introduced progressively, starting from serial no. 40516.0001.

N1045083FIG1

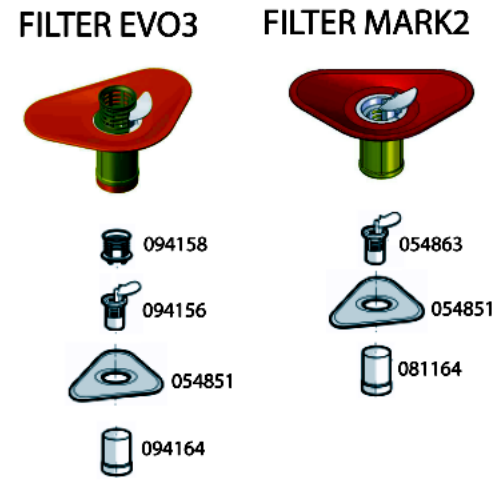

n1045084: Elimination of duct fixing pin code 056342

Duct fixing pin code 056342 has been eliminated from all dishwashers affected by this note, modifying the connection between the feeder-distribution assembly and the internal duct.

Introduced items:
Internal duct 110527
Feeder-distribution assembly 110526

Eliminated items:
Internal duct 054926
Feeder-distribution assembly 094134 (EX 054871)
Duct fixing pin 056342

The modification has been introduced progressively, starting from serial no. 40517.0001.

n1045085: Introduction of new litre counter turbine integrated on air-break.

All dishwashers affected by this note have been equipped with a new litre counter turbine on the air-break.
Picture N1045085FIG1 illustrates the premodification structure, picture N1045085FIG2 the new structure.

Items affected by the modification.

AIR-BREAK:
new 110610;
premodification 094174;
the new item features a new integrated litre counter turbine and its water supply hose has a smaller diameter.

LITRE COUNTER TURBINE code 094172 has been eliminated.

SOLENOID VALVES:
new:
1-WAY code 110611;
2-WAY code 084558(Rohs 143737);
premodification:
1-WAY code 094227;
2-WAY code 094168;
the new solenoid valves have a smaller diameter drain hose fitting.

HOSES:
new solenoid valve hose/air-break code 110612;
premodification turbine hose/air-break code 094267;
premodification solenoid valve hose/air-break code 094267;
the new hose has a smaller internal diameter.

WIRING:
the litre counter turbine connecting cable is longer, but since the connector is the same, the new item can be used in place of the premodification one.


Affected models with related modification introduction serial numbers:
BCI 450 - 30386 s/n 41001.0001;
BFI 620 - 30708 s/n 41001.0001;
BFI 680 - 30715 s/n 40902.0001;
BFV 620 B - 30718 s/n 41001.0001;
BFV 620 K - 30717 s/n 41001.0001;
BFV 620 W - 30719 s/n 41001.0001;
BFV 620 X - 30720 s/n 41001.0001;
DI 6 - 29930 s/n 41001.0001;
DI 620 A - 29932 s/n 40830.0001;
DI 620 - 29931 s/n 41001.0001.
DI 620 UK - 30351 s/n 41001.0001;
DI 630 A - 30369 s/n 41001.0001;
DV 620 BK - 29927 s/n 41001.0001;
DV 620 BK UK - 30349 s/n 41001.0001;
DV 620 K IX UK - 30350 s/n 41001.0001;
DV 620 WH - 29928 s/n 41001.0001;
DV 620 WH UK - 30348 s/n 41001.0001;
DV 630 A BR - 30695 s/n 40830.0001;
DV 630 A IX - 30693 s/n 40830.0001;

DV 630 A WH - 30694 s/n 40830.0001;
DV 640 A IX - 30368 s/n 40830.0001;
DV 650 A IX - 30696 s/n 40830.0001;
DV 650 A WH - 30697 s/n 40830.0001;
DV 670 A BR - 30701 s/n 40830.0001;
DV 670 A IX - 30699 s/n 40830.0001;
DV 670 A WH - 30700 s/n 40830.0001;
DV 620 IX - 29929 s/n 40531.0001;
DVG 621 BK - 33220 s/n 40830.0001;
DVG 621 IX - 33212 s/n 40830.0001;
DVG 621 WH - 33221 s/n 40830.0001;
DWM 55 A - 29793 s/n 41001.0001;
DWT 10 P.2 - 32228 s/n 40830.0001;
FDW 20 P - 33182 s/n 41001.0001;
FDW 80 G - 33189 s/n 41001.0001;
FDW 80 P - 33187 s/n 41001.0001;
FDW 80 T - 33188 s/n 41001.0001;
FDW 85 A - 33190 s/n 41001.0001;
FDW 60 G - 33185 s/n 41001.0001;
FDW 60 P - 33183 s/n 41001.0001;
FDW 60 T - 33184 s/n 41001.0001;
FDW 65 A - 33186 s/n 41001.0001;
IDE 100 (EU) - 30666 s/n 41001.0001;
IDE 100 S (IT) - 30216 s/n 41001.0001;
IDE 100 SK - 30758 s/n 41001.0001;
IDE 1000 UK - 30044 s/n 41001.0001;
IDE 1005 S UK - 30045 s/n 41001.0001;
IDE 44 EU - 30423 s/n 40911.0001;
IDE 44 UK - 30394 s/n 40916.0001;
IDL 40 DE - 32308 s/n 41001.0001;
IDL 40 EU - 30417 s/n 41001.0001;
IDL 40 FR - 30403 s/n 41001.0001;
IDL 40 S UK - 31956 s/n 41001.0001;
IDL 40 UK - 30393 s/n 41001.0001;
IDL 42 DE - 32309 s/n 40830.0001;
IDL 42 EU - 30419 s/n 40911.0001;
IDL 42 FR - 30404 s/n 40911.0001;
IDL 50 EU.2 - 32006 s/n 40916.0001;
IDL 50 SK.2 - 32221 s/n 41001.0001;
IDL 500 FR - 30014 s/n 40916.0001;
IDL 505 S UK.2 - 32001 s/n 41001.0001;
IDL 51 (EU) - 31075 s/n 40906.0001;
IDL 51 EU.2 - 32217 s/n 40906.0001;
IDL 55 (DE) - 30561 s/n 40909.0001;
IDL 55 (EU) - 30634 s/n 40916.0001;
IDL 55 (IT) - 30212 s/n 40916.0001;
IDL 55 DE.2 - 32220 s/n 40909.0001;
IDL 55 EU.2 - 32215 s/n 40917.0001;
IDL 55 S (DE) - 30565 s/n 40909.0001;
IDL 55 S (IT) - 30213 s/n 40916.0001;
IDL 55 S DE.2 - 32224 s/n 40909.0001;
IDL 57 (PT) - 31086 s/n 40916.0001;
IDL 60 (EU) - 30644 s/n 40909.0001;
IDL 60 (IT) - 30214 s/n 41001.0001;
IDL 60 EU.2 - 32216 s/n 40909.0001;
IDL 60 NL.2 - 32219 s/n 41001.0001;
IDL 60 S (EU) - 30647 s/n 40909.0001;

IDL 60 S EU.2 - 32225 s/n 40909.0001;
IDL 60 SK - 30755 s/n 41001.0001;
IDL 60 SK.2 - 32222 s/n 41001.0001;
IDL 61 (EU) - 30680 s/n 41001.0001;
IDL 61 EU.2 - 32218 s/n 41001.0001;
IDL 62 (EU) - 30686 s/n 40911.0001;
IDL 62 EU.2 - 32223 s/n 40911.0001;
IDL 63 S NL.2 - 32226 s/n 41001.0001;
IDL 70 (EU) - 30654 s/n 40902.0001;
IDL 70 (IT) - 30215 s/n 41001.0001;
IDL 70 D EU - 30600 s/n 41001.0001;
IDL 700 FR - 30016 s/n 41001.0001;
IDL 700 UK - 30042 s/n 41001.0001;
IDL 7021 (SP) - 30603 s/n 40902.0001;
IDL 710 FR - 30017 s/n 41001.0001;
IDL 75 (EU) - 30661 s/n 41001.0001;
IDL 75 EU.2 - 32627 s/n 41001.0001;
IDL 75 S (EU) - 30604 s/n 41001.0001;
IDL 75 S EU.2 - 32845 s/n 41001.0001;
IDL B2 EU - 32271 s/n 40917.0001;
IDL 500 UK.2 - 31984 s/n 40524.0001 ;
IDL 50 EU - 30217 s/n 40531.0001;
IDL 550 FR - 30015 s/n 40531.0001;
IDL 705 SUK - 30043 s/n 40531.0001;
L 6047 FR - 33150 s/n 40830.0001;
L 61 (IT) - 28169 s/n 40917.0001;
L 61 AG - 29907 s/n 40917.0001;
L 61 EU - 28470 s/n 40917.0001;
L 63 (IT) - 28453 s/n 41001.0001;
L 63 AUS - 29912 s/n 41001.0001;
L 63 EU - 29544 s/n 40909.0001;
L 63 SK - 31080 s/n 41001.0001;
L 63 SK.2 - 32227 s/n 41001.0001;
L 63 X (IT) - 28904 s/n 41001.0001;
L 63 X AUS - 29913 s/n 41001.0001;
L 64 AUS - 29914 s/n 41001.0001;
L 64 X AUS - 29915 s/n 41001.0001;
LD 85 (IT) - 28454 s/n 41001.0001;
LD 85 X (IT) - 28457 s/n 41001.0001;
LD 87 (IT) - 28455 s/n 41001.0001;
LD 87 EU - 28473 s/n 41001.0001;
LD 87 FR - 29285 s/n 41001.0001;
LD 87 X (IT) - 28458 s/n 41001.0001;
LD 87 X AUS - 29918 s/n 41001.0001;
LD 87 X EU - 28474 s/n 41001.0001;
LD 87 X SK - 29692 s/n 41001.0001;
LI 420 - 30392 s/n 40830.0001;
LI 460 - 30370 s/n 40830.0001;
LI 480 A - 30371 s/n 40830.0001;
LI 660 A - 30304 s/n 40830.0001;
LI 700 DUO - 29515 s/n 40830.0001;
LI 620 - 29511 s/n 40714.0001;
LI 640 A - 29512 s/n 40531.0001;
LI 670 DUO - 29513 s/n 40603.0001;
LI 680 DUO - 29514 s/n 40607.0001;
LIQ 700 DUO JADE - 29952 s/n 40830.0001;
LL 40 EU - 30408 s/n 41001.0001;

LL 42 EU - 30411 s/n 40907.0001;
LL 420 FR - 30397 s/n 40907.0001;
LL 43 S EU - 30412 s/n 40907.0001;
LL 62 FR - 30614 s/n 41001.0001;
LL 62 X FR - 30615 s/n 41001.0001;
LL 63 EU - 29909 s/n 41001.0001;
LL 63 FR - 28460 s/n 41001.0001;
LL 63 TK - 28471 s/n 41001.0001;
LL 63 X EU - 30174 s/n 41001.0001;
LL 64 X AUS - 29917 s/n 41001.0001;
LL 64 77 - 31940 s/n 41001.0001;
LL 64 AG - 29908 s/n 40920.0001;
LL 64 AUS - 29916 s/n 41001.0001;
LL 64 DE - 31941 s/n 41001.0001;
LL 64 EU - 29545 s/n 41001.0001;
LL 64 SK - 29690 s/n 41001.0001;
LL 64 X EU - 29546 s/n 41001.0001;
LL 65 (IT) - 28903 s/n 41001.0001;
LL 65 EU - 29547 s/n 40906.0001;
LL 65 FR - 28462 s/n 41001.0001;
LL 65 TK - 28472 s/n 41001.0001;
LL 65 X EU - 29910 s/n 40906.0001;
LL 65 X FR - 29284 s/n 41001.0001;
LL 6546 FR - 33151 s/n 40916.0001;
LV 460 A BK - 30379 s/n 40830.0001;
LV 460 A IX - 30377 s/n 40830.0001;
LV 460 A WH - 30378 s/n 40830.0001;
LV 460 BK - 30375 s/n 40920.0001;
LV 460 IX - 30372 s/n 40920.0001;
LV 460 WH - 30373 s/n 40920.0001;
LV 620 BK - 29939 s/n 41001.0001;
LV 620 IX - 29941 s/n 41001.0001;
LV 620 WH - 29940 s/n 41001.0001;
LV 640 A BK - 29942 s/n 40902.0001;
LV 640 A IX - 29946 s/n 40902.0001;
LV 640 A R AN - 29944 s/n 40902.0001;
LV 640 A R OW - 29945 s/n 40902.0001;
LV 640 A WH - 29943 s/n 40902.0001;
LV 650 A ALU - 29922 s/n 41001.0001;
LV 650 A BK - 29925 s/n 41001.0001;
LV 650 A IX - 29921 s/n 41001.0001;
LV 650 A OW - 29923 s/n 41001.0001;
LV 650 A WH - 29924 s/n 41001.0001;
LV 660 A BK FR - 30300 s/n 40902.0001;
LV 660 A IX FR - 30301 s/n 40902.0001;
LV 660 A WH FR - 30299 s/n 40902.0001;
LV 670 DUO ALU - 29926 s/n 41001.0001;
LV 670 DUO AN - 29947 s/n 41001.0001;
LV 670 DUO IX - 29948 s/n 41001.0001;
LV 670 R AN - 30302 s/n 40830.0001;
LV 670 R OW - 30303 s/n 40830.0001;
LV 680 DUO IX - 29949 s/n 41001.0001;
LVI 12-44 AN - 29564 s/n 40830.0001;
LVI 12-44 IX - 29562 s/n 40830.0001;
LVI 12-44 WH - 29563 s/n 40830.0001;
LVI 12-55 AN - 29567 s/n 41001.0001;
LVI 12-55 IX - 29565 s/n 41001.0001;


LVI 12-55 WH - 29566 s/n 41001.0001;
LVI 12-66 AN - 29570 s/n 41001.0001;
LVI 12-66 IX - 29568 s/n 41001.0001;
LVI 12-66 M BA - 29573 s/n 41001.0001;
LVI 12-66 M GI - 29571 s/n 41001.0001;
LVI 12-66 M VA - 29572 s/n 41001.0001;
LVI 12-66 WH - 29569 s/n 41001.0001;
LVO 670 DUO IX - 30848 s/n 40830.0001;
LVO 680 DUO IX - 29951 s/n 40902.0001;
LVR 640 A AN - 33614 s/n 40902.0001;
LVR 640 A OW - 33615 s/n 40902.0001;
LVR 670 AN - 33616 s/n 40830.0001;
LVR 670 OW - 33617 s/n 40830.0001;
LVTI 12-55 - 29574 s/n 41001.0001;
LVTI 12-66 - 29575 s/n 41001.0001;
SDW 60 P - 31010 s/n 40906.0001;
XLV 670 DUO IX - 29950 s/n 41001.0001.

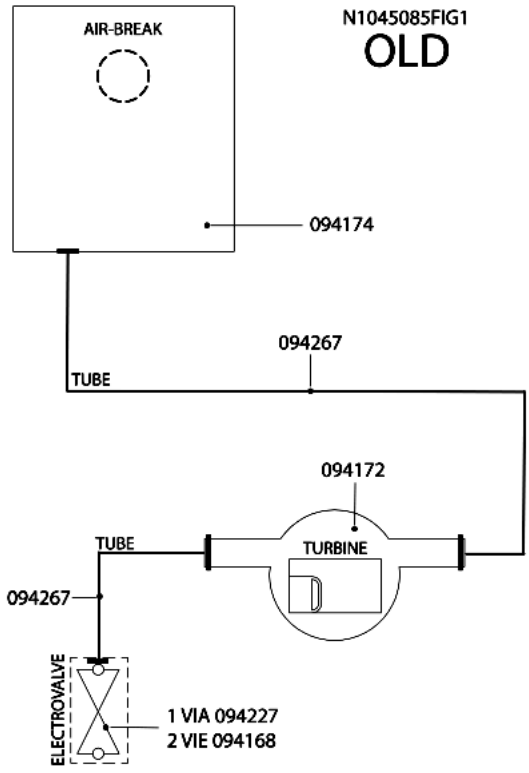

n1045098: Different position of electric distributor.

The position of the electric distributor has been changed as shown in the attached illustration.
The new machines have a new industrial code.

Introduced items:
C00109659 upper rack
C00109698 inside door

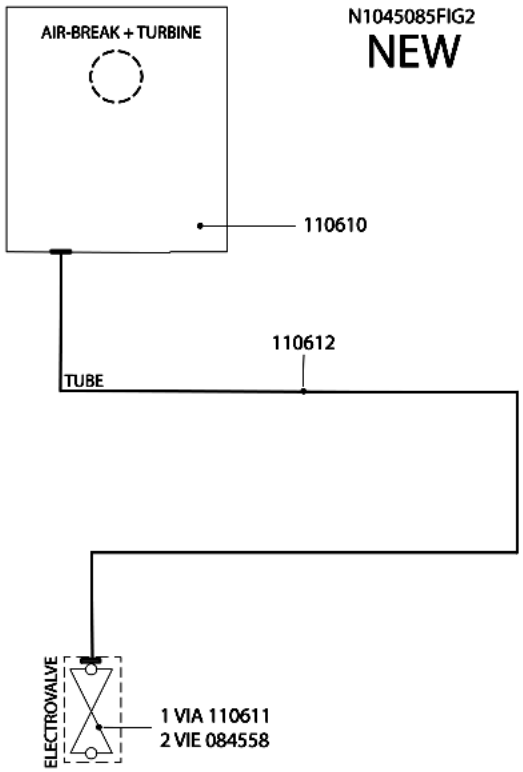

Premodification items:
C00097164 upper rack
C00095276 inside door

The following list shows the affected models with the relevant modification start serial numbers.

cc 29931 s/n 40330.0001 DI620
cc 30369 s/n 41021.0001 DI630A
cc 30350 s/n 41029.0001 DV620KIXUK
cc 29929 s/n 41102.0001 DV620IX
cc 29932 s/n 41103.0001 DI620A
cc 30348 s/n 41102.0001 DV620WHUK
cc 30351 s/n 41103.0001 DV620UK
cc 29930 s/n 41123.0001 DI6
cc 30349 s/n 41127.0001 DV620BKUK


n1045127: New airbreak - solution of water spurts leaking from base LVS 60 CM

From serial number 50930.0001, to solve the problem of water spurts emitted from the lower right and left side of the door the following modifications were introduced in production:

1-Airbreak without insert to allow the necessary pressure venting
2-Honeycomb top panel to protect the kitchen unit from any steam emitted (only on built-under models)
3-Tank seal length increased by 3 cm to improve water tightness
4-Die-cut roof sound-deadening panel
5-Three clips for correct fixing of the tank base seal (in production from serial number 50701.0001)

N1045076FIG1

Mark II

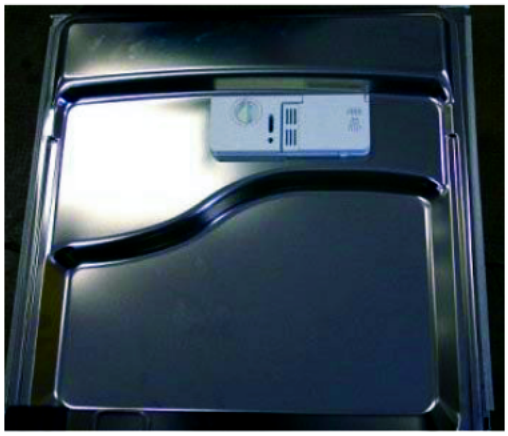

New parts:
C00141308 - Airbreak
C00141310 - Honeycomb top panel (built-under versions only)
C00141317 - Tank seal
C00141314 - Roof sound-deadening panel
C00140679 - Tank base seal fixing clip

Premodification parts
C00110610 - Airbreak
C00116110 - Tank seal
C00097300 - Roof sound-deadening panel


1) AIRBREAK REPLACEMENT
It is mandatory to use the new part; in the event of replacement with premodification appliances proceed as follows:
- replace the airbreak with the new part C00141308
- if present, refit the roof sound-deadening panel after cutting out a 10x10 cm square from the rear left-hand corner
- on the built-under version, fit honeycomb panel C00141310 on the top of the appliance
- replace tank seal with the new seal P/N C00141317

WARNING: when replacing an airbreak without a litre-counter turbine use exclusively the same type of part (P/N C00094174 - all the relevant details are given in bulletin n1045085)

2) CHANGING THE TANK SEAL
On appliances with serial number from 40101.0001 to 50930.0001, you can use the new tank seal P/N C00141317 after cutting 1.5 cm off each end.

Electric schemes and links

Cod. 16001674500

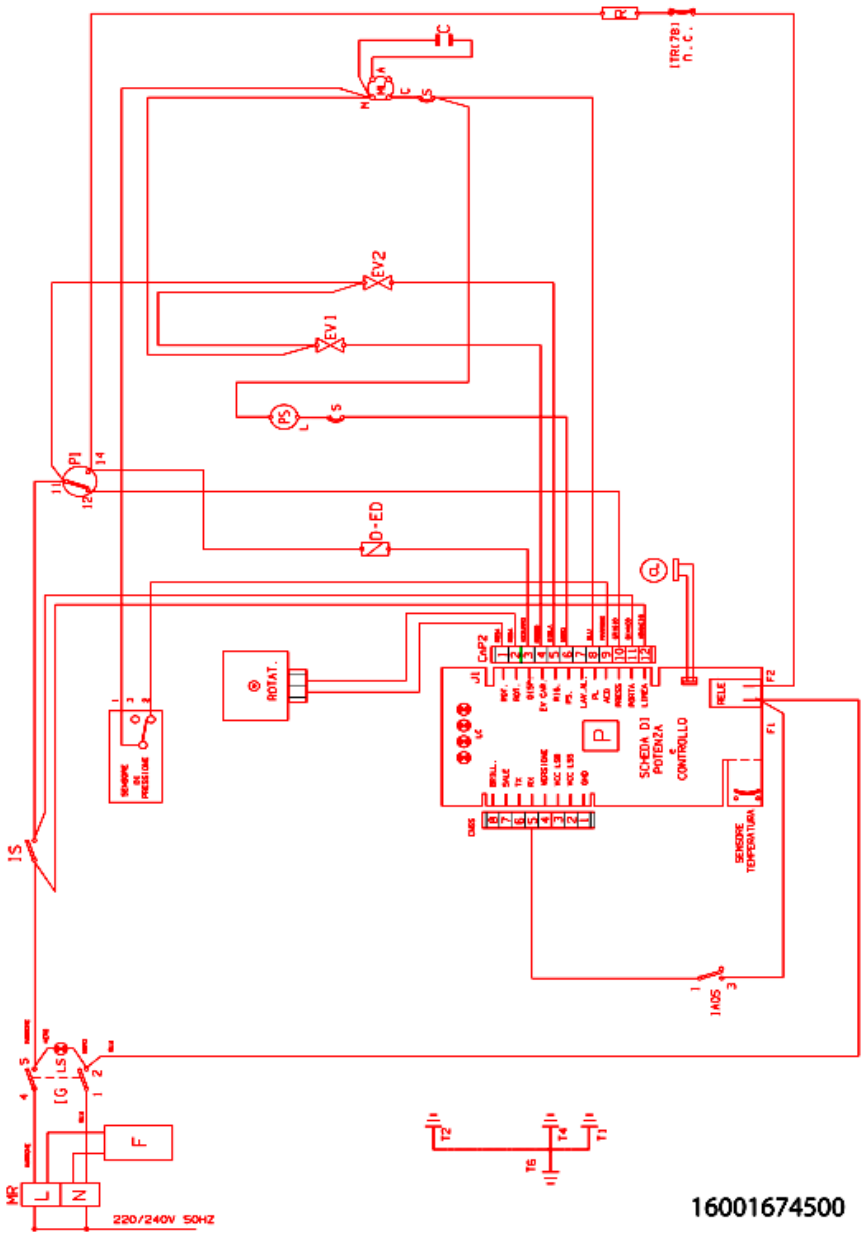

Legend

Legend: 16001674500

A..	Timer contact	LPA	Door open
AQS	Aquastop electrovalve	LPR	Prewash LED
B..	Timer contact	LRI	Rinse LED
C	Condensor	LS	Mains LED -Pilot lampe On/Off
C..	Timer contact	LSB	Polisher LED
CL	Slow cam	LSC	Cycle ranning lamp
CM	Wash pump motor connector	LSE	Acquastop LED
CN	Connector	LSS	Salt LED
CV	Fast cam	LV	Fan off lamp
D-ED	Dispenser - Electric dosing device	M	Terminal box
D..	Timer contact	MB	Polisher dip-switch
DB	Brightener dispenser	ME	Acquastop dip-switch
DD	Display - Detergent dispenser	ML	Wash motor
E1	Cold water electrovalve	MM	Handle dip-switch
E2	Regeneration electrovalve	MP	Door dip-switch
E3	Hot water electrovalve	MR	Delay-timer motor - Terminal board
ECO	Saving switch	MT	Timer motor
ED	Detergent/Brightener dispenser	MTR	Fast forward timer motor
EV1	Cold water electrovalve MM- Handle dip-switch	MV	Motor fan
EV1/2	Half-load electrovalve	P	Pressure switch
EV2	Regeneration electrovalve	P..	Pressure switch contact
EV3	Hot water electrovalve	P1	Stage 1 pressure
EVC	Hot water electrovalve	P2	Stage 2 pressure switch
EVF	Cold water electrovalve	PAP	High pressure switch
EVR	Regeneration water electrovalve	PO	Overflow pressure switch
F	Anti-interference filter ML- Wash motor	PS	Drain pump
FA	Radio interferences	PULS	Push-button panel
I1	On/Off switch - Plus cycle switch -IEC cycle	R	Heating element
I1/2	Switch half-load	R.D.	Delay rotary selector
I2	Fast switch -IEC cycle switch (standard) -	RA	Heating element drying
I2H	2-hour delay switch	ROT D	Delay rotary selector
I3	Saving switch- Switch for cycle with no pre-	ROT.	Rotary selector
I4	Switch for cycle fresh dirty	S	Motor overload cutout

I4H	4-hour delay switch	SC	Selector cycli
I5-ICR	Fast cycle switch	SS	Salt detector
I6	Soak cycle switch	ST	START
I6H	6-hour delay switch	T..	Delay-tymer contact
IAQS	Aquastop switch	T1	Power supply earth cable -Thermostat 45?C
ID	Switch display	T2	Lid earth -Thermostat 55?C
IE	Saving switch	T3	Timer earth -Thermostat 65?C
IEXD	Exstra dray switch	T36	36?C N.O. Thermostat
IG	Main switch	T4	Heating element earth
IMV	Off motor fan switch	T46	46?C N.O. Thermostat
IP	High temperature switch	T5	Drain pump earth
IS	Cut-off switch	T57	57?C N.O. Thermostat
ISB	Polisher led switch	T6	Wash motor earth
ISS	Salt LED switch	T8	External lid earth
ITR	Heating element switch	TE	Relay switch
L	Mains LED	THP	Thermoprotector
L1	Cycle 1 lamp	TM	Timer
L1/2	Lamp cjcle half-load	TS	Safety thermostat
L2	Cycle 2 lamp	TS 40	Thermostat 40 ?C
L3	Cycle 3 lamp	TS 50	Thermostat 50 ?C
L4	Cycle 4 lamp	TS 62	Thermostat 62 ?C
L5	Cycle 5 lamp	TS1	Min. temperature thermostat
L6	Cycle 6 lamp	TS2	Max. temperature thermostat
LA	Drying LED	TT	Terminal box support earth
LAQ	Aquastop on lamp	Tcp	nner-door earthing connection
LC	Cycle ranning lamp	Tfa	Radio interference
LD	Delay activated lamp	Tml	Pump wash motor earthing connection
LE	Saving cycle	Tpg	Large door earthing connection
LH2	2-hour delay lamp	Tpi	Inspection door earthing connection
LH4	4-hour delay lamp	Tpr	Pressure switch
LH6	6-hour delay lamp	Tps	Discharge pump earthing connection
LL	Wash LED	Tr	Heating element
LP	High temperature LED	Tte	Delay-timer earthing connection