
INDESIT company

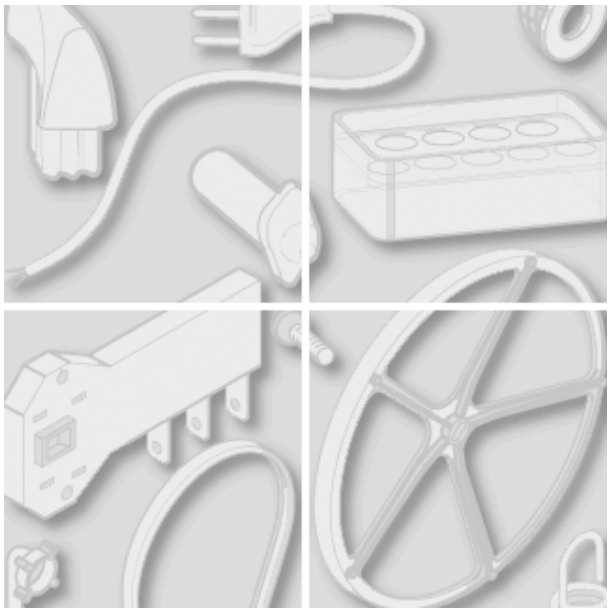

Model type:
WI82EX

Commercial code:
F030353

General notes

Technical Documentation guidelines

You can find herewith some generic information to simplify cunsulting of technical documentation:

1. Models of same range share the same exploded views, which report the richest set of spare parts:generally, a model does not necessarly have a related spare part for each particular shown on exploded views.

2. Some spare parts can not be represented directly on the exploded views (instruction booklets, specific kit, etc...). You can find those codes in the spare parts list with the same reference of particular where spares are installed or with references 099, 999. Instruction booklets, once managed, appear with 000 reference.

3. On the higher right site of each exploded view there is a serial number which indicates the beginning of the production of certain range:some models might have more than an exploded view for a given category, each distinguished by a different serial no.and linked to another spare parts list, In this case, serial no. is required to supply the right spare part code. Exploded view to be considered is the one with a more recent serial no. but previous than the one of the model that needs assistance.

4.Exploded views might require further updates even after publishing. Addition of new spares will go on following the already existing numeration references. Revision number of an exploded view is shown into last four digits of serial number into upper right hand corner.

5.The spare parts list associated to an exploded view shows related codes of spares managed for a certain model; for each spare part other informations are available:

REF: reference no of spare into a table; SUBSTITUTE: list of spare(s) which can replace a code but that keeps same functional characteristics


INDUSTRIAL CODE: list of variables of a model (shown into model label) where such spare is used; NOTICE: code of information(s) to refer to complete technical intervention, track for changes or to find correct spare part code.

6. Some notices, into a same section are generic therefore cannot be directly linked to a spare part. In order to assist a model in the best way as possible, it is helpful to pay attention to all notices and constantly verify documentation updates

7.Technical documentation cover shows model name and its commercial codes

1180170 Exploded views

Matr. 30901.0002

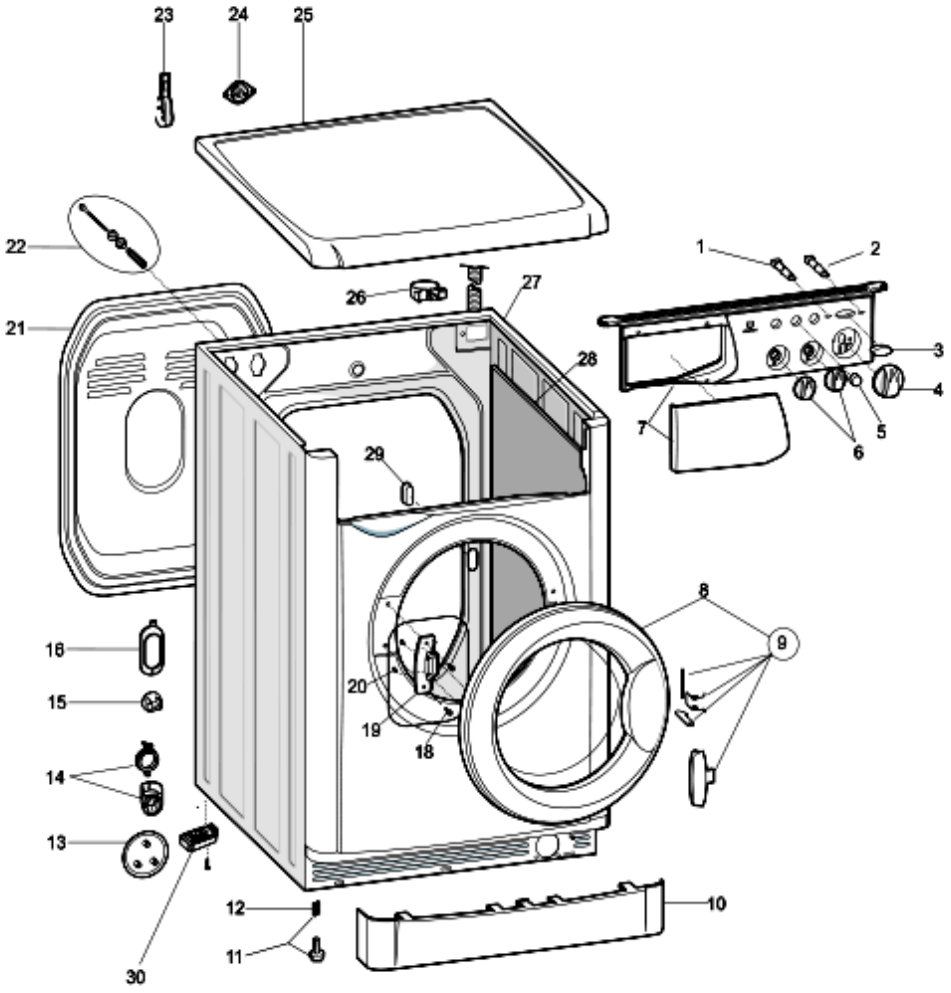

1180170


1180170 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
000	C00098553				user instruct.bookl e-gb-f-p-cz-sk		
000	C00098554				user instruct.bookl ro-pl-hu-sl-hr		
000	C00098555				user instruct.bookl rs-bg-sb-ar-al-		
001	C00096881			1 x C00112262	pilot light red 230v ra2,5 ind.		
002	C00096882				pilot light red 12v r 2,5 indes.		
003	C00096858				pushbutton white 27 on/off	n1040356	46303530000
003	C00115930				pushbutton white pw on/off		46303530900
004	C00096856				wash timer knob white 27	n1040356	46303530000
004	C00115929				wash timer knob white pw		46303530900
005	C00096967				pushbutton white 27 indes.tev.	n1040356	46303530000
005	C00115931				pushbutton white pw indes.tev.		46303530900
006	C00096857			1 x C00115924	components knob white 27 ind.	n1040356	46303530000
006	C00115924				knob white		46303530900
007	C00098556				control panel + handle wi82ex	n1040356	46303530000
007	C00116340				control panel & handle pw wi82ex		46303530900
008	C00096860			1 x C00115842	door frame b27 and glass assy	n1040356	46303530000
008	C00115842				door frame & glass assy		46303530900
009	C00096865				door handle kit		
010	C00096855			1 x C00115813	plinth white ind. tev. evoii	n1040356	46303530000
010	C00115813				plinth white		46303530900
011	C00143730			1 x C00264036	foot m8 h=2,9 cm rohs thread 8	n4007j00	
012	C00059869				spring for foot d =11 mm h = 21		
013	C00089803				blanking plug d = 53 mm		
014	C00064755				drain hose collar		
016	C00044085				plug cabinet		
018	C00096210				screw self tapping		
019	C00075325			2 x C00096210 1 x C00255430	hinge door 3.5 mm indesit		
020	C00065185				bolt m4,5 x 8		
021	C00046924				rear cover white	n1040356	46303530000
021	C00115812				rear panel white pw		46303530900
022	C00058925				spacer		
022	C00065879				bolt		
024	C00083796				cap for electrovalve		
025	C00096859			1 x C00115814	worktop - white ind.tev. evoii	n1040356	46303530000

1180170 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
025	C00115814				worktop - white		46303530900
026	C00019685				drain hose hook		
027	C00096852			1 x C00115811	cabinet white evo ii tev ind.	n1040356	46303530000
027	C00285207				cabinet white pw indesit (1 hole)		46303530900
029	C00084817				blanking plate-rear(test plug)		
030	C00254045				back foot - rear h= 10 mm	n4007j00	


1180250 Exploded views

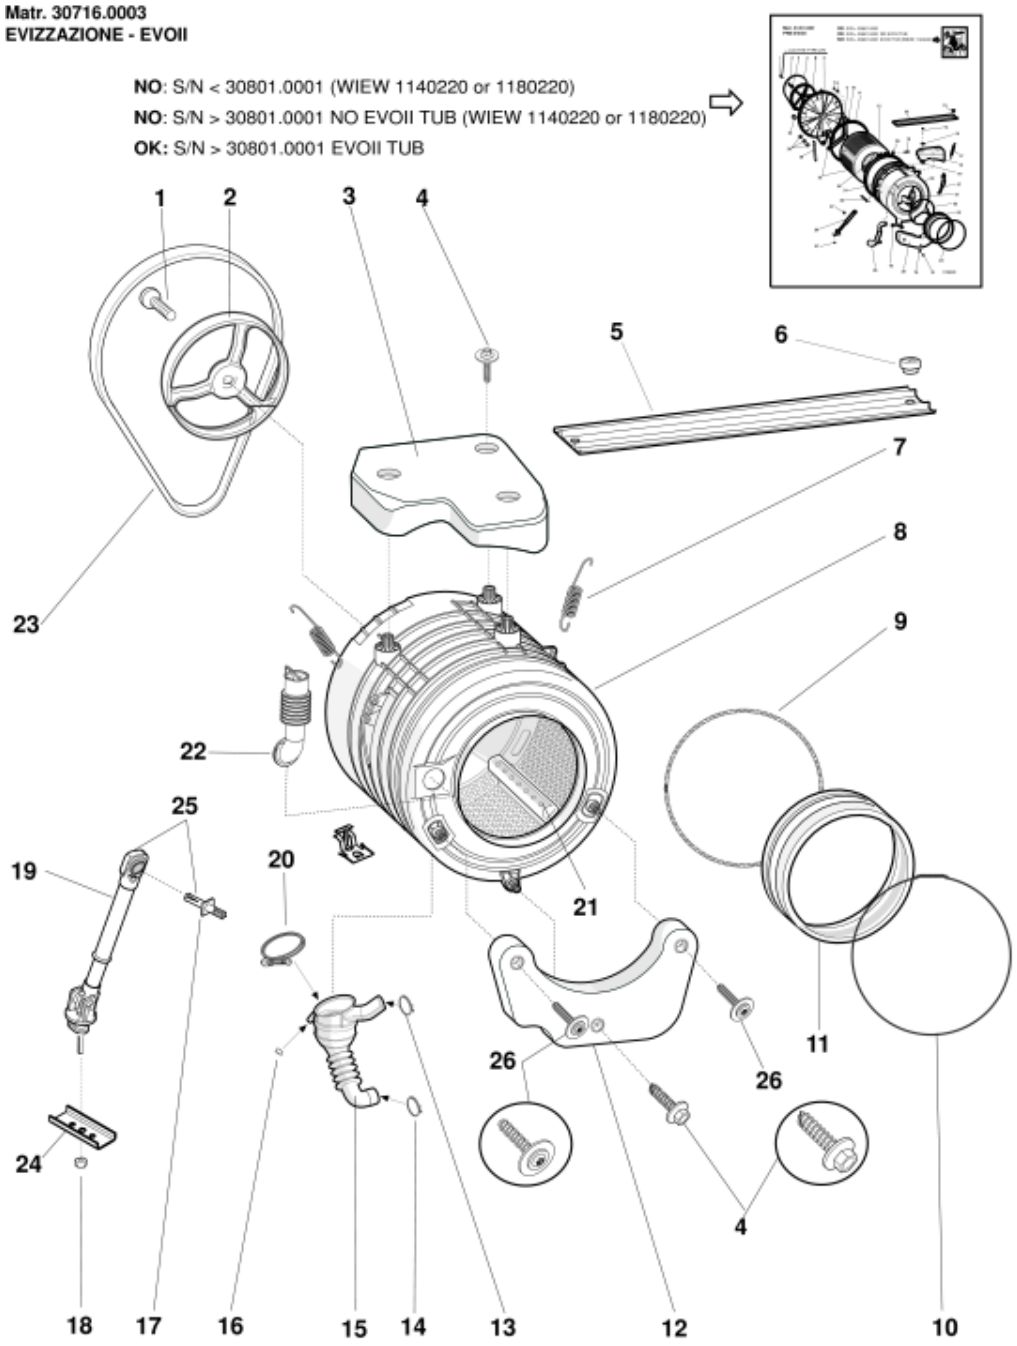

1180250 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
001	C00064786			1 x C00143260	bolt m8x23 torx tefl		
002	C00064527				drum pulley cone d=280 mm h=	n1040305	
002	C00097268				drum pulley d=280 mm h=15 mm	n1040318	
003	C00094710				top ballance weight 15kg		
004	C00094741			1 x C00118612	screw locking counterweight/tub		
004	C00194611				screw.pl28 9.5x50 tmtfr t40	n4011c00	
005	C00055397				tank cradle channel top		
006	C00047133				spring support top white 1 per pick		
007	C00096195				suspension spring		
008	C00113810				46l plastic tank/pulley		
009	C00092155				door seal- rear retainer		
010	C00092156				door seal retainer front		
011	C00092154		41231...		door seal		
011	C00111416	50101...			door seal (30cm) (hl)		
012	C00094711				front ballance weight 9,4kg		
013	C00008612				tube clamp 34,6-36,4		
014	C00092411			1 x C00094908	hose clamp		
015	C00092174				hose tank to filter with oko ball		
017	C00055037				plastic expansion rivet	n1040372	
017	C00118593			1 x C00280757	plastic expansion peg		46303530000 46303530900
018	C00065152				nut romob m6x22x1,5		
019	C00097259			1 x C00140744	shock absorber 100 n	n1040372	
020	C00094908				hose clamp		
021	C00065463				lifter 40 - 46l		
022	C00066183				hose dispenser to tank		
023	C00082318				belt hutchinson 8phe 1195		
024	C00110233				cabinet plate		
025	C00140744				shock absorber 100 n kit		46303530000 46303530900
026	C00194612				screw larger diameter 11.3x50 kit	n4011c00	
099	C00001109				loctite 270 10 gr.		
099	C00033026			1 x C00292523	ambljgon grease ta 100 gr.		

1180330 Exploded views

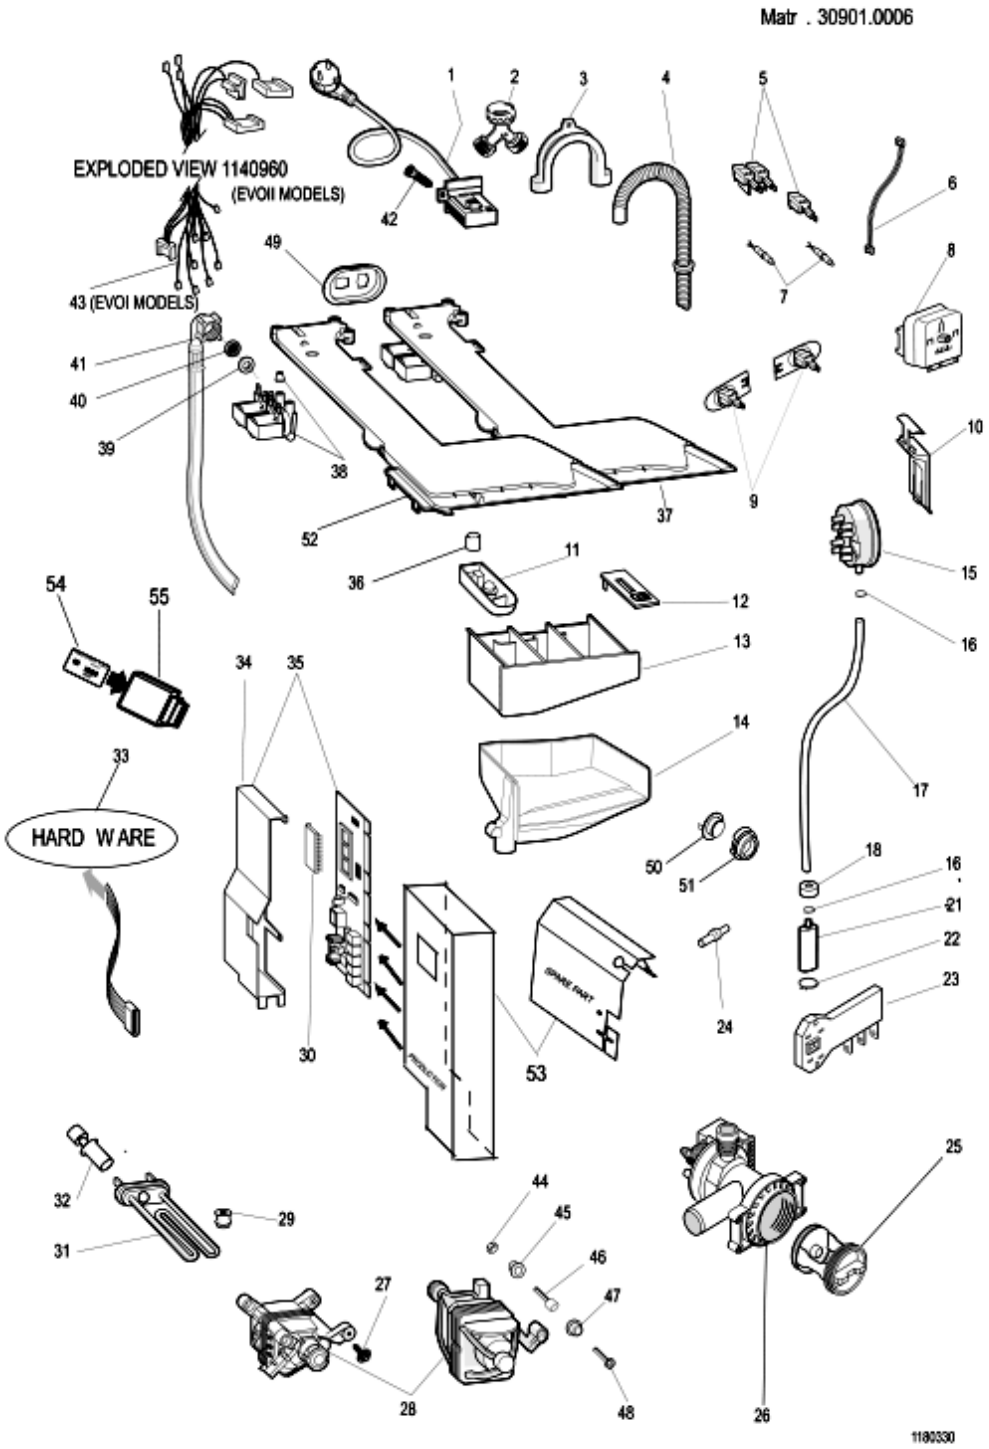

1180330 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
001	C00091633				supply cable 3x1 schuko		
003	C00019902				plastic -u- to make drain hose		
004	C00027466				drain hose - to sink l=1860mm		
005	C00063971				on-off switch		
005	C00088394				push button switch na idc		
007	C00096881			1 x C00112262	pilot light red 230v ra2,5 ind.		
007	C00096882				pilot light red 12v r 2,5 indes.		
008	C00083916				programme selector (idc elbi) (hl)		
009	C00085195			1 x C00143096	potentiometer 8 pos. idc rast 2,5		
010	C00050186				bracket - pressure switch		
012	C00047069			1 x C00097834	additive cover		
013	C00075352			1 x C00097732	soap dispenser drawer		
014	C00081560			1 x C00097732	dispenser body		
				1 x C00099206			
015	C00096880				pressure switch (hl)		
016	C00092412				hose clamp		
017	C00094746				pipe pressostat l=505		
021	C00092173				air trap x oko		
022	C00008612				tube clamp 34,6-36,4		
023	C00065185				bolt m4,5 x 8		
023	C00085194				door interlock		
025	C00045023				filter handle		
025	C00045025				filter seal		
025	C00045027				pump filter kit		
026	C00085618			1 x C00119307	self cleaning pump 240v./50hz.idc		
027	C00094744				screw locking motor/tub		
028	C00056962				motor ice 850/1000 rpm (hl)	n1040258	
029	C00058523				pillar retainer-heating element		
030	C00098552				eeprom wi82ex evoi s/w		
031	C00094715				heating element 1700w		
032	C00083915				thermistor ntc		
033	C00066292				insulated tweezers		
033	C00084943			1 x C00099862	serial cable lb2000 - pc	n1040317	
033	C00095669			1 x C00145046	hardware key mk1	n1040317	
034	C00086717				bracket for module		

1180330 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
034	C00086718				support cover		
035	C00084838			1 x C00093157	universal module (less eeprom)		
037	C00096877			2 x C00064534	hopper cover 1e 2u ind.evoii tev		
				1 x C00110333			
				1 x C00115294			
038	C00064534				seal - dispenser to valve		
038	C00110333				fill valve 2 way (7lt rst 2.5)		
039	C00005572				sealing washer-mains inlet hose		
040	C00005781				inlet hose filter		
041	C00003070				mains inlet hose cold 25c 10bar		
042	C00092348				self-scraping screw 3,5x8		
043	C00098557				wiring idc		

Notices

n1040061: Trouble-shooting.

Intervention procedure on 2000 washing machines

1. Reading the error code

The fault on the appliance is signalled via:
1. the continuous rotation of the selector knob
2. the action, for the first 4', of the electrovalve and the drain pump
3. the door becomes unlocked
4. the led flashes:
the number of flashes indicates the fault code; the code should be read as follows:
· each fast flash (2/3 flashes of the led very close together) represents one code value
· the fault code is evaluated by counting the number of flashes occurring at 3/4" intervals from one another
· stop counting when the washing machine waits the equivalent of approximately 8/9" between flashes
· the procedure is repeated by the appliance cyclically

E.g.: F03

(FIGURE NT 00)

2. Autotest

Should the washing machine not be signalling an error, you can check it using a serial key and using a particular autotest cycle, which is to be activated as follows:
1. bring the washing machine to reset position (coloured ball) for at least 5" and wait until the led flashes on reset mode
2. insert the hardware key into the serial outlet
3. position the switch situated on the key in TEST position
4. wait for the door to lock and for the selector to start turning
5. position the switch situated on the key in PC position
the appliance will carry out the following cycle:
· selector moves on up to position 0 (12h if the appliance has a delay, programme 1 if it has no delay)
· loads the wash electrovalve for approx. 10"
· loads the pre-wash electrovalve for approx. 10"
· loads the wash electrovalve and pre-wash electrovalve at the same time until the pressure switch is on full
· heats up to 30° and moves the motor in both directions
· selector moves on for 9 notches
· drains and spins
· the selector knob stops on one of the reset positions
· STOP

The test cycle can be repeated as many times as you wish following the same procedures
The test cycle can be interrupted by positioning the selector knob on one of the reset positions.
3. Intervention in the event of a Fault

In the event of a fault, the procedure to go by is as follows:

F01: Triac Short circuit
Overhaul CNE
Replace Card

F02: Blocked Motor, Short-circuited/Open Tachometry
Overhaul CNE
Overhaul Motor connector
Control CNE Continuity/Motor Connector
Control Motor Windings
Control Tachometry Windings
Replace Card

F03: Open/Short-Circuited NTC Found
Overhaul CNA
Control NTC Wiring
Control CNA/NTC Wiring Continuity
Replace NTC
Replace Card

F04: Overflow and Pressure Switch Empty found at the same time (Pressure Switch stuck on Empty)
Overhaul CN1
Overhaul Pressure Switch Contacts
Control CN1/Pressure Switch Continuity
Replace Pressure Switch
Replace Card

F05: Blocked Pump or Pressure Switch stuck on Empty Found
Overhaul CNF (pump connector)
Overhaul Pump Connector
Control Pump Filter
Control Pump Windings
Change Pump
Replace Card

F06: Selector Error (a part no. cannot be found)
Overhaul CND (selector connector)
Overhaul Selector Connector
Control Selector/CND Continuity
Control Selector Motor
Replace Selector
Replace Card

F07: Resistance Relay Stuck
Overhaul CN1
Overhaul CN1
Overhaul Resistance Connection
Replace Card

Overhaul Resistance Connection
Replace Card

F08: Resistance Missing or Pressure Switch stuck on Full Found
Overhaul CN1
Overhaul Resistance Connection
Overhaul Pressure Switch Connection
Replace Resistance
Replace Pressure Switch
Replace Card

F09: Machine Setup Error Found
Control Microprocessor Version
Ask for EEPROM Spare Part indicating Microprocessor version

F10: Pressure Switch Empty and Full or neither Empty nor Full Pressure Switch Found
Overhaul CN1
Overhaul Pressure Switch Wiring
Control CN1/Pressure Switch Continuity
Replace Pressure Switch
Replace Card

F11: Pump Feedback Missing
Overhaul CN1
Overhaul CNF
Overhaul Pump Connector
Overhaul Pressure Switch Connector
Control Pump Windings
Replace Pump
Replace Card

F12 SPECIFIC FOR LVB2000 INDESIT EVOLUTION / DIALOGIC.
F12: Lack of Display card-Main Card Communication
1. Check the effectiveness of contacts on CNC Connector Card
2. Overhaul 8-way connector on Display card
3. Check continuity of CNC-CN 8 way connector
4. Replace Main Card
5. Replace Display Card

F13: NTC wiring harness disconnected from the dryer system
1. Check the efficiency of the terminals on the CNA connector board
2. Check NTC wiring harness
3. Check the wiring harness continuity of the CNA / NTC connectors
4. Replace NTC
5. Replace terminal board

F14: Dryer connector open or not connected
1. Check the efficiency of the terminals on the CNI connector board
2. Overhaul CN1
3. Overhaul connector connection
4. Replace the board.Merloni Elettrodomestici

F15: Dryer connector is always active
1. Check the efficiency of the terminals on the CNI connector board
2. Overhaul connector connection
3. Overhaul the pressure sensor connection
4. Replace the connector

5. Replace pressure sensor
6. Replace the board

F16: Non-functioning basket block
1. Go over connector card CNC
2. Go over connector basket block
3. Control Continuity of cabling CNC / basket block and basket block supply
4. Replace basket block
5. Replace card

N.B.From Fault F01 to fault F11
These are shown by LEDs in stand by/on in LVB2000 machines Ariston/Indesit.
From fault F01 to fault F12
These are shown in a display located on the instrument panel of LVB2000 ma-chines
Evolution Indesit.
From fault F01 to fault F15
Are those that are indicated according to the version via LED stand by/on or
display positioned on the Wash Dry machine Ariston/Indesit panel.

4. Replacing the card

Should you have to replace the card:
· retrieve the EEPROM from the old card
· reassemble the EEPROM onto the new replacement card (without EEPROM)

In the event, and only in this case:
· an F02 has been detected
· the above-mentioned checks have been carried out and no problems have been detected on the wiring or to the motor
· the card fitted onto the washing machine is a 12 or 20 version (the version is indicated by a label on the module-containing box with SW20 or SW12)

you should:
· fit on a new card (version 32 or above)
· fit on an updated EEPROM to request from the assistance service centre, stating the code (e.g. 80xxxxx0000 or 46xxxxx0000), the serial number and the washing machine model.

n1040242: Power card with welded eeprom.

From serial number 20304.0001, IDC power card with welded eeprom is used to ensure the perfect connection of all parts, in the Comunanza, Teverola and Brembate factories.
To replace the module with welded eeprom, it will be necessary to use the eeprom indicated in the SAT document of the model concerned.
To replace the module on a unit with welded eeprom both the SAT module and the eeprom are required, because the latter cannot be reused.

n1040305: Introduction of EVO on LB2000 washing machines produced at Teverola.

Since August 2003, the following modifications are gradually being made to the oscillating unit on 2000 range models produced in the Teverola factory:
Gradual use of the EVOII 40 litre plastic bowl (code 097236) which differs to the previous LB2000 version, for the following characteristics:
1) Assembled with basket and welded bowl lid;
2) Elimination of detergent recovery tube hole (where provided);
3) Diameter 30 cm opening instead of 28 cm;
The last two numbers of the Industrial Code (given on the rating plate) of the models relevant to this system will be 30 (e.g. 46268790030)
This modification has involved the use of a new table for the oscillating unit (1140240) in the documentation of the relevant models, and for the appliances the following parts have been used:

· OKO pump bowl tube (models code 092174);
·Truncated cone window seal 30cm > 28 cm (code 093345);
·Window seal fixing ring bowl side 30 cm (code 092155);
·Upper counterweight (code 094710);
·Front counterweight (code 094711);
·400 litre drum agitator (code 097565);
·Shock absorber 100 N (code 097259) and 120N (code 055039);
·Bowl springs (codes 097753 and 096195)
·Air trap (code 092173);
·Pressure switch tube L = 505 mm (code 94746);
·Linear detergent container (code 097732);
·Product dispenser lid 1E 2U (code 096877 for Indesit and code 097340 for Ariston);
·Solenoid valve 1E 2U (110333 ex 093843);
·Pressure switches:
Code 096880 - Pressure switch one level 100-75 + overflow Rast 5;
Code 097735 - Pressure switch one level 185-80
Code 097746 - Pressure switch two levels 130-100 200-105 RST 5
·Resistance 1700/230 Rast. 2.5 (code 094715);
·Induction motors 2/16 poles (code 066087), 2/12 poles (code 075892) and 2/12 poles 60 Hz (099101);
·Eeproms - The new software for the 40 litre EVO washing machines can also be used on premodification appliances; it is managed with the same Sat codes as the previous software, which is being immediately replaced as the new models enter into production.
·Pulleys - The use of a single 40 litre bowl assembly in Assistance involves management of the pulleys used in production (097268 and 097267) and also those required for creating the various combinations (see fig. n1040305fig.01):

Code 064527 - Pulley D=280mm H=17 mm;
Code 084026 - Pulley D=210mm H=17mm.

NB: From serial no. 31103.0001, all EVO appliances are equipped with a 40 litre bowl with H=15 mm drum cross shaft which will be managed with the same SAT code (097236) as the 40 litre bowl with H=17 mm shaft until stocks last.
To create the various combinations, the following pulleys are required:

Code 097268 - Pulley D=280mm H=15 mm;
Code 097267 - Pulley D=210mm H=15mm.
Exceptions to this are models W93UK (23330) and W103UK (23334) which are equipped with a 46 litre bowl; therefore if the bowl needs replacing code 096198 with 20 mm pulley cross shaft must be used.
In production, pulley code 064527 (diameter D= 280 mm and central hole H= 17mm) is used; therefore, when replacing the bowl, code 097269 (diameter D= 280 mm and central hole H= 20mm) must be used.


·Belts - These vary according to the motor used in the appliance
Code 082318 - Belt EL1000 - 1195H8 X Commutator motors;

Code 081730 - Belt EL600 - 1106J4 X Induction motors 2/16
Code 081785 - Belt EL400 - 1094J4 X Induction motors 2/12

·Synchronous pre-chamber drain pump (code 085618).
·The pressure switch varies according to the motor used in the appliance:
Code 096880 - Pressure switch 1 Level commutator motor;
Code 097735 - Pressure switch 1 Level induction motor 2/12 - 2/16;
Code 097735 - Pressure switch 2 Levels induction motor 2/12 - 2/16;

In particular, the OKO system consists of a spherical plastic component inserted in the tube connecting the bowl to the drain pump. At the beginning of each wash cycle the machine fills water for 10 seconds and activates the drain pump for 2 seconds, thus creating a difference between the water level in the bowl and the water in the drain tube; this difference increases the upward thrust of the ball, closing the bowl-pump connection tube hermetically.
This offers the dual advantage of:
1) separating the wash water and the "dead" water in the drain hose, thus saving energy during the heating phase;
2) ensuring optimal use of all the detergent.
With the introduction of this new component, the detergent recovery tube is eliminated and the pump has only one inlet hole for water from the tank.

FIG. n1040305fig01

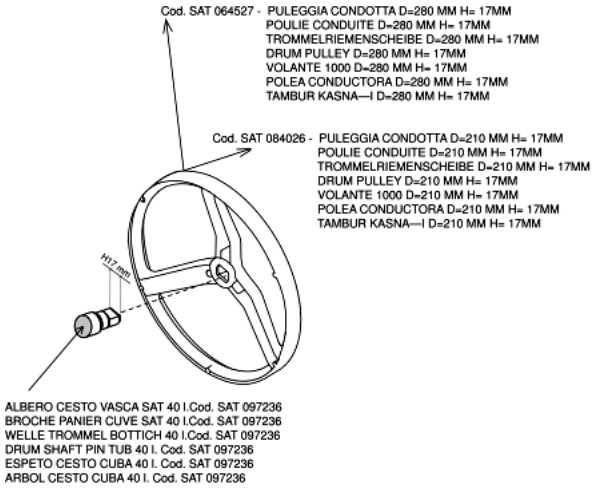

n1040318: 46-litre bowl unit with H= 15 mm basket shaft.

From serial no. 40224.0001, following washing machines produced in the Teverola factory are equipped with the 46-litre bowl unit with 15 mm basket cross shaft in place of 17 mm and the 280 mm diameter pulley with 15 mm central hole Service code 097268 in place of the 280 mm diameter pulley with 17 mm central hole Service code 064527.
The industrial codes of the models affected by this modification remain the same.

Code 30139 - WI8FR
Code 30146 - WIL66IT
Code 30000 - WI10FR
Code 30545 - WIE87EX
Code 39535 - WIL95KW
Code 30353 - WI82EX
Code 30356 - WIL105EX

Code 30354 - WIL85EX
Code 30145 - WIL86IT.
The same modification from serial nos. 40301.0001, 40308.0001 and 40503.0001 also affects the following models:

Serial no. 40301.0001.
Code 30548 WIE107EX
Code 30455 WIL105DE
Code 30526 WIL62EX
Code 29541 W101EX
Code 30223 WIE87IT
Code 30222 WIE107IT.

Serial no. 40308.0001.
28482 - AVL105TK
28479 - AV82TK
28480 - AVL85TK
28481 - AV102TK
28484 - AVD8TK
28485 - AVD10TK
30093 - AVL86PIT
30055 - AVL6EIT
29775 - AVL62EX
30056 - AVL8EIT
30206 - AVL105SK
30357 - AVL100PR
30361 - AVL95AUS
30611 - AVL64EU
30612 - AVL65PT
30490 - WIL81TK
30235 - WILM64IT
30492 - WIL101TK
30488 - WI100TK
30486 - WI80TK
30196 - WI101UK
30523 - WI102AUS
30513 - WI82AUS
30503 - WI62AUS

Serial no. 40503.0001.
29999 - LISA100FR
30092 - AVL66PIT
30144 - WIL106IT.

When replacing the bowl unit on these models the 46-litre unit with H17 mm basket shaft Service code 113810 (already given in the documentation of all 46-litre models) equipped with the 280 mm diameter pulley with H 17 mm hole Service code 064527, must be used.

n1040356: Polar White Factory 46 (Teverola)

From serial no. 50228.0001, the new "Polar White" is used on all washing machines produced in factory 46 in place of White 27.
The third last number of the Industrial Code given on the rating plate of the modified models is 9 (e.g. 46302230900).
To determine the new Polar White codes, it is necessary to know the industrial code or serial number of the appliance being repaired.
The new items, which bear the initials "PW" in place of "B27", are not aesthetically interchangeable with premodification items as the whites are different. Both colours will be available for some time.
The items affected by this modification are:
Body, rear panel, top, control panel, handles, buttons, knobs, knob disc, door and plinth.

n1040372: Introduction of new shock absorbers and expanders.

From serial no. 50725.0001, new shock absorbers and expanders have been introduced.

New codes:
C00140670 - shock absorber
C00118593 - expander

Premodification codes
C00097259 - shock absorber
C00055037 - expander

The new items can also be used (but not separately) when replacing shock absorber 100N - C00097259; in this case, it will be necessary to replace both shock absorbers / expanders using kit C00140744, which is composed of two new shock absorbers and two new expanders.

List of appliances affected by this modification
22484AB84PT
23295W63IT
23308W93TEX
23310W83TEX
23317W83SP
23320W83TK
23321W83TTK
23330W93UK
23332W104TEX
23334W103UK
23335W113UK
23337W103TTK
23386W104NL
23781AB95EU
23879AB95AUS
23909AB63EX5060HZ
23910AL109K60HZ
24415W104SP
24600W103NL
24833W83DE
24834W104DE
25379W9521E
25474W104TBE
25885W63TAUS

25886W83TAUS
26878WA6IT
26879WA8IT
26880WA10IT
27094AB107PT
27299AL102PFR
27639WA6PT
27640WA8PT
27641WA10PT
27647WE8EX
27648WE10EX
27699W85FR
27700W105FR
27757WP67EX
27761WP100EX
27914AB84IT
28016WA105UK
28119AB66IT
28193W104TCH
28305WE8IT.1
28306WE10IT.1
28382WAP61EX
28383W84TTK
28400W104TTK
28479AV82TK
28480AVL85TK
28481AV102TK
28482AVL105TK
28484AVD8TK
28485AVD10TK
28626W101UK
28674W83FR
28676W107FR
28876AL88EU
28877AL109EU
28940AVL68ITTE
29378LNA1000FR
29540W81EX
29541W101EX
29549WP80EX
29999LISA100FR
30000WI10FR
30001WIL12FR
30018WIL113UK
30028WIE127UK
30055AVL6EIT
30056AVL8EIT
30062AVL62EX60HZ
30063AVL61EX115/60
30092AVL66PIT
30093AVL86PIT
30139WI8FR
30144WIL106IT
30145WIL86IT
30146WIL66IT
30196WI101UK
30197WI121UK

30206AVL105SK
30222WIE107IT
30223WIE87IT
30228WIV80IT
30229WIV60IT
30233WIL105EU
30234WIL85EU
30235WILM64IT
30331W12GE
30352WI81EX
30353WI82EX
30354WIL85EX
30355WI101EX
30356WIL105EX
30357AVL100PR
30361AVL95AUS
30443WIL126NL
30444WIE128NL
30455WIL105DE
30459WIL125DE
30460WIE127DE
30484WI70TK
30486WI80TK
30488WI100TK
30490WIL81TK
30492WIL101TK
30503WI62AUS
30507WI82SING
30513WI82AUS
30515WI82EX60HZ
30517WI102PL
30520WI105EX
30522WI102EX
30523WI102AUS
30525WI122EX
30526WIL62EX
30535WIL95KW
30540WIL125EX
30545WIE87EX
30548WIE107EX
30551WIE127EX
30611AVL64EU
30612AVL65PT
31813WI8EU
31922WI102EU
31923WI122EU
31969WI600IT
31970AV102CSI
32251WIL123DE
32252WIL143DE
32538WI102CH
32539WIL125CH
32571WIL146NLTE
32572WIE148NLTE
32859LISA111FR
32860WI11FR
32861WIL13FR

33178WIL145DETE
33179WIE147DETE
33180AVL145DETE
33244AVL62EO
33612AVL145EUTE
33613WIL103IT
33622WIL145EU
33623WIE147EU
33624WIL133UKTE
33625WIE147UKTE
33685AVL62KW
33742WIA121UK
33754WIA122EX
33962WIL14NL
33968AV6EU
33979AVF10TK
34056WIL146SPIT
34214AVF8TK
34238WIL14FRTE
34412WIAV60IT
34413WIA600EU
34415WIAV80IT
34438WIA60TK
34439WIA82EX
34440WIA80TK
34442WIA82EX60HZ
34443WIA8EU
34444WIA100TK
34445WIA102PL
34446WIA102EX
34447WIA101EU
34448WIA102CH
34449WIA121EU
34450WIL8FR
34451WIL11FR
34452LISA10FR
34453WIE12FR
34471WIL1000OT
34472WIL1200OT
34479AVL14FR
34483WIA101UK
34486WIA101EX
34507WIL62AUS
34508WIL82AUS
34509WIL102AUS
34515WIU61CSI
34516WIU81CSI
34517WIU102CSI
34907WIL103UK
35010WIU82CSI
35248WIL10FR
35249WIE10FR
35397WIL85EXTE
35398AVL62EXTE
35399AVL82EUTE
35400AVL88ITTE
35913AVF88EUTE

35918AVL66PITTE
35919AVL84EUTE
35920WIL105EXTE
35921WIL85PLTE
35974AV8IT
35975AV10IT
36241WIL125NL
36243WIL124NL
36536AVL95EXTE
36537AVL125EUTE
36593WIA110EU
36594WIL105PLTE
36595WIL126ITTE
36596WIL113UKTE
36684AVL105EU
36685WIE107PLTE
36768AVL120FRTE
36887WIL106SPEU
37014WILB12EU
37335WIA64IT
37732WIA9FR
37916AVL82AG
38059LISA11FR



n4007j00: Rear feet changed


From Serial Number 70403.0001 the two rear feet changed with new code C00254045, the cabinet fixing has been modified.

The new feet are not interchangeable with premodification.

CABINET
The spare part code isn't changed, in the warehouse stock we have the new cabinet.
If you fix it on premodification models you need to use the new feet.

Electric schemes and links

Cod. 16001405501

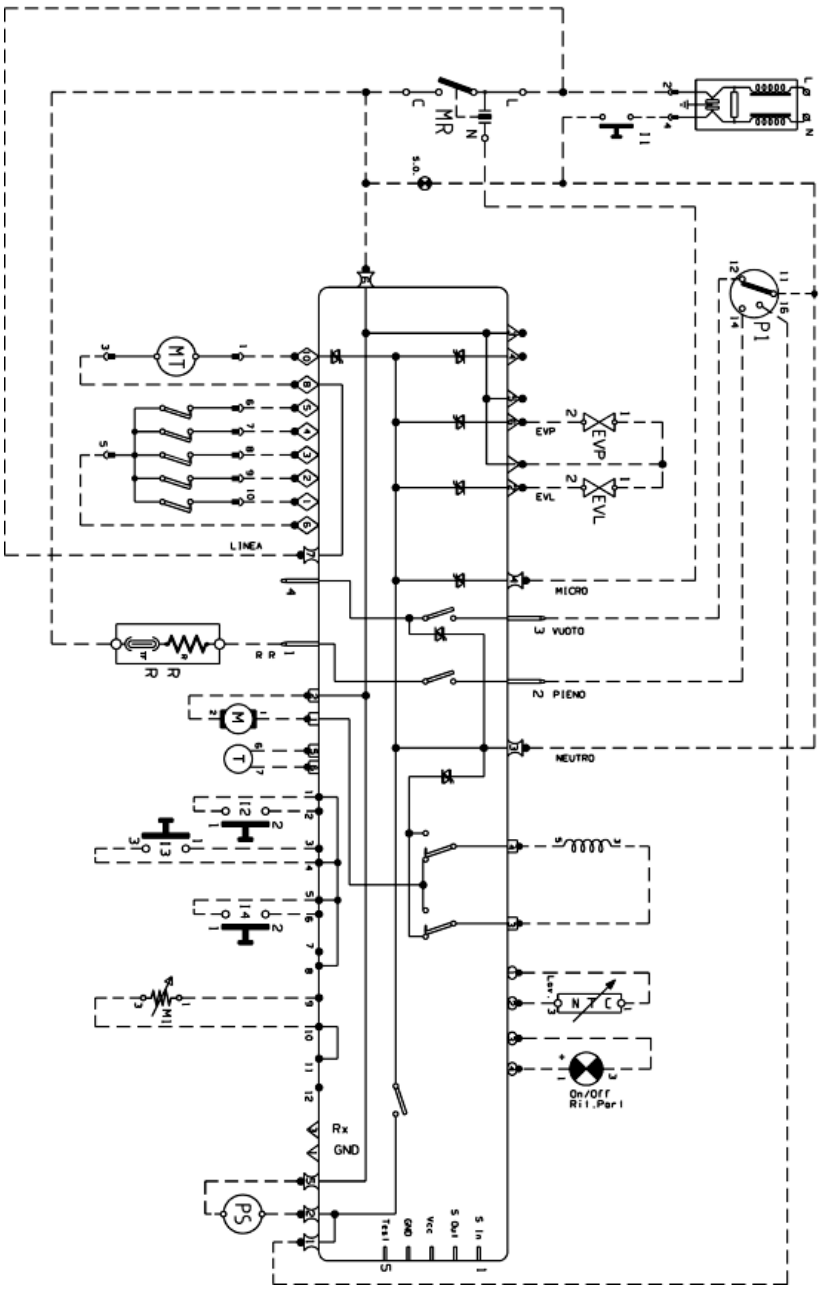


Legend

Legend: 16001405501

Electric schemes and links

Cod. 21009662700

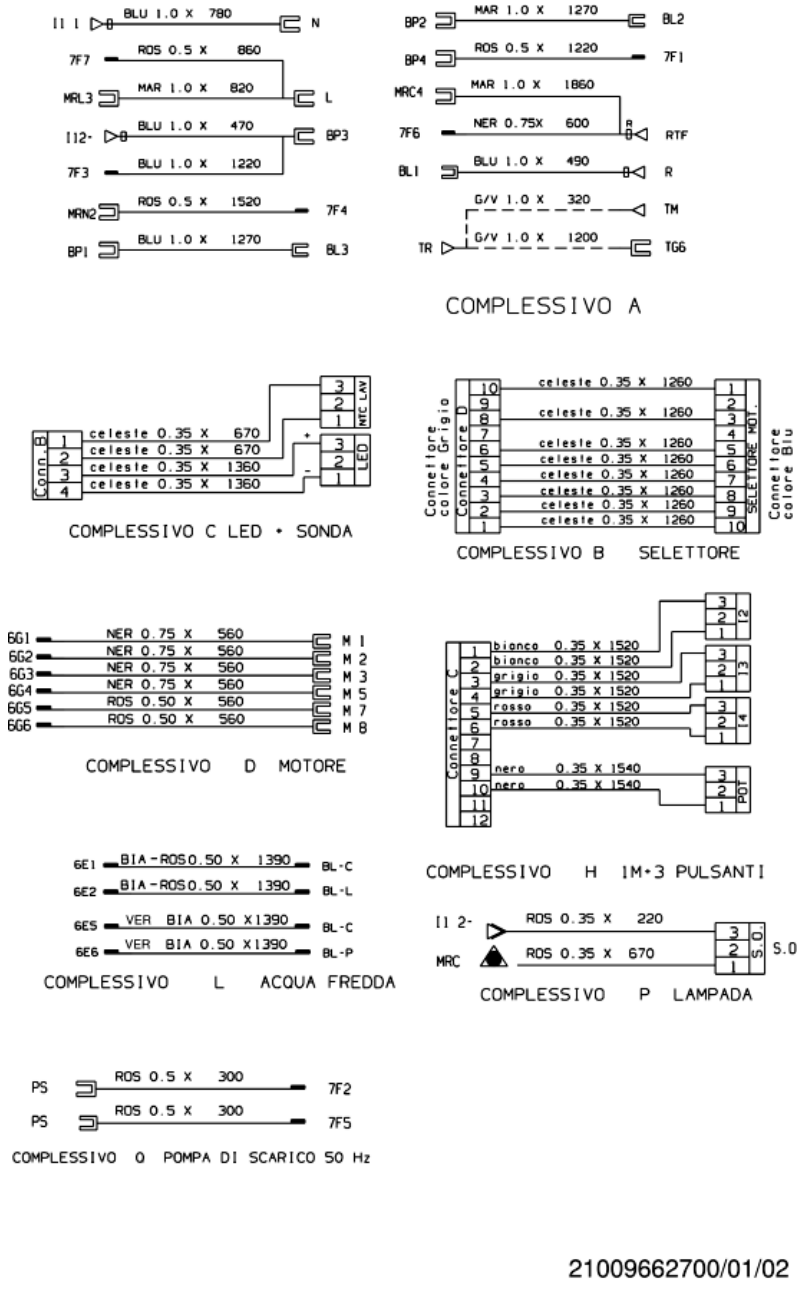

Legend

Legend: 21009662700