
INDESIT company

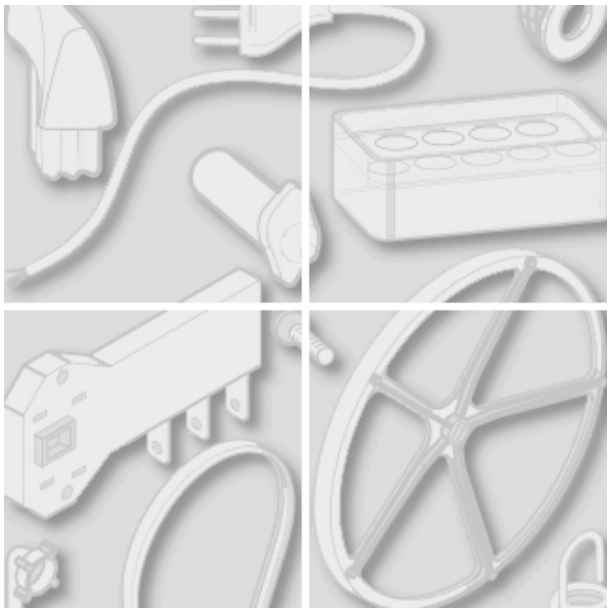

Model type:
AVSF109EU

Commercial code:
F034046

General notes

Technical Documentation guidelines

You can find herewith some generic information to simplify cunsulting of technical documentation:

1. Models of same range share the same exploded views, which report the richest set of spare parts:generally, a model does not necessarly have a related spare part for each particular shown on exploded views.

2. Some spare parts can not be represented directly on the exploded views (instruction booklets, specific kit, etc...). You can find those codes in the spare parts list with the same reference of particular where spares are installed or with references 099, 999. Instruction booklets, once managed, appear with 000 reference.

3. On the higher right site of each exploded view there is a serial number which indicates the beginning of the production of certain range:some models might have more than an exploded view for a given category, each distinguished by a different serial no.and linked to another spare parts list, In this case, serial no. is required to supply the right spare part code. Exploded view to be considered is the one with a more recent serial no. but previous than the one of the model that needs assistance.

4.Exploded views might require further updates even after publishing. Addition of new spares will go on following the already existing numeration references. Revision number of an exploded view is shown into last four digits of serial number into upper right hand corner.

5.The spare parts list associated to an exploded view shows related codes of spares managed for a certain model; for each spare part other informations are available:

REF: reference no of spare into a table; SUBSTITUTE: list of spare(s) which can replace a code but that keeps same functional characteristics


INDUSTRIAL CODE: list of variables of a model (shown into model label) where such spare is used; NOTICE: code of information(s) to refer to complete technical intervention, track for changes or to find correct spare part code.

6. Some notices, into a same section are generic therefore cannot be directly linked to a spare part. In order to assist a model in the best way as possible, it is helpful to pay attention to all notices and constantly verify documentation updates

7.Technical documentation cover shows model name and its commercial codes

1140150B Exploded views

Matr. 41004.0002

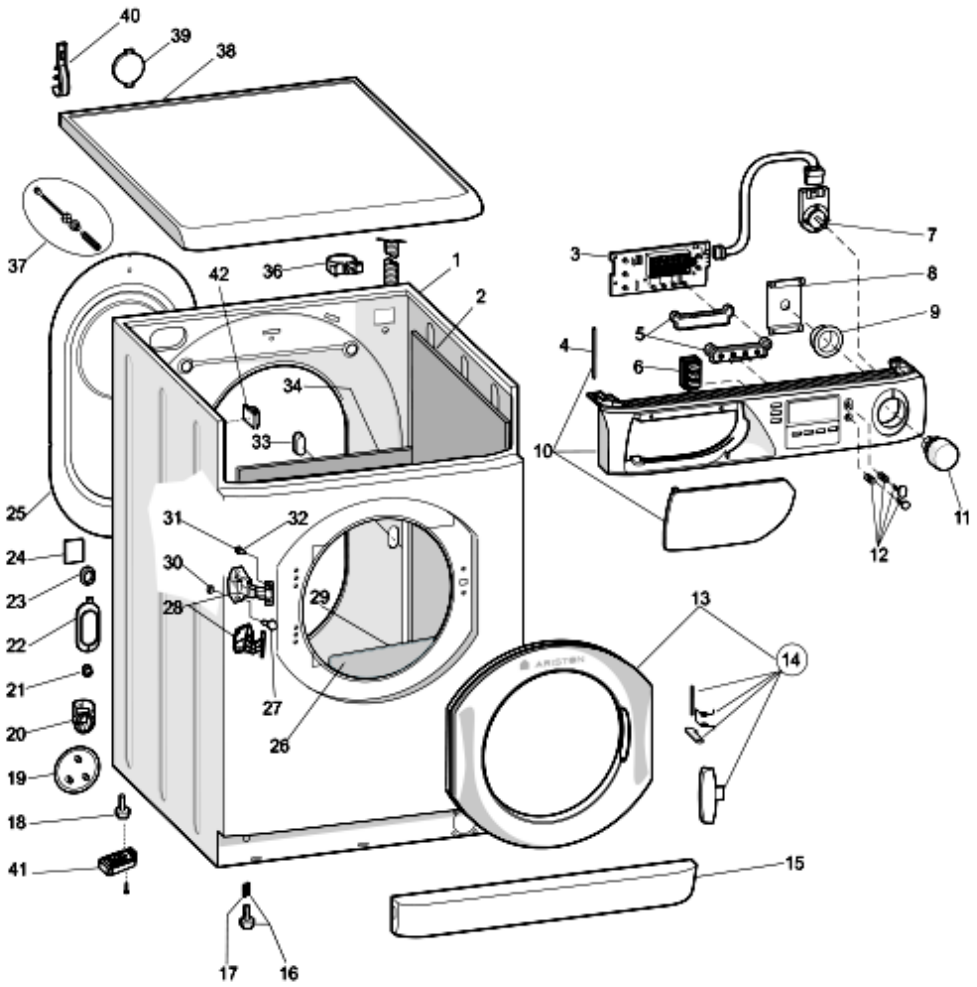

1140150B

1140150B

Spare parts list


Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
000	C00114585				user instructions booklet gb-de-cz-		
000	C00114587				user instructions booklet hr-pl-sl-		
001	C00094305		50206...	1 x C00115664 2 x C00115666 1 x C00115676	cabinet white evoii snella b27	n1040353	80340460000 80340460052
001	C00115664	50207...		1 x C00116540	cabinet white evoii snella b27	n1040353 n1040359	80340460052
001	C00116540				cabinet white evoii snella avsd		80340460900 80340460905
003	C00143089				control digit big-size rohs		
004	C00091882				pivot pin drawer front 106.5x5		
005	C00114263				white push buttons display avf		
006	C00111997				button pad		
007	C00087067			1 x C00143095	programme select bitron 16		
008	C00091890				potentiometer support avd		
009	C00094065			1 x C00118964	knob timer disc 28 pr b27	n1040359	80340460000 80340460052
009	C00116381			1 x C00203083	knob timer disc pw		80340460900 80340460905
010	C00114582				control panel + handle avsf109eu	n1040359	80340460000 80340460052
010	C00116795				control panel + handle pw		80340460900 80340460905
011	C00091873			1 x C00115953	wash timer knob white 27 avd	n1040359	80340460000 80340460052
011	C00115953				wash timer knob white pw avd		80340460900 80340460905
012	C00110115				white pushbutton on-off/reset kit	n1040359	80340460000 80340460052
012	C00116359			1 x C00110115	push button on-off/start kit white		80340460900 80340460905
013	C00092157			1 x C00115670 1 x C00115678	door frame and glass assy		
013	C00110133		50206...	1 x C00115674 1 x C00115678	door frame glass assy b27evo ii	n1040349 n1040353	

1140150B

Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
013	C00116384				door frame and glass assy pw		80340460900
							80340460905
014	C00092158			1 x C00116576	door handle kit b27 ariston	n1040359	80340460000
							80340460052
014	C00116576				door handle assy white pw		80340460900
							80340460905
015	C00110325			1 x C00116552	plinth white	n1040359	80340460000
							80340460052
015	C00116552				plinth white pw		80340460900
							80340460905
016	C00087084				foot		
021	C00065871				blanking plug		
024	C00082762				motor shock absorber		
025	C00099313			1 x C00116923	rear cover - white	n1040359	80340460000
							80340460052
025	C00116923				rear cover - white pw		80340460900
							80340460905
027	C00096210				screw self tapping		
028	C00064541				outer door hinge assembly	n1040349	80340460000
						n1040359	80340460052
028	C00115666				zama hinge 150°		80340460900
031	C00065185				bolt m4,5 x 8		
033	C00084817				blanking plate-rear(test plug)		
034	C00094018				insulation pad (front panel)		
036	C00046667				wiring stop		
038	C00095326				worktop - white avsd avsl	n1040359	80340460000
							80340460052
038	C00116551				worktop - white pw avsd avsl		80340460900


1140230 Exploded views

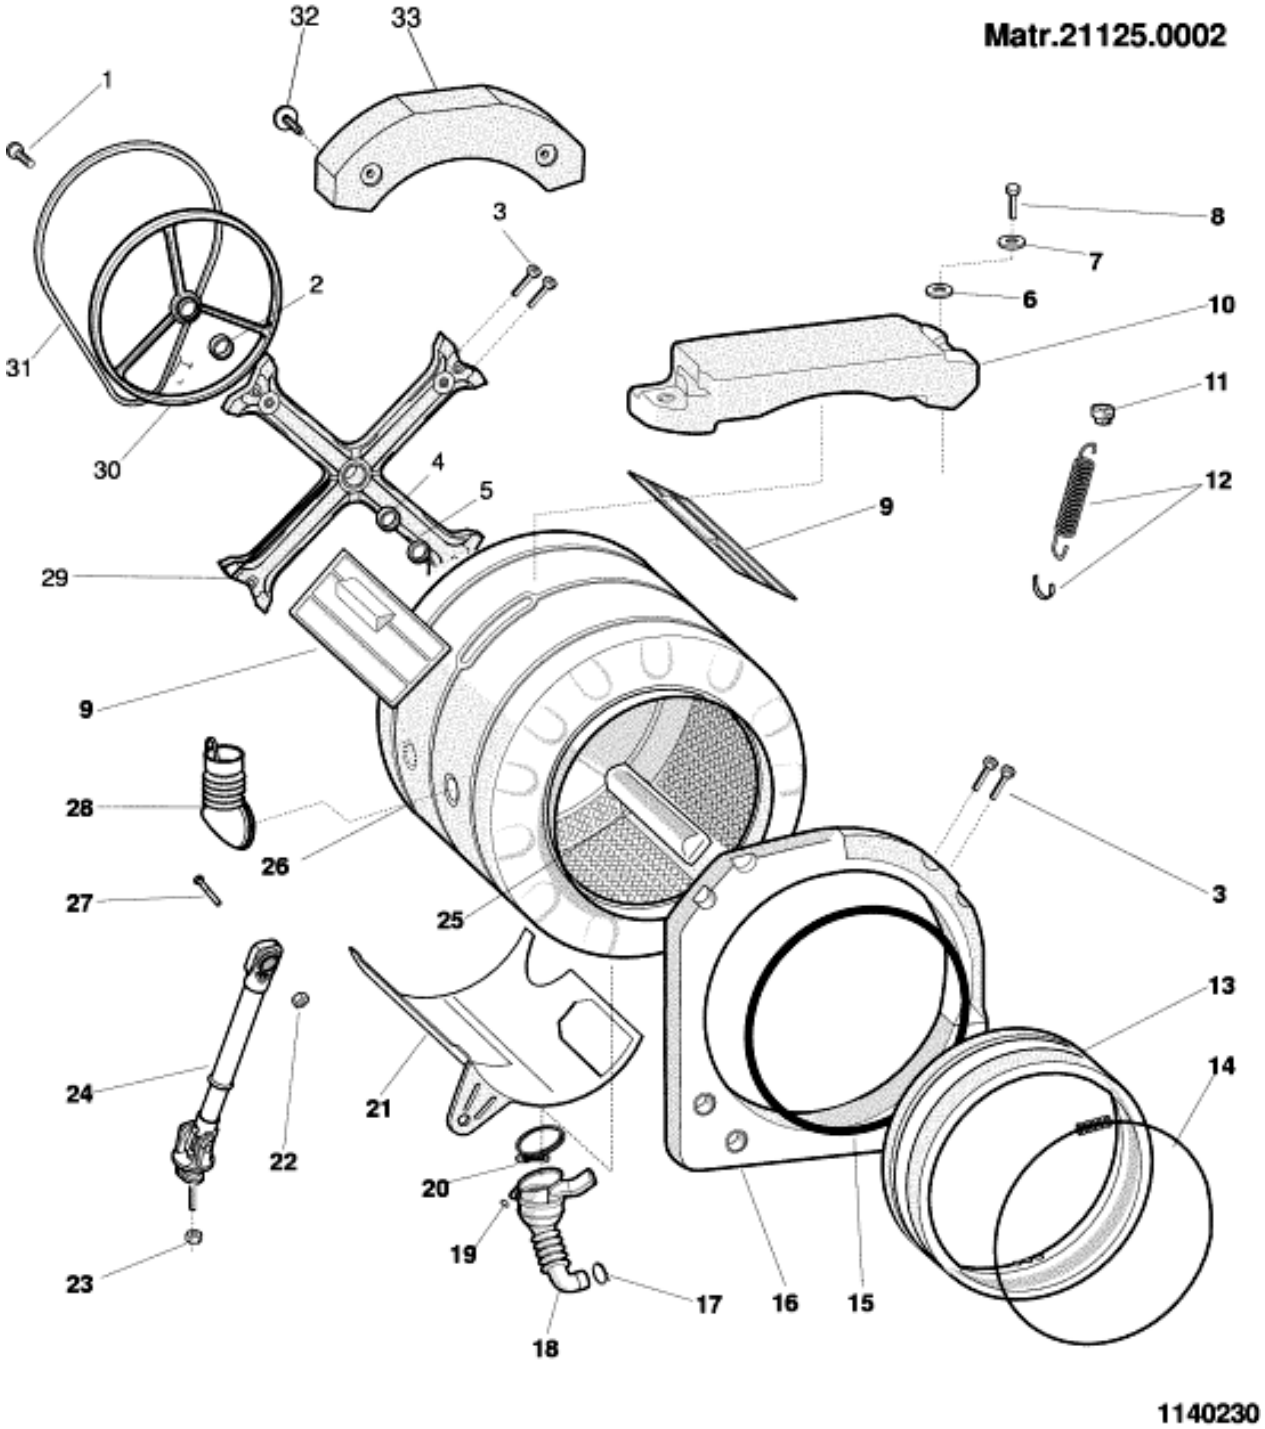

1140230 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
001	C00064786			1 x C00143260	bolt m8x23 torx tefl		
002	C00002591				bearing 20x47x14		
003	C00064785			1 x C00193879	bolt m8x22 tb6lt		
004	C00013563				bearing fits light/heavy spider 25		
005	C00096186				standard oil seal	n1040300 n1040326	
008	C00088408				bolt + washer		
009	C00065918				support left right lb		
010	C00064548				upper counterweight 11 kg		
011	C00064515				anchorage pad - suspension		
012	C00064502				suspension spring - tank		
013	C00110330				door bellows seal avsd avsl d= 30		
014	C00092156				door seal retainer front		
015	C00092155				door seal- rear retainer		
016	C00092178				front counterweight		
017	C00092411			1 x C00094908	hose clamp		
018	C00094312				hose tank to filter oko ws - abs		
019	C00092412				hose clamp		
020	C00091148			1 x C00094908	clamp d=79 mm		
021	C00093878				cradle outer- set		
023	C00065152				nut romob m6x22x1,5		
024	C00303584				kit shock absorber 80 n 10,2 mm		
025	C00065463				lifter 40 - 46l		
026	C00094289			1 x C00094275 1 x C00094290	outer- set 40 l. evo ii	n1040326	
027	C00110163				shock absorber elastic pin		
028	C00092161				hose dispenser to tank		
029	C00110340				bearing spider assembly	n1040326	
030	C00066080				drum pulley cone d=210 mm h=		
031	C00064598				belt 1046 h7 / 1053 h7		
099	C00001109				loctite 270 10 gr.		
099	C00033026			1 x C00292523	ambljgon grease ta 100 gr.		

1140330 Exploded views

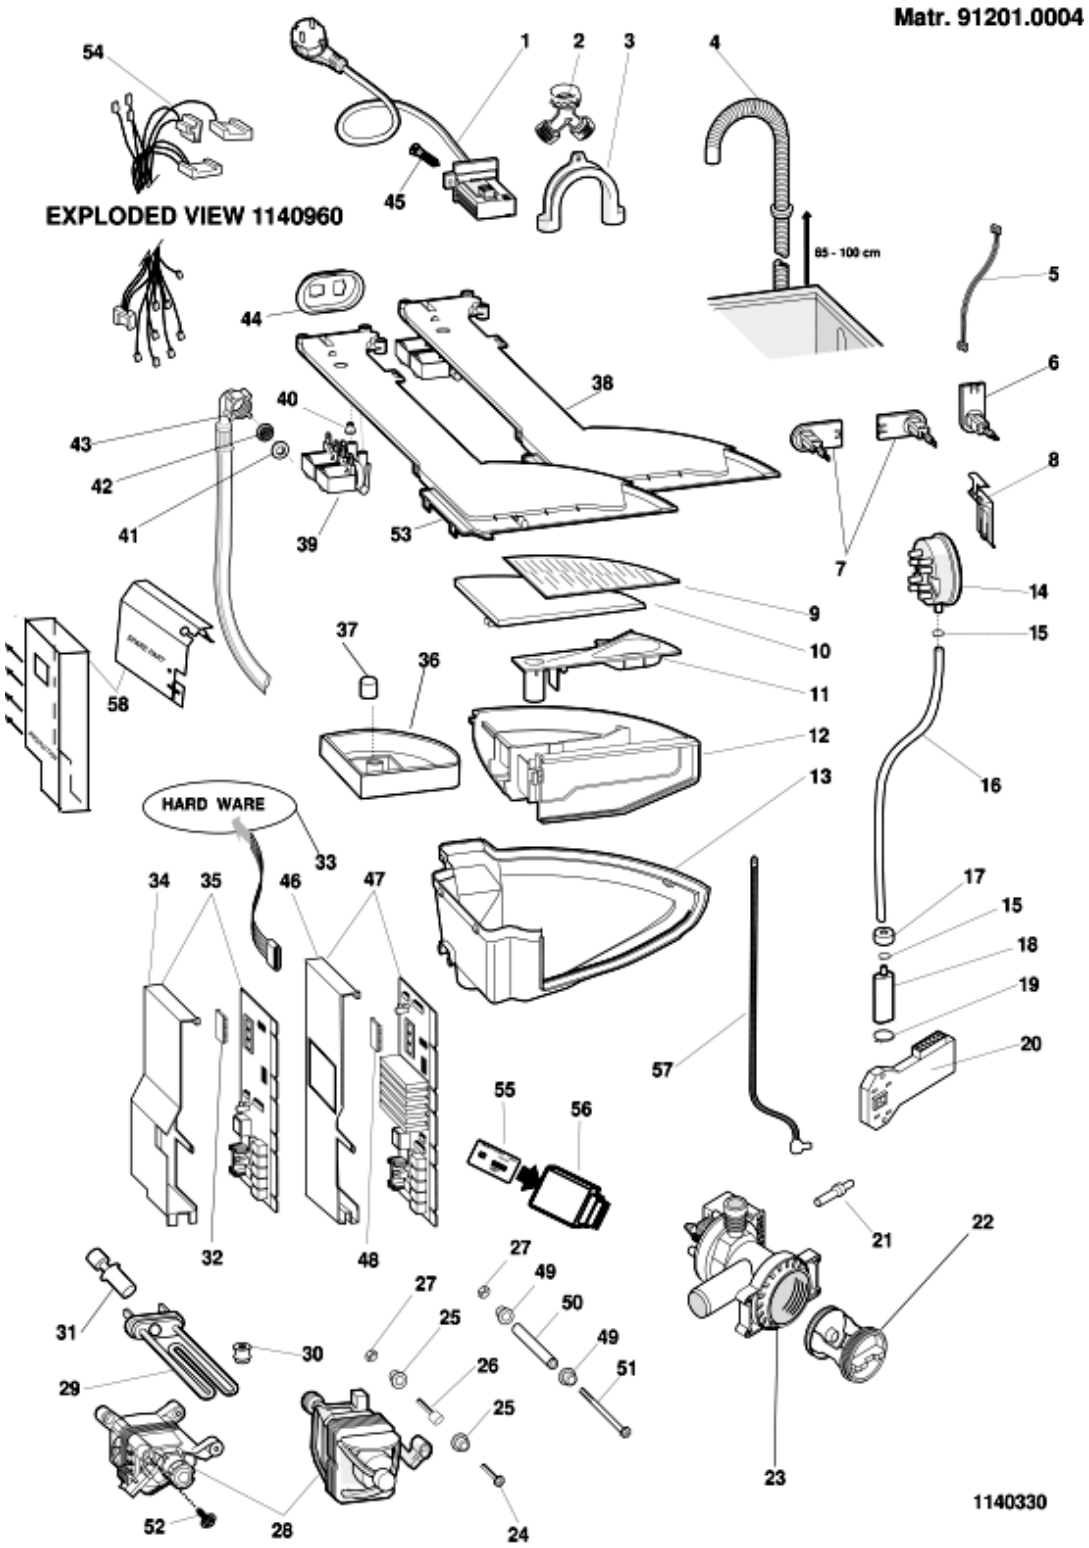

1140330 Spare parts list


Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
001	C00094203			1 x C00115769	supply cable 3 x 1.0 1,5mt shuko		
003	C00019902				plastic -u- to make drain hose		
004	C00027466				drain hose - to sink l=1860mm		
005	C00112238				wiring dashboard lbe digit		
006	C00087067			1 x C00143095	programme select bitron 16		
008	C00064537			1 x C00263210	support - pressure switch		
009	C00113404				reading desk 14803013200		
010	C00093813				support - programme guide evo ii		
011	C00046154				additive cover		
012	C00046148			1 x C00281253	soap dispenser drawer (rotary)		
013	C00092176				dispenser body		
014	C00110328				pressure switch 1 l.80 -55 +		
015	C00092412				hose clamp		
016	C00092170			1 x C00041785	pipe pressostat l= 470mm. evo ii		
017	C00019755				anti-vibration bush (foam)		
017	C00098754				anti-vibration hose (foam) l= 330		
018	C00092173				air trap x oko		
020	C00065185				bolt m4,5 x 8		
020	C00091911				door interlock avd		
021	C00092416				conducibility sensor l=28mm		
022	C00045023				filter handle		
022	C00045025				filter seal		
022	C00045027				pump filter kit	n1040376	
022	C00141034				filter element kit		
022	C00297161				filter element kit copreci		
023	C00119307				drain pump		
027	C00040932				self locking nut m6		
028	C00095316				motor three phase cim sn (stator	n1040351	80340460000
028	C00097258				tacho generator for motor ceset		
028	C00115836				motor three phase cim sn (stator		80340460052 80340460900 80340460905
029	C00087188				heat element + sensor hole	n1040300	
030	C00058523				pillar retainer-heating element		
031	C00083915				thermistor ntc		

1140330 Spare parts list


Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
033	C00066292				insulated tweezers		
033	C00095669			1 x C00145046	hardware key mk1	n1040317	
033	C00099862				serial cable lb2000 evoii - pc		
038	C00111813			2 x C00064534 1 x C00110333 1 x C00115912	hopper cover ev 1e2u rst 2,5 230v		
039	C00110333				fill valve 2 way (7lt rst 2.5)		
040	C00064534				seal - dispenser to valve		
041	C00005572				sealing washer-mains inlet hose		
042	C00005781				inlet hose filter		
043	C00003070				mains inlet hose cold 25c 10bar		
044	C00064946				electrovalve support 1 ev		
045	C00092348				self-scraping screw 3,5x8		
046	C00094047				support cover 3 f		
046	C00094049				bracket for module 3 f		
047	C00257406		51027...		module evoii trif. ed2 wd +sc	n1040378 n4008c01	80340460000 80340460052 80340460900
047	C00265676	51028...			module triphase 3.5 (for card)	n4008c01	80340460905
049	C00019682				rubber bush 20 mm - motor		
050	C00074153				spacer motor support l= 187 mm		
051	C00074152				bolt m6x30		
055	C00262252	51028...			card avsf109eu evoii 8kb sw	n4008c01	80340460905
055	C00262605		50202...		card avsf109eu evoii 8kb sw	n4008c01	80340460000
055	C00262974	50203...	51027...		card avsf109eu evoii 8kb sw	n4008c01	80340460052 80340460900
056	C00252539			1 x C00263927	smart reader for card 8kb		

1140960 Exploded views

The new wiring when fitted, must be securely attacched to the machine wiring with insulating tape. **Matr. 61116.0001**



WIRING P = DRUM BLOCK COD. C00141995

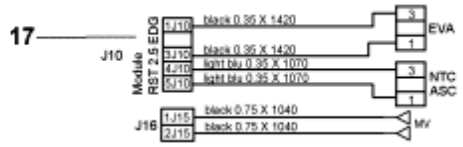


WIRING F = EVA+NTCAS / WIRING G = MTV COD. C00141769




WIRING P = DRUM BLOCK COD. C00112822




WIRING B2 = DISPLAY CONNECTION COD. C00111227

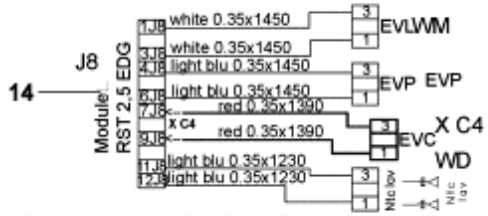


WIRING C1(WM) C3(WD) = EVL + EVP COD. C00093713
WIRING C4 (WD) = EVL + EVP + EVC COD. C00109960




WIRING D = INTERLOCK. + MICRO SWITCH COD. C00093714




WIRING D1 = INTERLOCK. COD. C00093715




WIRING H = DRYING ELEMENT COD. C00093716

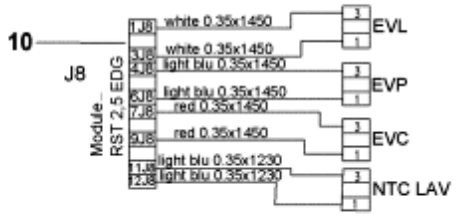


WIRING C = EVL + EVP + EVC COD. C00093724




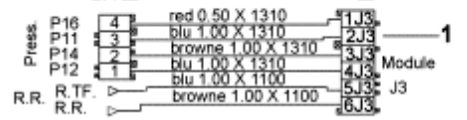


WIRING A COD.C00141139 (ex C00093722)

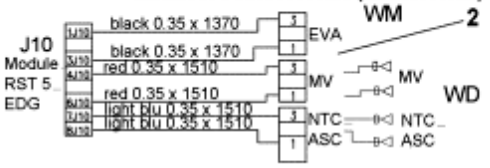


WIRING F = EVA + MV + NTCAS COD.C00093717

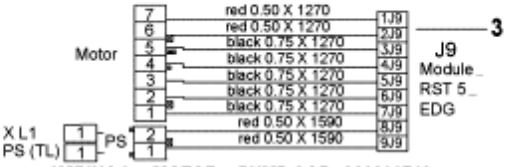


WIRING L = MOTOR + PUMP COD. C00093718
WIRING L1 (TL) = MOTOR + PUMP COD. C00195340




WIRING I = CONDUCTIVITI SENSOR COD. C00093725

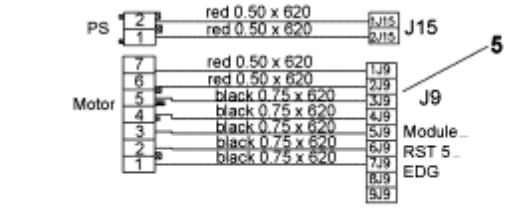


WIRING N = MOTOR + PUMP COD. C00093719



WIRING X = EART STD MACCHINE COD. C00093720



WIRING Y = EART TRI-PHASE MACCHINE COD. C00093721



WIRING B1 = MAIN-DISPLAY CONNECTION COD. C00093726



WIRING B = SELECTION CONNECTION COD. C00093723

1140960

1140960 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
001	C00141139				wiring		
004	C00093725				wiring conducibility sensor		
005	C00093719				wiring pump-motor-module		
007	C00093721				wiring earth triphase		
008	C00093726				wiring display		
012	C00093715			1 x C00259857	wiring door lock-module j4		
014	C00093713				wiring ntc-evl+evp-module j8		

Notices

n1040242: Power card with welded eeprom.

From serial number 20304.0001, IDC power card with welded eeprom is used to ensure the perfect connection of all parts, in the Comunanza, Teverola and Brembate factories.
To replace the module with welded eeprom, it will be necessary to use the eeprom indicated in the SAT document of the model concerned.
To replace the module on a unit with welded eeprom both the SAT module and the eeprom are required, because the latter cannot be reused.

n1040296: List of EVOII FAULTS and troubleshooting.

In case of washing-machine fault in carrying out the self-test function, the machine reproposes the fault previously signalled and the same fault is shown on the display of the new hardware key.
The type of fault can be signalled in different ways:
- on AVD models the fault is shown directly on the machine display.
- on AVL models the fault is signalled by LEDs.

Reading of Faults signalled by LEDs
When the machine has a fault:
1. The window is locked
2. The door lock light flashes fast (> 1 Hz)
3. The control panel LEDs light up, to signal the fault, according to the table (fig. 01).
The example shown in fig. 02 (Example Fault F03) below indicates which LEDs are flashing if the machine has Fault F03

List of faults, malfunctions and Warnings:

F01: Triac Motor short circuit
- Check for water leaks that may affect connector J9 causing the relevant contacts to short
- Check the motor terminal block (possible problems due to chemical effects of work residuals on the contacts which may cause short-circuiting)
- Replace Card

F02: Motor blocked, Tachometrics in Short Circuit/Open
- Check motor if blocked

- Check efficiency of J9 connector on card
- Check the tachometric winding verifying an ohmic resistance reading of 115 - 170 ohm between pins
1 and 2 on wiring connector J9. In case of short circuit/open circuit check the wiring between pins 1 and 2 of J9 relevant to the tachometrics. With three-phase motor, make sure there is ohmic continuity between J9 pins 6 and 7.
- Replace motor
- Replace card

F03: NTC Open or in Short Circuit or washing heater relay stuck (signalled in presence of full load)
- Check efficiency of J8 connector contacts on card
- Check NTC verifying that the ohmic resistance value at room temperature 20°C is approx. 20Kohm on J8 wiring connector pin 11 and 12.
- If the measurement is incorrect check J8/NTC wiring continuity
Check the same parameter directly on NTC
- Replace NTC
- Replace Card

F04: Simultaneous empty and overflow (pressure switch stuck on empty).
If the pressure switch contact is stuck on empty the washing-machine loads water until reaching the overflow. The drain pump is automatically started by the contact on the overflow pressure switch.
- Check efficiency of J3 connector contacts on card
- Check pressure switch status by checking ohmic continuity on wiring connector J3 pins 2 and 4 (it must only be present with tub empty), pins 2 and 3 (it must only be present with water in the drum) and pins 2 and 1 (it must only be present with water in the tub above normal level, more than halfway up door glass).
- Check wiring of connector J3/pressure switch
- Replace pressure switch
- Replace card.

F05: Pump Blocked or pressure switch empty not reached
- Check efficiency of J9 connector on card, verifying a voltage of 220V between pins 8 and 9
- Check that pump if being fed
- Check Pump Filter + wall drain
- Change Pump
- Replace Card

F06: No on AVD and AVL

F07: No Wash Heating Element Absorption (the fault is only signalled with the pressure switch on empty)
- Check efficiency of J3 connector contacts on card
- Check continuity of the wash heating element on J3 connector pins 5 and 6. The 1800W 230V heating element has a resistance of 25 ohm.
- Check connection of pressure switch J3 connector pins 2 and 3: there must not be ohmic continuity (shared with full load).
Check connection of pressure switch J3 connector pins 2 and 4: there must be ohmic continuity
- Replace Heating Element
- Replace Pressure Switch
- Replace Card

F08: Wash Heater Relay Stuck (signalled in presence of empty) or pressure switch stuck on Full (simultaneously empty and full)
- Check efficiency of J3 connector contacts on card
- Check pressure switch status by checking ohmic continuity on wiring connector J3 pins 2 and 4 (it must only be present with tub empty), pins 2 and 3 (it must only be present with water in the drum) and
pins 2 and 1 (it must only be present with water in the tub above normal level, more than halfway up door glass).
- Check wiring J3/pressure switch
- Check connection of heating element J3 connector pins 5 and 6.
- Replace pressure switch
- Replace Card

F09: Machine Setup Error (Eeprom error)

- In case of production card with Eeprom soldered: replace the card and Eeprom
- In case of replacement of Eeprom and card, check correct housing of Eeprom on card socket

F10: No full and empty signal
- Check efficiency of J3 connector contacts on card
- Check pressure switch status by checking ohmic continuity on wiring connector J3 pins 2 and 4 (it must only be present with tub empty), pins 2 and 3 (it must only be present with water in the drum) and
pins 2 and 1 (it must only be present with water in the tub above normal level, more than halfway up door glass).
- Check wiring of connector J3/Pressure switch
- Replace Pressure Switch
- Replace Card

F11: No Pump Feedback (Drain pump disconnected or winding broken)
- Check efficiency of J9 connector on card
- Check continuity of the Pump on J15 connector pins 1 and 2 (in case of washing-machine with Easy Door door lock) or on J9 connector pins 8 and 9 (in case of conventional door lock), checking a resistive value equal to 170 ohm.
- Check wiring of connector J15 (or J9)/Pump
- Replace Pump
- Replace Card

F12: No Communication Display/LED Card-Main Board
- Check efficiency of contacts on card of J11 connector
- Check the continuity of J11 connector-display card 5-pin connector
- Replace Main Board
- Replace Display Card/LED

F13: Drying NTC sensor open / Drying system NTC wiring disconnected
Check efficiency of J10 connector on card
Check NTC on J10 connector pins 7 and 8 verifying that the ohmic value of the sensor at room temperature 20°C is approx. 20Kohm
Check continuity of NTC/J10 connectors wiring
Replace NTC
Replace card

F14: Drying heater open or not connected
Check efficiency of J2 connector contacts on card
Check continuity of drying heater on J2 wiring connector pins 1 and 2, verifying that the ohmic value of the 1300W 230V heating element is approx. 40Kohm
Check wiring of connector J10/drying heater
Replace heating element
Replace card

F15: Drying heater always on (drying relay contact stuck or drying Triac short circuit)
Check efficiency of J2 connector contacts on card of
Check wiring of connector J2/drying heater
Check wiring of connector J3/pressure switch
Replace card

F16: Drum locking (top-loading only)

F17: Door lock unfed/open (with Easy Door)
- Check presence of 230V mains power on J4 wiring connector inserted on card between pins 3 and 4,
(not present with machine on standby) and presence of power from 230V door lock between pins 3 and 5
- Check ohmic continuity of the door microswitch on J4 connector inserted on card between pins 1 and 2 (with door closed/on open/off)
- Check continuity of J4/door lock wiring
- Check door hooking

- Replace door lock
- Replace card

F17: Door lock unfed/open (conventional door lock, not Easy Door)
- Check presence of 230V mains power on J4 wiring connector inserted on card between pins 2 and 3,
(not present with machine on standby) and presence of power from 230V door lock between pins 3 and 1
- Check door hooking
- Replace door lock
- Replace card

F18 --> Communication error microprocessor / DSP (Digital Signal Processor)
- Replace card

COMBINAZIONE LED


SIMBOLOGIA:
= LED ACCESO = LED SPENTO

FAULT	LED Fasi	TASTI FUNZIONI			
F01	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F02	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F03	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F04	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F05	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F06	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F07	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F08	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F09	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F10	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F11	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F12	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F13	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F14	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F15	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F16	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F17	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F18	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4



ARISTON INDESIT


FIG. 01

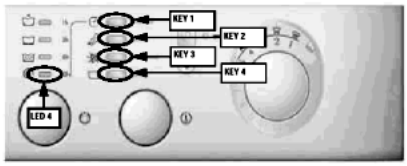

Fault	Key 1	Key 2	Key 3	Key 4	Led 4
01	Off	Off	Off	Flash	Off
02	Off	Off	Flash	Off	Off
03	Off	Off	Flash	Flash	Off
04	Off	Flash	Off	Off	Off
05	Off	Flash	Off	Flash	Off
06	Off	Flash	Flash	Off	Off
07	Off	Flash	Flash	Flash	Off
08	Flash	Off	Off	Off	Off
09	Flash	Off	Off	Flash	Off
10	Flash	Off	Flash	Off	Off
11	Flash	Off	Flash	Flash	Off
12	Flash	Flash	Off	Off	Off
13	Flash	Flash	Off	Flash	Off
14	Flash	Flash	Flash	Off	Off
15	Flash	Flash	Flash	Flash	Off
16	Off	Off	Off	Off	Flash
17	Off	Off	Off	Flash	Flash

Table Fault LED

FIG. 02

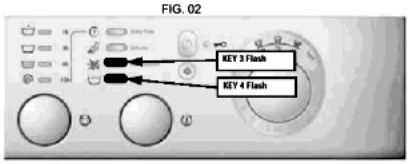

Example Fault F03

Tabla de averías para lavadora EVO II



FAULT	CAUSA	COMBINACIÓN LED				
		LED Fase	TECLAS FUNCIONES			
F01	Triac control motor en corto	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F02	Motor bloqueado, taquímetro motor abierto / en corto	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F03	Sonda NTC lavado abierta / en corto	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F04	Vacío + sobrenivel presostato simultaneamente	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F05	No se logra vacío presostato hasta desagüe bloqueada	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F06	Error de selector (no encuentra código)	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F07	Falta absorción en la resistencia de lavado	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F08	Relé resistencia de lavado con el contacto NA/NC pegado	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F09	Error umap file (EEPROM no programada o correcta)	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F10	Presostato en Rotor+Vacío o sin salida de vacío ni lleno	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F11	Falta alimentación a la bomba de desagüe	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F12	Falta comunicación entre módulo display y modulo de control	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F13	Sonda NTC secado abierta/corto. Ventilador secado bloqueado	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F14	Falta alimentación a la resistencia de secado	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F15	Contacto relé resistencia de secado pegado	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F16	Bloqueo de cesto (sobe carga superior)	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F17	Bloqueo puerto desalineado /abierto	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F18	Error de comunicación Micro/DSP (MODULO)	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4


– LED

SIMBOLOGIA:

– led encendido

– led apagado


ABB. 01

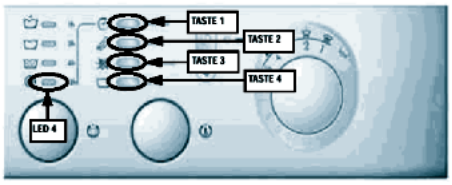

Fault	Taste 1	Taste 2	Taste 3	Taste 4	Led 4
01	Ausgeschaltet	Ausgeschaltet	Ausgeschaltet	Blinkt	Ausgeschaltet
02	Ausgeschaltet	Ausgeschaltet	Blinkt	Ausgeschaltet	Ausgeschaltet
03	Ausgeschaltet	Ausgeschaltet	Blinkt	Blinkt	Ausgeschaltet
04	Ausgeschaltet	Blinkt	Ausgeschaltet	Ausgeschaltet	Ausgeschaltet
05	Ausgeschaltet	Blinkt	Ausgeschaltet	Blinkt	Ausgeschaltet
06	Ausgeschaltet	Blinkt	Blinkt	Ausgeschaltet	Ausgeschaltet
07	Ausgeschaltet	Blinkt	Blinkt	Blinkt	Ausgeschaltet
08	Blinkt	Ausgeschaltet	Ausgeschaltet	Ausgeschaltet	Ausgeschaltet
09	Blinkt	Ausgeschaltet	Ausgeschaltet	Blinkt	Ausgeschaltet
10	Blinkt	Ausgeschaltet	Blinkt	Ausgeschaltet	Ausgeschaltet
11	Blinkt	Ausgeschaltet	Blinkt	Blinkt	Ausgeschaltet
12	Blinkt	Blinkt	Ausgeschaltet	Ausgeschaltet	Ausgeschaltet
13	Blinkt	Blinkt	Ausgeschaltet	Blinkt	Ausgeschaltet
14	Blinkt	Blinkt	Blinkt	Ausgeschaltet	Ausgeschaltet
15	Blinkt	Blinkt	Blinkt	Blinkt	Ausgeschaltet
16	Ausgeschaltet	Ausgeschaltet	Ausgeschaltet	Ausgeschaltet	Blinkt
17	Ausgeschaltet	Ausgeschaltet	Ausgeschaltet	Blinkt	Blinkt


Tab. Störung Led

ABB. 02

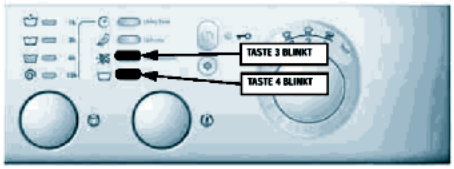

Beispiel Störung F03


FIG. 01

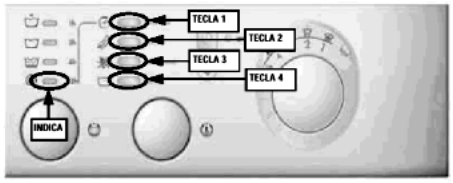

Fault	Tecla 1	Tecla 2	Tecla 3	Tecla 4	Indicador luminoso 4
01	Apagado	Apagado	Apagado	Pisca	Apagado
02	Apagado	Apagado	Pisca	Apagado	Apagado
03	Apagado	Apagado	Pisca	Pisca	Apagado
04	Apagado	Pisca	Apagado	Apagado	Apagado
05	Apagado	Pisca	Apagado	Pisca	Apagado
06	Apagado	Pisca	Pisca	Apagado	Apagado
07	Apagado	Pisca	Pisca	Pisca	Apagado
08	Pisca	Apagado	Apagado	Apagado	Apagado
09	Pisca	Apagado	Apagado	Pisca	Apagado
10	Pisca	Apagado	Pisca	Apagado	Apagado
11	Pisca	Apagado	Pisca	Pisca	Apagado
12	Pisca	Pisca	Apagado	Apagado	Apagado
13	Pisca	Pisca	Apagado	Pisca	Apagado
14	Pisca	Pisca	Pisca	Apagado	Apagado
15	Pisca	Pisca	Pisca	Pisca	Apagado
16	Apagado	Apagado	Apagado	Apagado	Pisca
17	Apagado	Apagado	Apagado	Pisca	Pisca

Tab. Fault indicador luminoso

FIG. 02

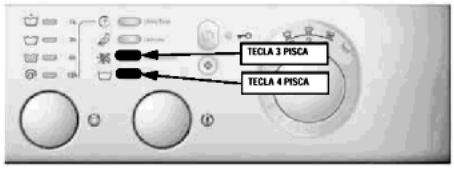

Exemplo Fault F03

n1040349: Introduction of 150° Zamac hinge on Ariston 46 models.

From serial no. 50207.0001, all Ariston models produced in the Teverola factory (see table 001 attached) with industrial code (given on the rating plate) starting with 46, have been equipped with a Zamac hinge with 150° opening angle, code C00115666



Cruscotto - Tableau de borde - Belde - Control panel
Painel frontal - Quadro Mandos - Kontrol paneli

(see Fig.001).
This modification has involved the introduction of the following items:

Code C00115670 - Complete door EVOII 150° white 27 with standard glass;
Code C00115674 - Complete door EVOII 150° white 27 with long glass;
Code C00115667 - EVOII body for 150° hinge white 27;

The premodified items are not interchangeable separately with the modified ones.

Code C00110133 - Complete door EVOII Standard 180° white 27 standard glass;
Code C00092157 - Complete door EVOII 180° white 27 long glass;
Code C00096193 - EVOII body for 150° hinge white 27;

The hinge code C00064541 continues to be used on the build-under models produced in the Comunanza factory.

		CABINET		DOOR				HINGE	
		180°	150°	180°	150°	180°	150°	180°	150°
Model	Code	C00096193	C00115667	C00092157	C00115670	C00110133	C00115674	C00064541	C00115666
AV 82 (TK)	28479	X	X	X	X			X	X
AVL 85 (TK)	28480	X	X	X	X			X	X
AV 102 (TK)	28481	X	X	X	X			X	X
AVL 105 (TK)	28482	X	X	X	X			X	X
AVD 10 (TK)	28485	X	X	X	X			X	X
AVL 125 (EU)	29774	X	X	X	X			X	X
AVL 62 (EX)	29775	X	X	X	X			X	X
AV 61 (EU)	29890	X	X			X	X	X	X
AVL 6 E (IT)	30055	X	X	X	X			X	X
AVL 62 (EX)60HZ 40-F	30062	X	X	X	X			X	X
AVL 61 (EX)115-60	30063	X	X			X	X	X	X
AV 51 (EX) 50-60	30064	X	X			X	X	X	X
AV 41 (EX) 50-60	30065	X	X			X	X	X	X
AV 41 (AG) 50-60	30066	X	X			X	X	X	X
AV 51 (AG) 50-60	30067	X	X			X	X	X	X
AVL 86 P (IT)	30093	X	X	X	X			X	X
AVL 105 (SK)	30206	X	X	X	X			X	X
AVL 100 P (R)	30357	X	X	X	X			X	X
AVL 95 (AUS)	30361	X	X	X	X			X	X
AV 51 (EO)	30498	X	X			X	X	X	X
AVL 65 (PT)	30612	X	X	X	X			X	X
AV 102 (CSI)	31970	X	X	X	X			X	X
AV 40 (AG) 50-60	32303	X	X			X	X	X	X
AVL 145 (DE) (TE)	33180	X	X	X	X			X	X
AV 42 (EX) 50-60	33217	X	X			X	X	X	X
AV 52 (EX) 50-60	33218	X	X			X	X	X	X
AVL 62 (EO)	33244	X	X	X	X			X	X
AVL 145 (EU) (TE)	33612	X	X	X	X			X	X
AVL 62 (KW)	33685	X	X	X	X			X	X
AV 62 (EU)	33968	X	X	X	X			X	X
AVF 10 (TK)	33979	X	X	X	X			X	X
AVF 8 (TK)	34214	X	X	X	X			X	X
AVF 149 (EU)	34217	X	X	X	X			X	X
AVL 135 (FR) (TE)	34239	X	X	X	X			X	X
AVL 140 (FR) (TE)	34240	X	X	X	X			X	X
AVL 14 (FR)	34479	X	X	X	X			X	X
AV 8 (IT)	35974	X	X	X	X			X	X
AV 10 (IT)	35975	X	X	X	X			X	X

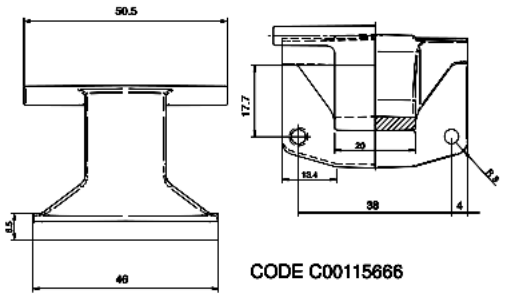


Fig . 001

n1040351: Three-phase motors package 40 factory 80.

Since February 2005, all 800, 1000 and 1200 rpm washing machines produced in factory 80 have been equipped with three-phase motors (package 40 code C00115836 for Snelle models and C00116103 for Standard models) and related eeproms.

The new items are not interchangeable separately with the premodification ones that will continue to be used.

The last two numbers of the Industrial Code given on the rating plate of the modified models are 52 (e.g. 80300070052).

To determine the codes of the motor or eeprom to be used, it is necessary to know the industrial code or serial number of the appliance being repaired and consult the table n1040351TAB001 attached.

STANDARD MODEL						
MODEL	MOTOR (STATOR 50)	EEPROM (STATOR 50)	INDUSTRIAL CODE	MOTOR (STATOR 40)	EEPROM (STATOR 40)	DATE START PRODUCTION
AVD109EX	C00094023	C00095729	80284460252	C00116103	C00116076	23/02/05
AVD109SEX	C00094023	C00096448	80284470252	C00116103	C00116046	17/02/05
AVD129EX	C00094023	C00095411	80284480152	C00116103	C00116048	17/02/05
AVL129R	C00094023	C00094659	80286370152	C00116103	C00116045	17/02/05
AVG12EU	C00094023	C00111524	80288710152	C00116103	C00116049	17/02/05
AVL109R	C00094023	C00095420	80297000052	C00116103	C00116066	10/02/05
AVL129EU	C00094023	C00097159	80298410052	C00116103	C00116050	17/02/05
AVD129NL	C00094023	C00096169	80298510052	C00116103	C00116051	17/02/05
AML125FR	C00094023	C00114362	80300070052	C00116103	C00116062	10/02/05
AML119TK	C00094023	C00115008	80305880052	C00116103	C00116052	17/02/05
AMD129EU	C00094023	C00114363	80305890052	C00116103	C00116063	10/02/05
AMD109EU	C00094023	C00115004	80305920052	C00116103	C00116053	17/02/05
AML89EU	C00094023	C00115005	80305960052	C00116103	C00116054	17/02/05
AML129EU	C00094023	C00115053	80305980052	C00116103	C00116064	10/02/05
LBE129ALL	C00094023	C00111128	80325690052	C00116103	C00116065	10/02/05
AVF109SIT	C00094023	C00113361	80331370052	C00116103	C00116055	17/02/05
BWM129	C00094023	C00111908	80332130052	C00116103	C00116057	17/02/05
MLE129ALL	C00094023	C00112842	80332380052	C00116103	C00116058	17/02/05
AVF109SEX	C00094023	C00113401	80340430052	C00116103	C00116067	10/02/05
AVF129EX	C00094023	C00113452	80340440052	C00116103	C00116068	10/02/05
AVF109EX	C00094023	C00115900	80342160052	C00116103	C00116059	17/02/05
SLIM MODEL						
MODEL	MOTOR (STATOR 50)	EEPROM (STATOR 50)	INDUSTRIAL CODE	MOTOR (STATOR 40)	EEPROM (STATOR 40)	DATE START PRODUCTION
AVSD129EU	C00095316	C00096321	80299690052	C00115836	C00115834	17/02/05
AVSL109IT	C00095316	C00095377	80284290252	C00115836	C00116637	26/01/05
AVSL129R	C00095316	C00095788	80297690052	C00115836	C00116638	26/01/05
AVSD120FR	C00095316	C00095489	80284400152	C00115836	C00116639	03/02/05
AVSD109IT	C00095316	C00095314	80289050052	C00115836	C00116640	03/02/05
AVSL89IT	C00095316	C00096028	80291170152	C00115836	C00116641	26/01/05
AVSL109R	C00095316	C00095387	80297010052	C00115836	C00116642	26/01/05
AVSG12EU	C00095316	C00112844	80297760152	C00115836	C00116643	26/01/05
AVSD109EU	C00095316	C00096324	80296280052	C00115836	C00116644	26/01/05
AVSD109SEX	C00095316	C00096839	80299930052	C00115836	C00116646	26/01/05
AVSD1209IT	C00095316	C00097296	80300390052	C00115836	C00116647	03/02/05
AVSL9EIT	C00095316	C00109683	80314940052	C00115836	C00116648	26/01/05
AVSL129IT	C00095316	C00109814	80319300052	C00115836	C00116649	03/02/05
AVSF109SIT	C00095316	C00114993	80331380052	C00115836	C00116650	03/02/05
AVSF109EU	C00095316	C00114577	80340460052	C00115836	C00116651	03/02/05
AVSF120FR	C00095316	C00114987	80344100052	C00115836	C00116652	03/02/05
AVSF129EU	C00095316	C00114481	80340470052	C00115836	C00116653	03/02/05

n1040353: Introduction of 150° Zamac hinge on Ariston models (Comunanza).

From serial no. 50207.0001, all Ariston models produced in the Comunanza factory (see table 001 attached) with industrial code (given on the rating plate) starting with 80, have been equipped with a Zamac hinge with 150° opening angle, code C00115666 (see Fig.001).
This modification has involved the introduction of the following items:

Code C00115670 - Complete door EVOII 150° white 27 with standard glass;
Code C00115674 - Complete door EVOII 150° white 27 with long glass;
Code C00115668 - Complete door EVOII 150° silver with standard glass;
Code C00115673 - Complete door EVOII 150° silver snella standard glass;
Code C00115662 - EVOII body for 150° hinge white 27
Code C00115663 - EVOII body for 150° hinge silver 27
Code C00115664 - Snella EVOII body for 150° hinge white 27
Code C00115665 - Snella EVOII body for 150° hinge silver

The premodified items are not interchangeable separately with the modified ones.

Code C00096416 - Complete door EVOII LB 180° standard depth silver;
Code C00097374 - Complete door EVOII 180° WD 180° white 27 long glass;
Code C00110133 - Complete door EVOII Standard 180° white 27
Code C00110178 - Complete door EVOII Snella 180° Silver;
Code C00091836 - EVOII body white 27 for 180° hinge;
Code C00094306 - EVOII body silver for 180° hinge;
Code C00094305 - Snella EVOII body white 27 for 180° hinge;
Code C00094307 - Snella EVOII body silver for 180° hinge;

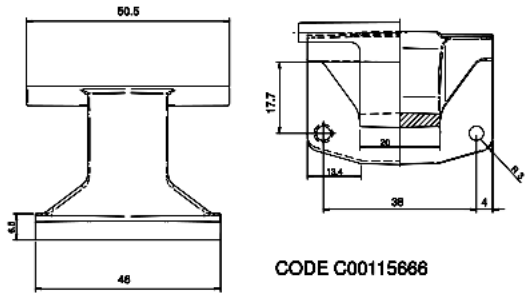


Fig . 001

n1040359: Polar White Factory 80 (Comunanza)

From serial no. 50315.0001, the new "Polar White" colour is used on all washing machines and washer-dryers produced in factory 80 in place of White 27.
The third last number of the Industrial Code given on the rating plate of the modified models is 9 (e.g. 80286390900).
To determine the new Polar White codes, it is necessary to know the industrial code or serial number of the appliance being repaired.
The new items, which bear the initials "PW" in place of "B27", are not aesthetically interchangeable with premodification items as the whites are different. Both colours will be available for some time.
The items affected by this modification are:
Body, rear panel, top, control panel, handles, buttons, knobs, knob disc, door and plinth.


n1040376: Drain pump with filter with pin.

A new drain pump with filter with pin has been introduced progressively as from serial no. 50609.0001.

New parts:
C00119307 - Drain pump with pin filter;
C00141034 - Askoll / Plaset drain pump with pin filter kit (figure 001);

Premodification parts:
C00092264 - Drain pump;
C00045027 - Askoll / Plaset pump filter kit (figure 001);

The new parts can be used on all WASHING MACHINES previously equipped with the premodification parts.

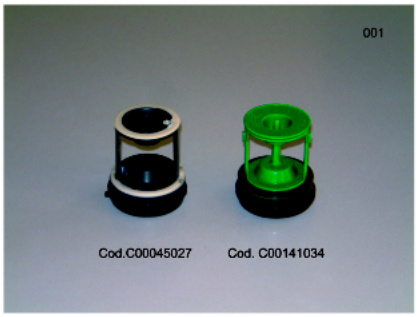

n1040378: 3.5 three phase module, factory 80 (Comunanza)

From October 2005, the new 3.5 module has been installed on three phase Comunanza models (80)

New parts:
C00254298 - Three phase module for card LB-WD 3.5;


C00141769 - J10-MV J16-EVA/NT WD cables (see picture attached).

Premodification parts:
C00257406 - MODULO WD>1200 G. +SC FW2.74 (CARD)
C00093717 - Cables J10-EWA MV NT WD.

The new items are not interchangeable with the premodification ones.

New CARDS codes have been introduced for use with modified products; the list of part codes affected is given below along with the industrial code on which the modification was introduced, the relevant serial number, the eeprom code introduced (to be used only on modified products) and the model code.

80288730905 - 51024.0001 - C00141772 - AVD149EX
80298490905 - 51017.0001 - C00141774 - AVL169EU
80319300905 - 51015.0001 - C00141775 - AVSL129IT
80328540905 - 51017.0001 - C00141773 - AVL135FR
80314940905 - 51020.0001 - C00141777 - AVSL9EIT
80325690905 - 51003.0001 - C00141784 - LBE129ALL
80286370905 - 51008.0001 - C00141789 - AVL129R
80332130905 - 51011.0001 - C00141790 - BWM129
80284480905 - 51007.0001 - C00141795 - AVD129EX
80284460905 - 51025.0001 - C00141796 - AVD109EX
80297000905 - 51007.0001 - C00141797 - AVL109R
80340430055 - 51020.0001 - C00141799 - AVF109SEX
80342160905 - 51015.0001 - C00141800 - AVF109EX
80344100905 - 51020.0001 - C00141801 - AVF120FR
80297010905 - 51013.0001 - C00141803 - AVSL109R
80291170905 - 51012.0001 - C00141805 - AVSL89IT
80284291005 - 51015.0001 - C00141806 - AVSL109IT
80340440905 - 51025.0001 - C00141809 - AVF129EX
80319780905 - 51013.0001 - C00141770 - AML135FR
80305920905 - 51024.0001 - C00141781 - AMD109EU
80332140905 - 51011.0001 - C00141779 - BWD129
80305890905 - 51025.0001 - C00141782 - AMD129EU
80325700905 - 51011.0001 - C00141784 - CDE129ALL
80305960905 - 51005.0001 - C00141785 - AML89EU
80305980905 - 51013.0001 - C00141787 - AML129EU
80300070905 - 51013.0001 - C00141788 - AML125FR
80332390905 - 51014.0001 - C00141798 - MLSE129ALL
80284470255 – 51027.0001- C00142008 - AVD109SEX
80296280905 – 50928.0001 - C00142009 - AVSD109EU
80297690905 – 51027.0001 - C00142010 - AVLS129R
80299930055 - 51102.0001 - C00142011 - AVSD109SEX
80300080905 – 51027.0001 - C00142012 - AMD145FR
80297760905 - 51031.0001 - C00254537 - AVSG12EU
80340451005 - 51104.0001 - C00142013 – AVF149EX
80340460905 - 51028.0001 - C00142014 - AVSF109EU
80340470905 - 51029.0001 - C00142015 - AVSF129EU
80331370055 – 51027.0001 - C00142017 - AVF109SIT
80288710905 - 60215.0001 - C00141808 - AVG12EU.
80303630905 - 51031.0001 - C00098467 -AVD149DE
80284340905 - 60131.0001 - C00142007 - AVG1600EU
80284890905 - 60131.0001 - C00143734- AVG16TK
80339800105 - 60208.0001 - C00254277 - AVF169SK.

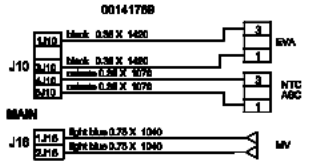

n4008c01: Smart Card - LVB/DRYERS

Beginning April 2008 spare parts warehouse started to manage the EVOII modules with eeprom fixed, these can only be programmed with smart card/palmare/pc.

Attention!! The premodification with eeprom socket can be programmed with smart card/palmare/pc using a blank eeprom or with pre programmed eeprom.

Spare parts of modules with eeprom fixed/eeprom socket:

C00265676 with eeprom fixed - C00143068 with eeprom socket - for models with conducibility sensor
C00254298 with eeprom fixed - C00143068 with eeprom socket - for models without conducibility sensor
C00254297 with eeprom fixed - C00259941 with eeprom socket
C00254531 with eeprom fixed - C00143058 with eeprom socket
C00254297 with eeprom fixed - C00143057 with eeprom socket - for models without blocking drum
C00265697 with eeprom fixed - C00143057 with eeprom socket - for models with blocking drum
C00254297 with eeprom fixed - C00143056 with eeprom socket
C00254530 with eeprom fixed - C00259738 with eeprom socket
C00254533 with eeprom fixed - C00143060 with eeprom socket
C00254535 with eeprom fixed - C00145013 with eeprom socket
C00254530 with eeprom fixed - C00145551 with eeprom socket
C00254529 with eeprom fixed - C00142293 with eeprom socket
C00257406 with eeprom fixed - C00143989 with eeprom socket
C00257409 with eeprom fixed - C00144151 with eeprom fixed
C00254530 with eeprom fixed - C00143069 with eeprom fixed

DRYERS
C00255835 with eeprom fixed - C00258789 with eeprom socket
C00255835 with eeprom fixed - C00194077 with eeprom socket


This notice has a "reference list" specific for each product where you can find the link between smart card and the eeprom code with the same software.

Electric schemes and links


Cod. 21011188300




COMPLESSIVO A




COMPLESSIVO D1 - MICRORIT




COMPLESSIVO I - SENS.CONDUCIB




COMPLESSIVO B1 - COMUNICAZIONE DISPLAY

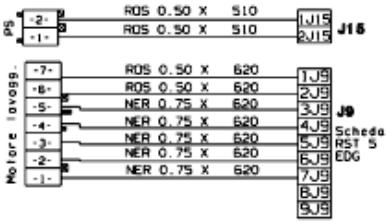

COMPLESSIVO N - MOTORE+POMPA

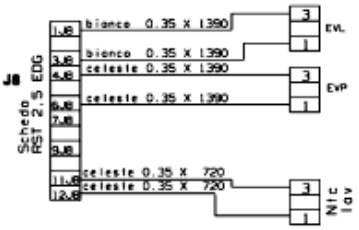

COMPLESSIVO C1 - EVL+EVP



COMPLESSIVO Y - TERRA MACC.TRIFASE


21011188300

Legend

Legend: 21011188300

Electric schemes and links

Cod. 21500759700

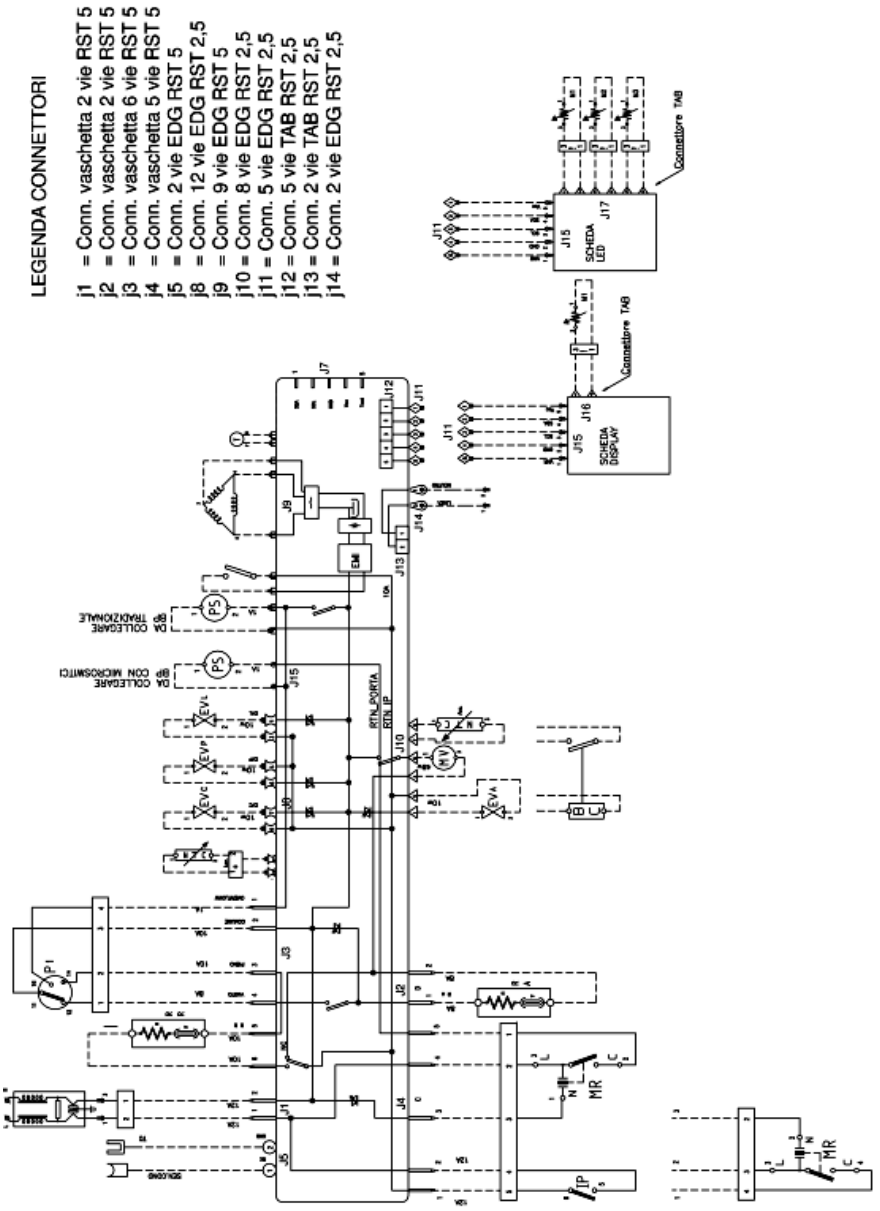

MODULO EVO II TRIFASE 215007597.00

Legend

Legend: 21500759700