
INDESIT company

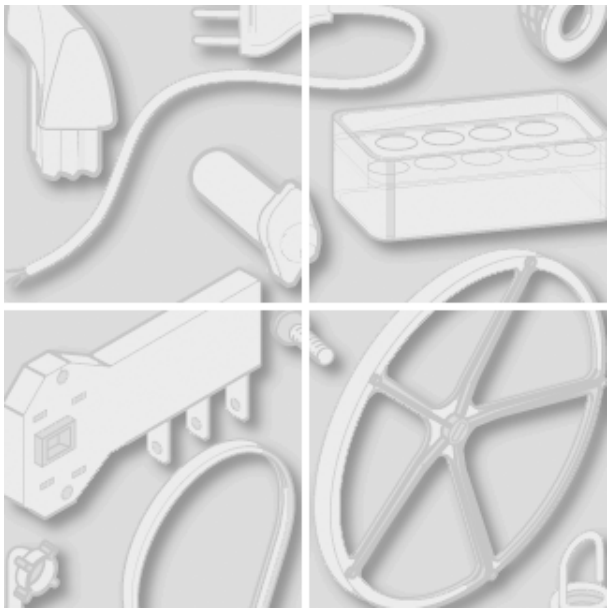

Model type:
LI640A

Commercial code:
F029512

General notes

Technical Documentation guidelines

You can find herewith some generic information to simplify cunsulting of technical documentation:

1. Models of same range share the same exploded views, which report the richest set of spare parts:generally, a model does not necessarly have a related spare part for each particular shown on exploded views.

2. Some spare parts can not be represented directly on the exploded views (instruction booklets, specific kit, etc...). You can find those codes in the spare parts list with the same reference of particular where spares are installed or with references 099, 999. Instruction booklets, once managed, appear with 000 reference.

3. On the higher right site of each exploded view there is a serial number which indicates the beginning of the production of certain range:some models might have more than an exploded view for a given category, each distinguished by a different serial no.and linked to another spare parts list, In this case, serial no. is required to supply the right spare part code. Exploded view to be considered is the one with a more recent serial no. but previous than the one of the model that needs assistance.

4.Exploded views might require further updates even after publishing. Addition of new spares will go on following the already existing numeration references. Revision number of an exploded view is shown into last four digits of serial number into upper right hand corner.

5.The spare parts list associated to an exploded view shows related codes of spares managed for a certain model; for each spare part other informations are available:


REF: reference no of spare into a table; SUBSTITUTE: list of spare(s) which can replace a code but that keeps same functional characteristics

INDUSTRIAL CODE: list of variables of a model (shown into model label) where such spare is used; NOTICE: code of information(s) to refer to complete technical intervention, track for changes or to find correct spare part code.

6. Some notices, into a same section are generic therefore cannot be directly linked to a spare part. In order to assist a model in the best way as possible, it is helpful to pay attention to all notices and constantly verify documentation updates

7.Technical documentation cover shows model name and its commercial codes

2210150 Exploded views

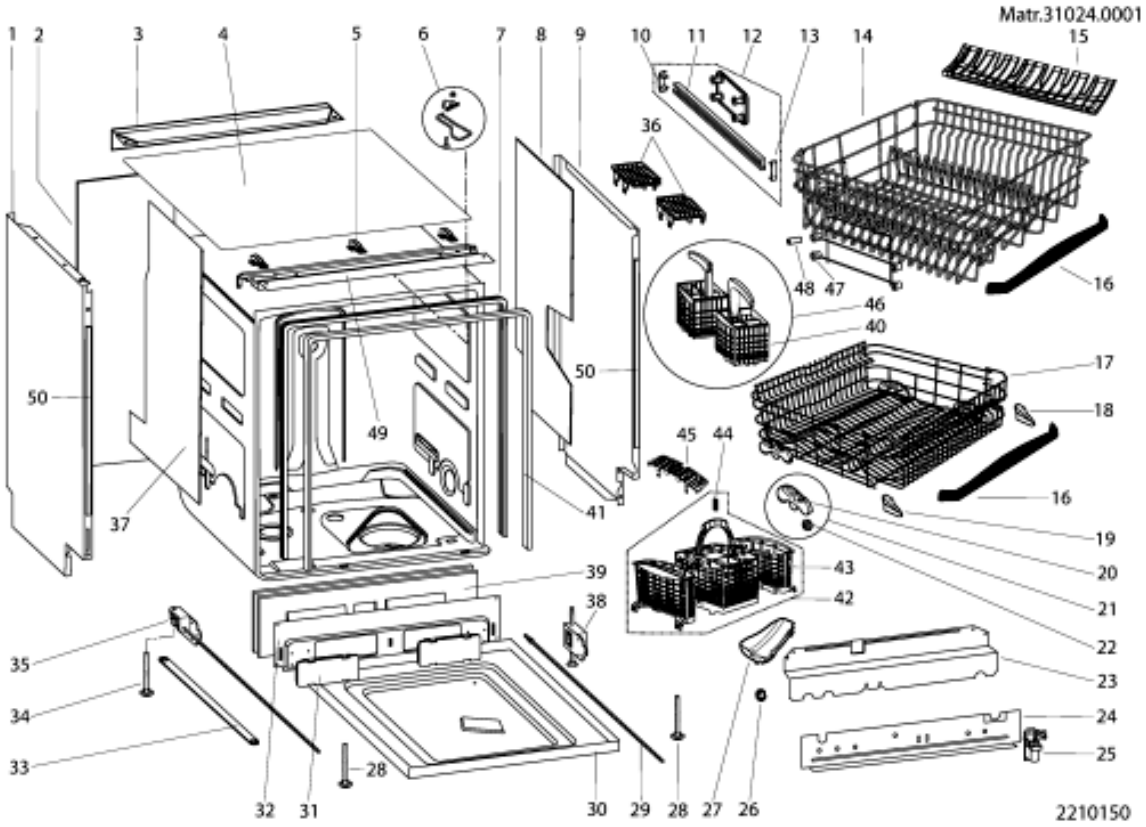


2210150 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
000	C00095825				instruction book it-gb-fr-d-nl-sp-p		
000	C00117466				instruction book dk-se		
001	C00092827			1 x C00092835	left side panel lh zinc		
003	C00033591				rear support - top		
004	C00141310				upper panel polionda 60cm evo3	n1045127	
006	C00085024			1 x C00037135	catch plate (cabinet)		
				1 x C00297907			
				1 x C00297909			
				1 x C00297910			
007	C00116110			1 x C00141317	door seal - top and sides mm1608	n1045127	
007	C00141317				top and side door seal (1638mm)	n1045127	
009	C00092828			1 x C00092835	right side panel lh zinc		
010	C00094117				rail back stop evo3		
011	C00094116			1 x C00094112	basket runner - upper evo3		
012	C00094112				runner assembly		
013	C00094118				runner end stop		
014	C00094233			1 x C00115003	upper basket noclik/clak evo3	n1045069	37295120000
						n1045093	37295120100
014	C00115003		50315...		upper basket noclik/clak evo3	n1045093	37295120000
						n1045102	37295120100
014	C00118143	50316...		1 x C00118142	upper basket noclik/clak markii		37295120200
015	C00094140				flap upper basket evo3	n1045093	
015	C00114799				light blue flap upper basket evo3	n1045093	
017	C00094232			1 x C00275698	lower basket evo3	n1045069	
018	C00094181				cap lower basket right evo3		
019	C00094187				cap lower basket left evo3		
020	C00086476				roller-lower basket body		
021	C00086474				roller-lower basket assembly		
022	C00086475				roller-lower basket		
023	C00091600				rear support - middle		
024	C00091598				lower rear support reflex		
025	C00078395			1 x C00076659	radio interference suppressor		
				1 x C00143383			
026	C00054830				drain hose fastener		
027	C00088301				grease box		

2210150 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
028	C00092555				foot 155mm		
029	C00082476				rear foot adjustment assembly		
030	C00092554			1 x C00118842	tray on bottom of tub 60cm		
031	C00054833				top for front support		
032	C00091599			1 x C00119016	front support lower 60cm		
033	C00076656				slide for foot		
034	C00092822				adjustable back foot		
035	C00092820				left rear foot adjustment assembly		
038	C00092821				rear foot adjustment assembly		
039	C00085284				front panel soundproofing 60cm		
041	C00054932				frame support for tub seal 60cm	n1045047	
042	C00094127			1 x C00094137 1 x C00119532	single basket evo3		
042	C00094137			1 x C00119532	cutlery basket assy ariston		
044	C00086484				spring for		
045	C00087980				cutlery basket top		
049	C00079013				door spring adjuster		
050	C00086602				edge cover right		
050	C00086603				edge cover left		
099	C00036547				anti condensation strip - worktop		
099	C00094138				lower basket buffer evo3		

2210210 Exploded views

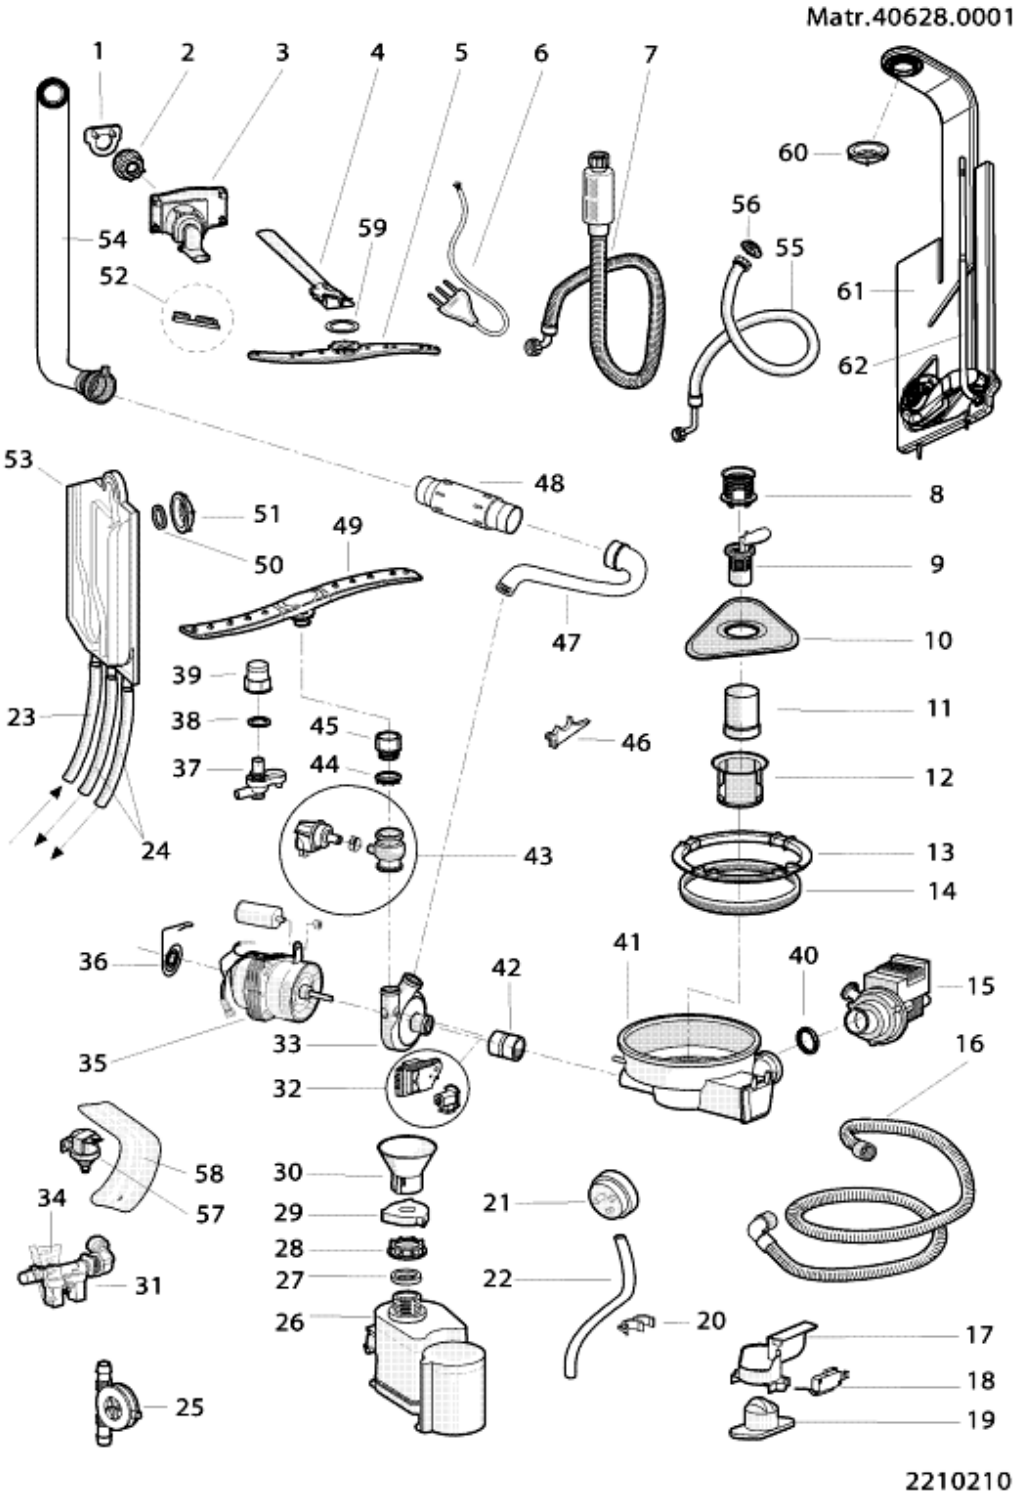

2210210 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
001	C00054925				upper was basket guide casing		
002	C00054862			1 x C00144315	ring-nut fasten.external hose top		
003	C00094134			1 x C00110526	water supply distribution assembly	n1045084	
				1 x C00110527			
003	C00110526				water supply distribution assembly		
004	C00054926			1 x C00110526	upper wash arm feed pipe	n1045084	
				1 x C00110527			
004	C00110527				upper wash arm feed pipe		
005	C00075746				upper wash arm curved set		
006	C00083706			1 x C00143371	supply cable schuko		
				1 x C00144229			
007	C00083761				inlet hose - includes antioverflow		
008	C00094158			1 x C00142344	filter grid evo3	n1045083	
009	C00054863			1 x C00142344	central filter		
009	C00094156			1 x C00142344	central filter basket/retainer evo3	n1045083	
010	C00054851			1 x C00145075	outlet filter stainless lvs2000		
011	C00081164			1 x C00142344	filter cylindrical		
011	C00094164			1 x C00142344	filter cylindrical evo3	n1045083	
012	C00061929				outer fine rotating polyester filter		
013	C00054854				sump fixing ferrule		
014	C00054828				gasket - sump fixing ring		
015	C00112306		60430...	1 x C00143739	drain pump 230v 50hz evo3	n1045133	
015	C00118767	60501...		1 x C00143766	drain pump v220-240 50hz		
016	C00054869				drain hose		
017	C00081162				container - overflow unit		
018	C00037205			1 x C00143107	microswitch		
019	C00058843				float - overflow unit		
020	C00095801				pressure hose clip evo3		
021	C00094151			1 x C00143740	pressure switch 90 71 evo3		
022	C00094154				pipe pressostat lvs evo3		
023	C00094267				tube water inlet air-break/turbine	n1045085	
023	C00110612			1 x C00111855	tube water inlet electrovalve/air-	n1045085	
				1 x C00115348			
024	C00054868				tube - softener/sump l.(480mm)		
025	C00094172				turbine evo3	n1045085	


2210210 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
026	C00094171				water softener adjustable evo3		
027	C00103610				seal - softener/wash chamber		
028	C00041090			1 x C00144235	retaining ring - softener		
029	C00056435				salt cap		
030	C00005819				salt funnel		
031	C00084558			1 x C00143737	load electrovalve	n1045085	
031	C00087337				collar seal		
031	C00094168				2-way electrovalve 4lt/1 evo3	n1045085	
033	C00055005				pump cover		
034	C00094160				protection electrovalve evo3		
035	C00076627				wash motor/pump assy 220v-60w		
036	C00076628				tub spring		
037	C00094159		60903...		overflow connector evo3		
037	C00196353	60904...			overflow connector evo3		
038	C00075695				connection gasket overflow		
039	C00143580		60903...		bodytop overflow evo3 rohs		
039	C00196352	60904...		1 x C00094159 1 x C00143580	bodytop overflow evo3 rohs		
040	C00054917				seal 'o'ring (23,81x2,62)		
041	C00094143			1 x C00141158	set sump evo3		
042	C00079016				pipe rubber sump-pump		
043	C00094157		60430...	1 x C00142435 1 x C00144125	high pressure sensor assembly	n1045136	
043	C00142435	60501...			high pressure sensor assembly		
044	C00075057			1 x C00075111	cap corner for support washing		
045	C00066643			1 x C00075111	support - lower wash arm bush		
046	C00078394				outlet pump support		
047	C00091568				hose circulating pump to heater		
048	C00057684				washing heating element 2000w		
049	C00094182				lower wash arm		
050	C00084600				o ring seal 38 mm		
051	C00054927			1 x C00144335	ring-nut for air-flow body		
052	C00056342				steel pin fixing upper wash arm	n1045084	
053	C00094174				water inlet air break evo3	n1045085	
053	C00110610			1 x C00115360	air break + turbine evo3	n1045085	

2210210 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
053	C00141308			1 x C00141655	air break + turbine evo3	n1045127	
054	C00094152				external pipe (hidden heating		
059	C00098769				upper wash arm seal		
099	C00033026			1 x C00292523	ambljgon grease ta 100 gr.		
099	C00073917				clamp for pump cover		
099	C00077010				clamp washing heating element		
099	C00084479				hose clamp		
099	C00094150				clip pressure sensor evo3		
099	C00094162				pipe fixing band on turbine		

2210380 Exploded views

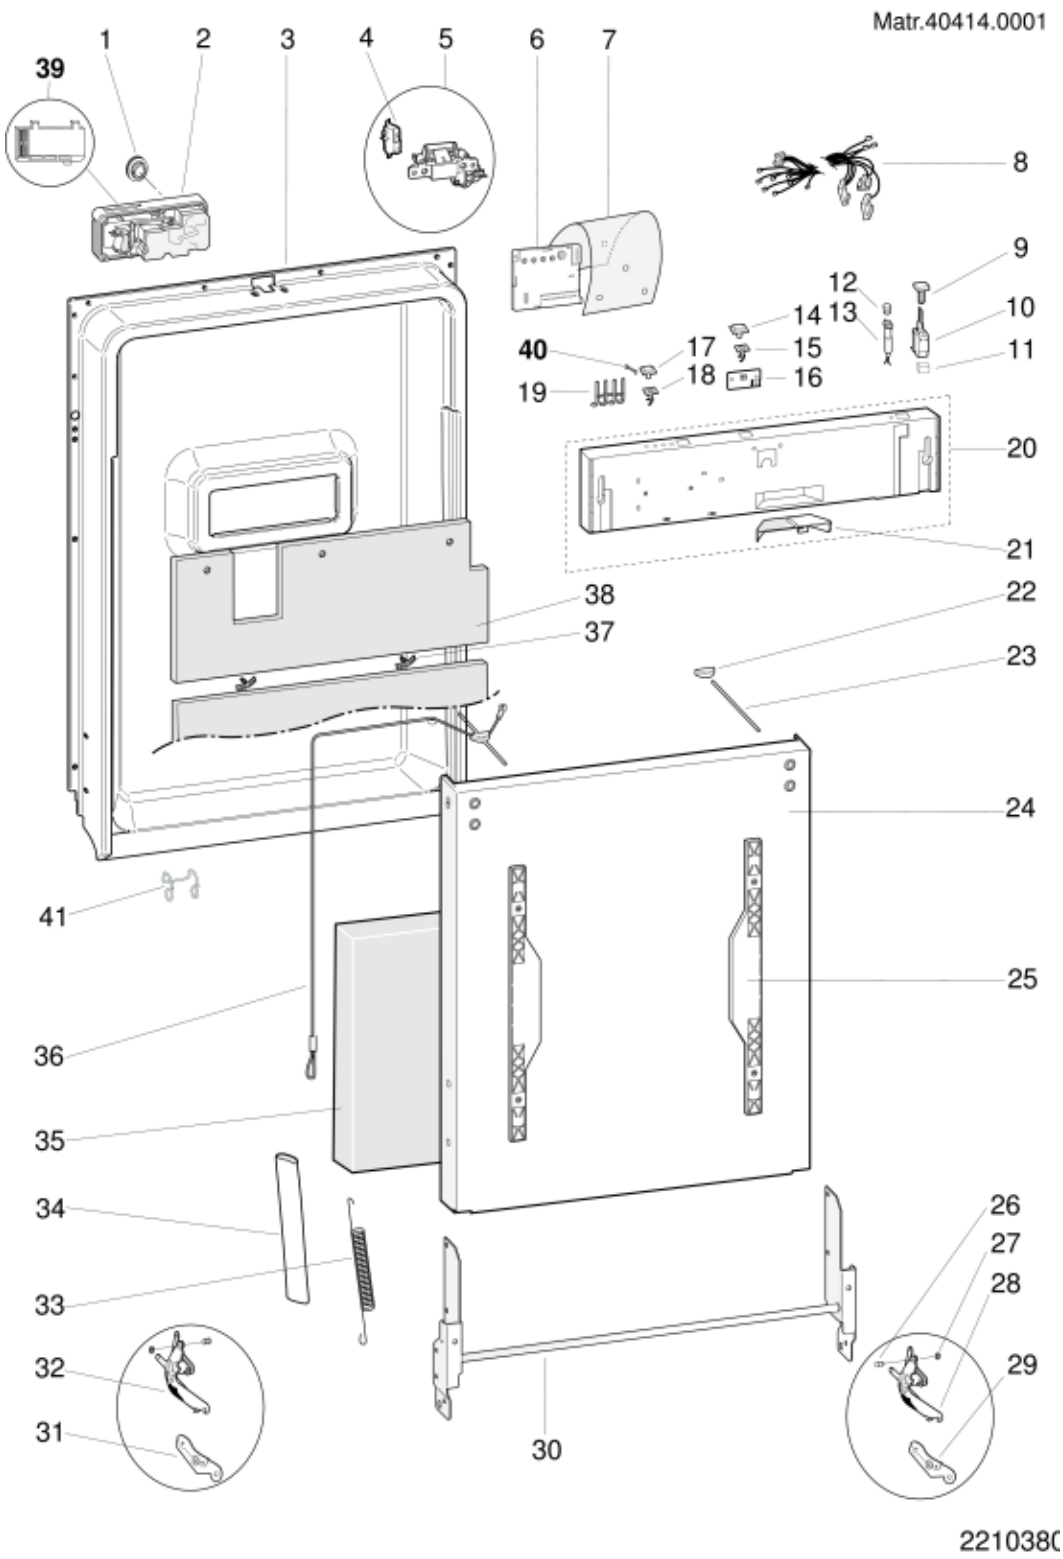

2210380 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
001	C00051755				rinse aid cap (pair) raised & flush		
002	C00094133			1 x C00143377	electrodispenser(lamp rinseaid-no		
003	C00091543			1 x C00290247	door seal lower 60cm		
003	C00095276		50315...		inner door panel stainless evo3	n1045102	37295120000
						n4509a00	37295120100
003	C00109698	50316...		1 x C00290243	inner door panel built-in		37295120200
004	C00085358				microswitch		
005	C00094128			1 x C00195887	locking assembly evo3		
006	C00096235			1 x C00097890	control card bit100.1 'p1' +	n1045067	
006	C00108957				bracket for timer bit 100		
007	C00095277				timer protection bit100		
008	C00095828				wiring harness assembly	n1045067	
008	C00097286		60430...	1 x C00111175	wiring harness assembly	n1045067	
008	C00145488	60501...			parallel wiring harness assembly		
009	C00053468				push-button		
010	C00041184		60430...		on-off switch (double pole) (dw)	n1045135	
010	C00140609	60501...			on-off switch (unipolar) lvs		
011	C00095278				terminal protection on/off switch		
012	C00100524				red pilot lamp lens		
013	C00051880				red pilot lamp		
014	C00086489				push-button extra		
015	C00085482				button lever		
016	C00086493			1 x C00143582	card extra dry		
017	C00085481				p - button cover		
018	C00095811				button lever evo3		
019	C00095812				pilot lamp lens		
020	C00095827				dashboard 'li640a'		
021	C00058094				protection lid handle		
022	C00054933				spring adjustment piece		
023	C00055000			1 x C00143736	special screw for spring		
024	C00095269				door panel zinc		
025	C00087431				door panel adhesive plastic strip		
026	C00048504				hinge pin		
027	C00058776				washer d = 6 mm		
028	C00085017				rh hinge		

2210380 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
029	C00085016				hinge cam+lh upper		
030	C00085014				hinge assembly		
031	C00085015				hinge cam+lh upper		
032	C00085018				lh hinge		
033	C00086467				door spring		
034	C00066426				tube hinge spring		
035	C00095273				door spacer	n1045088	
036	C00054936				spring adjustment wire		
037	C00087235				spring front panel soundproofing		
038	C00087216				front panel soundproofing 60cm		
039	C00098134				door detergent electrodispenser	n1045069	
040	C00109844				distance piece for p push button	n1045078	
041	C00140679				seal spring	n1045127	
099	C00076108			1 x C00012687	screw canoe klip		
099	C00084911			1 x C00304782	screw 3.5x9.5		
099	C00092251				fixing hole plug		
099	C00094120				fixing bolt inner door/dashboard		
099	C00094141				fixing screw inner/outer door		
099	C00095275			1 x C00256870	installation kit		
099	C00095896				inox door xdo (o.l.a.)##		
099	C00111286				transparent door lvs evo3 60cm ##		
099	C00284955				spacer door b.i. full integrated		

Notices

n1045048: BIT 100 CARD INITIALIZATION

Free-standing dishwasher

1- Close the door and switch the dishwasher on.
2- Wait for the test cycle to start (2 LEDs light up or "ROD" appears on dishwashers with display).
3- Wait 10 seconds (dishwasher will start to fill water...)
N.B. If the cycle fails to start the card has probably already initialized, so proceed to point 5.
4- To reset the test cycle turn the programme button to reset or hold down the start/reset button for 5 seconds. (Wait for the buzzer to beep three times or if the dishwasher does not have a buzzer, wait for the programme LEDs to switch off.)
5- To check the aforementioned steps have completed successfully, select a programme and see if it starts; (reset it after this check).
6- The dishwasher is ready for the customer.

Built-in dishwashers

1- Close the door and switch the dishwasher on.
2- Wait for the test cycle to start
3- Wait 10 seconds (the dishwasher will start to fill...)
N.B. If the cycle fails to start the card has probably already initialized, so proceed to point 5.
4- To reset the cycle, open the door (2 LEDs lit up) and press the programme button for three bips of the buzzer (or until the programme LEDs go off for dishwashers with no buzzer).
5- To check the aforementioned steps have completed successfully, press the select programme button and check that the indicator light beside the corresponding programme comes on.
6- The dishwasher is ready for thecustomer.

n1045067: Modification of model recognition resistance on LI640A and LI620.

From serial no. 30623.0001, the wiring on LI640A (industrial code 37295120000) and LI620 (industrial code 37295110000) model dishwashers has been modified with the introduction of a new model recognition resistance.

LI640A new wiring Service code 097286, premodification Service code 095828;
LI620 new wiring Service code 097288, premodification Service code 095814.

The new wiring is not interchangeable with premodification items; wiring diagrams are the same.

N.B.: When replacing the timer on machines produced before serial no. 30623.0001, also the premodification wiring must be replaced with the new wiring.

n1045069: Modification of racks and dispenser lid on EVO3 dishwashers


---

To obtain better dissolving of the detergent during the wash cycle, the following modifications have been made to EVO3 dishwashers:
- new dispenser lid, replacement code 098134 (see figure N1045069FIG4) created;
- upper racks modified with lid catch angle changed from 9° to 16° (see figure N1045069FIG5);
- MultiSystem lower racks modified with insertion of a spacer wire at the electric dispenser (see figure N1045069FIG6).


The upper and lower racks have the same spare part codes as the premodification items; Replacements Warehouse stocks have been replaced.

Lid installation instructions:
1) prise the lid out of the dispenser seat using a small screwdriver at point A (figure N1045069FIG1);
2) replace the lid, checking that release spring B (figure N1045069FIG2) is in place; before fitting the new lid load the spring from position 1 to position 2 (figure N1045069FIG2);
3) fit the lid in its special seat and check for correct operation (figure N1045069FIG3).
Lid closing may be harder for the first few cycles after replacement, due to settling of the material.

N1045069FIG1

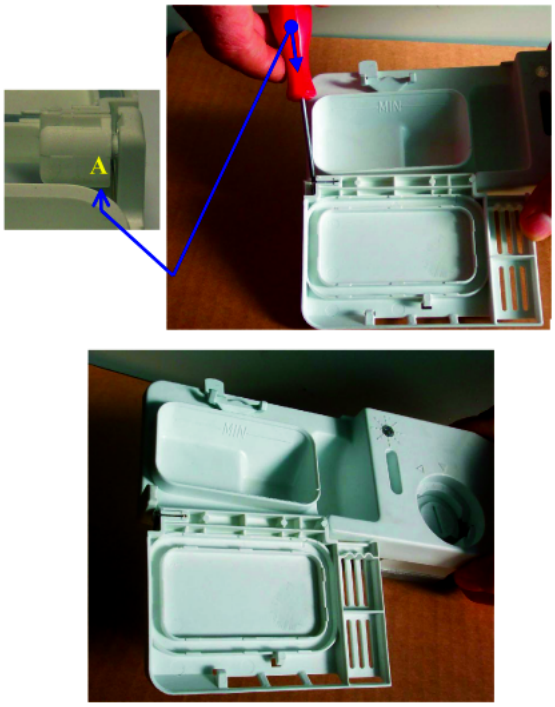


N1045069FIG2

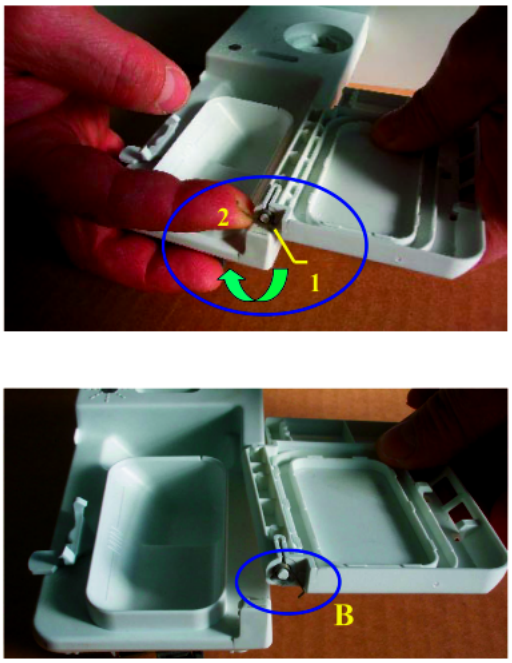


N1045069FIG3




N1045069FIG4

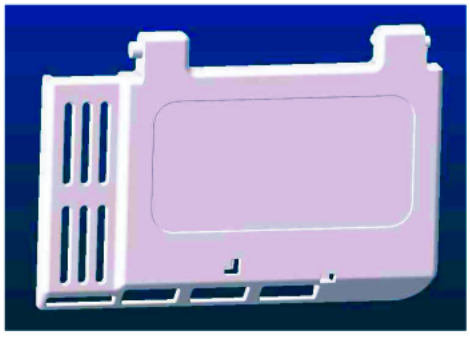


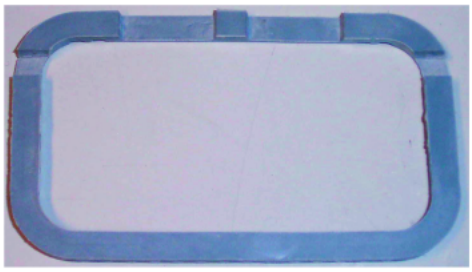

N1045069FIG5

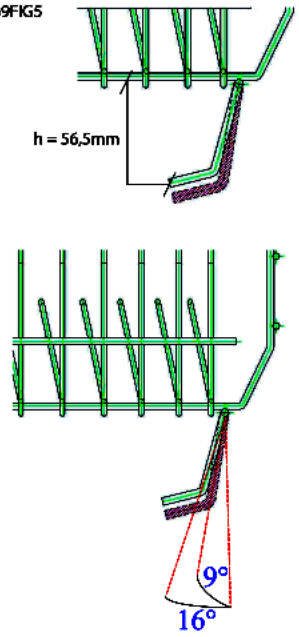


N1045069FIG6

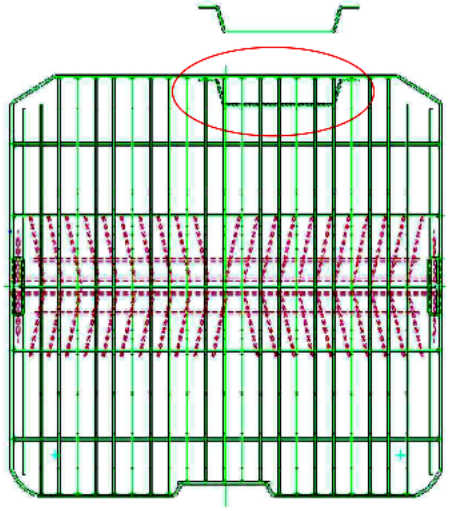

n1045078: Introduction of distance plug for button "P"

From serial no. 40406.0001, all dishwashers affected by this note have been equipped with a distance plug Service code 109844 in order to improve the mechanism of the "P" programme button (see N1045078FIG1).

N1045078FIG1

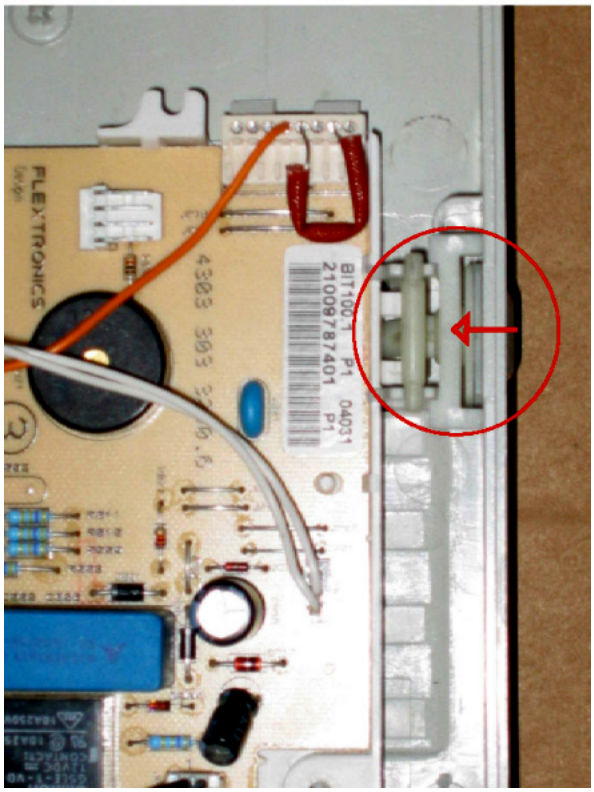

n1045082: Timer Bit 100 programmes for Evo3 60cm dishwashers

Table N1045082FIG1 shows information relevant to the programmes of the following Timer Bit 100 for Evo 3 60 cm dishwashers:
Timer BIT 100 - E1 - Service code 097890 (rohs 143206);
Timer BIT 100 - E2 - Service code 097481 (rohs 143207);
Timer BIT 100 - E3 - Service code 099892 (rohs 143208);
Timer BIT 100 - S1 - Service code 109875 (rohs 143211).

PROGRAMMES:
1) Energico or Super Wash or Intensive
2) Normal or Daily
3) Eco (Ciclo per Istituti)
4) Rapido
5) Ammollo
6) Cristalli
7) Special Guest
8) Just you
9) Duo-Wash o Crystal and Pot

PROGRAMME PHASES:
A) Pre-wash
B) Pre-wash
C) Wash
D) Rinse
E) Rinse
F) Rinse
G) Drying

PROGRAMME MODIFICATIONS ARE INDICATED IN RED.

TIMER BIT 100 - EVO 3

PROGRAMS	PROGRAM PHASES							Time	Effective Time	Kw/h	L
	A	B	C	D	E	F	G				
1	X	40°C	65°C	cold	cold	65°C	✓	120'	125'	1,4	23,0
2	X	X (ex:cold)	55°C	cold	X	70°C	✓	72'	85'	1,25	16,0
3	cold	cold	50°C	X	X	65°C	✓	130'	138'	1,05	18,0
4	X	X	47°C (ex:40°C)	62°C	X	X	extradry	24'	38'	0,7	10,0
5	cold	X	X	X	X	X	X	12'	12'	0,01	4,0
6	X	X	52°C (ex:55°C)	45°C	X	65°C	✓	96'	98'	1,16	16,0
7	X	X	X	X	X	65°C	✓	36'	38'	0,8	6,0
8	X	X	50°C	67°C	X	X	✓	40'	40'	0,9	10,0
9	cold	X	52°C (ex:55°C)	45°C	X	65°C	✓	108'	110	1,18	18,0

n1045083: Modification of filters on EVO3 60 cm dishwashers

All dishwasher models affected by this modification have been equipped with the items listed below, in order to solve the drain pump clooging problem.


Introduction of:
Cylindrical plastic filter code 081164
Central filter code 054863

Elimination of:
Cylindrical plastic filter code 094164
Central filter code 094156
Central filter grid code 094158

The modification has been introduced progressively, starting from serial no. 40516.0001.

n1045084: Elimination of duct fixing pin code 056342

N1045083FIG1

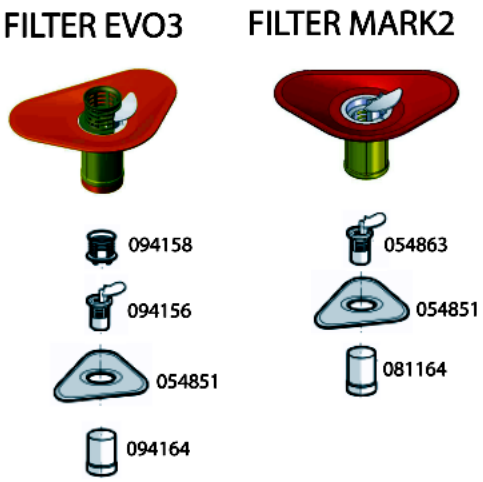

Duct fixing pin code 056342 has been eliminated from all dishwashers affected by this note, modifying the connection between the feeder-distribution assembly and the internal duct.

Introduced items:
Internal duct 110527
Feeder-distribution assembly 110526

Eliminated items:
Internal duct 054926
Feeder-distribution assembly 094134 (EX 054871)
Duct fixing pin 056342

The modification has been introduced progressively, starting from serial no. 40517.0001.

n1045085: Introduction of new litre counter turbine integrated on air-break.

All dishwashers affected by this note have been equipped with a new litre counter turbine on the air-break.
Picture N1045085FIG1 illustrates the premodification structure, picture N1045085FIG2 the new structure.

Items affected by the modification.

AIR-BREAK:
new 110610;
premodification 094174;
the new item features a new integrated litre counter turbine and its water supply hose has a smaller diameter.

LITRE COUNTER TURBINE code 094172 has been eliminated.

SOLENOID VALVES:
new:
1-WAY code 110611;
2-WAY code 084558(Rohs 143737);
premodification:
1-WAY code 094227;
2-WAY code 094168;
the new solenoid valves have a smaller diameter drain hose fitting.

HOSES:
new solenoid valve hose/air-break code 110612;
premodification turbine hose/air-break code 094267;
premodification solenoid valve hose/air-break code 094267;
the new hose has a smaller internal diameter.


WIRING:
the litre counter turbine connecting cable is longer, but since the connector is the same, the new item can be used in place of the premodification one.


Affected models with related modification introduction serial numbers:
BCI 450 - 30386 s/n 41001.0001;
BFI 620 - 30708 s/n 41001.0001;
BFI 680 - 30715 s/n 40902.0001;
BFV 620 B - 30718 s/n 41001.0001;
BFV 620 K - 30717 s/n 41001.0001;
BFV 620 W - 30719 s/n 41001.0001;
BFV 620 X - 30720 s/n 41001.0001;
DI 6 - 29930 s/n 41001.0001;
DI 620 A - 29932 s/n 40830.0001;
DI 620 - 29931 s/n 41001.0001.
DI 620 UK - 30351 s/n 41001.0001;
DI 630 A - 30369 s/n 41001.0001;
DV 620 BK - 29927 s/n 41001.0001;
DV 620 BK UK - 30349 s/n 41001.0001;
DV 620 K IX UK - 30350 s/n 41001.0001;
DV 620 WH - 29928 s/n 41001.0001;
DV 620 WH UK - 30348 s/n 41001.0001;
DV 630 A BR - 30695 s/n 40830.0001;
DV 630 A IX - 30693 s/n 40830.0001;
DV 630 A WH - 30694 s/n 40830.0001;
DV 640 A IX - 30368 s/n 40830.0001;
DV 650 A IX - 30696 s/n 40830.0001;
DV 650 A WH - 30697 s/n 40830.0001;
DV 670 A BR - 30701 s/n 40830.0001;
DV 670 A IX - 30699 s/n 40830.0001;
DV 670 A WH - 30700 s/n 40830.0001;
DV 620 IX - 29929 s/n 40531.0001;
DVG 621 BK - 33220 s/n 40830.0001;
DVG 621 IX - 33212 s/n 40830.0001;
DVG 621 WH - 33221 s/n 40830.0001;
DWM 55 A - 29793 s/n 41001.0001;
DWT 10 P.2 - 32228 s/n 40830.0001;
FDW 20 P - 33182 s/n 41001.0001;
FDW 80 G - 33189 s/n 41001.0001;
FDW 80 P - 33187 s/n 41001.0001;

FDW 80 T - 33188 s/n 41001.0001;
FDW 85 A - 33190 s/n 41001.0001;
FDW 60 G - 33185 s/n 41001.0001;
FDW 60 P - 33183 s/n 41001.0001;
FDW 60 T - 33184 s/n 41001.0001;
FDW 65 A - 33186 s/n 41001.0001;
IDE 100 (EU) - 30666 s/n 41001.0001;
IDE 100 S (IT) - 30216 s/n 41001.0001;
IDE 100 SK - 30758 s/n 41001.0001;
IDE 1000 UK - 30044 s/n 41001.0001;
IDE 1005 S UK - 30045 s/n 41001.0001;
IDE 44 EU - 30423 s/n 40911.0001;
IDE 44 UK - 30394 s/n 40916.0001;
IDL 40 DE - 32308 s/n 41001.0001;
IDL 40 EU - 30417 s/n 41001.0001;
IDL 40 FR - 30403 s/n 41001.0001;
IDL 40 S UK - 31956 s/n 41001.0001;
IDL 40 UK - 30393 s/n 41001.0001;
IDL 42 DE - 32309 s/n 40830.0001;
IDL 42 EU - 30419 s/n 40911.0001;
IDL 42 FR - 30404 s/n 40911.0001;
IDL 50 EU.2 - 32006 s/n 40916.0001;
IDL 50 SK.2 - 32221 s/n 41001.0001;
IDL 500 FR - 30014 s/n 40916.0001;
IDL 505 S UK.2 - 32001 s/n 41001.0001;
IDL 51 (EU) - 31075 s/n 40906.0001;
IDL 51 EU.2 - 32217 s/n 40906.0001;
IDL 55 (DE) - 30561 s/n 40909.0001;
IDL 55 (EU) - 30634 s/n 40916.0001;
IDL 55 (IT) - 30212 s/n 40916.0001;
IDL 55 DE.2 - 32220 s/n 40909.0001;
IDL 55 EU.2 - 32215 s/n 40917.0001;
IDL 55 S (DE) - 30565 s/n 40909.0001;
IDL 55 S (IT) - 30213 s/n 40916.0001;
IDL 55 S DE.2 - 32224 s/n 40909.0001;
IDL 57 (PT) - 31086 s/n 40916.0001;
IDL 60 (EU) - 30644 s/n 40909.0001;
IDL 60 (IT) - 30214 s/n 41001.0001;
IDL 60 EU.2 - 32216 s/n 40909.0001;
IDL 60 NL.2 - 32219 s/n 41001.0001;
IDL 60 S (EU) - 30647 s/n 40909.0001;
IDL 60 S EU.2 - 32225 s/n 40909.0001;
IDL 60 SK - 30755 s/n 41001.0001;
IDL 60 SK.2 - 32222 s/n 41001.0001;
IDL 61 (EU) - 30680 s/n 41001.0001;
IDL 61 EU.2 - 32218 s/n 41001.0001;
IDL 62 (EU) - 30686 s/n 40911.0001;
IDL 62 EU.2 - 32223 s/n 40911.0001;
IDL 63 S NL.2 - 32226 s/n 41001.0001;
IDL 70 (EU) - 30654 s/n 40902.0001;
IDL 70 (IT) - 30215 s/n 41001.0001;
IDL 70 D EU - 30600 s/n 41001.0001;
IDL 700 FR - 30016 s/n 41001.0001;
IDL 700 UK - 30042 s/n 41001.0001;
IDL 7021 (SP) - 30603 s/n 40902.0001;
IDL 710 FR - 30017 s/n 41001.0001;
IDL 75 (EU) - 30661 s/n 41001.0001;

IDL 75 EU.2 - 32627 s/n 41001.0001;
IDL 75 S (EU) - 30604 s/n 41001.0001;
IDL 75 S EU.2 - 32845 s/n 41001.0001;
IDL B2 EU - 32271 s/n 40917.0001;
IDL 500 UK.2 - 31984 s/n 40524.0001 ;
IDL 50 EU - 30217 s/n 40531.0001;
IDL 550 FR - 30015 s/n 40531.0001;
IDL 705 SUK - 30043 s/n 40531.0001;
L 6047 FR - 33150 s/n 40830.0001;
L 61 (IT) - 28169 s/n 40917.0001;
L 61 AG - 29907 s/n 40917.0001;
L 61 EU - 28470 s/n 40917.0001;
L 63 (IT) - 28453 s/n 41001.0001;
L 63 AUS - 29912 s/n 41001.0001;
L 63 EU - 29544 s/n 40909.0001;
L 63 SK - 31080 s/n 41001.0001;
L 63 SK.2 - 32227 s/n 41001.0001;
L 63 X (IT) - 28904 s/n 41001.0001;
L 63 X AUS - 29913 s/n 41001.0001;
L 64 AUS - 29914 s/n 41001.0001;
L 64 X AUS - 29915 s/n 41001.0001;
LD 85 (IT) - 28454 s/n 41001.0001;
LD 85 X (IT) - 28457 s/n 41001.0001;
LD 87 (IT) - 28455 s/n 41001.0001;
LD 87 EU - 28473 s/n 41001.0001;
LD 87 FR - 29285 s/n 41001.0001;
LD 87 X (IT) - 28458 s/n 41001.0001;
LD 87 X AUS - 29918 s/n 41001.0001;
LD 87 X EU - 28474 s/n 41001.0001;
LD 87 X SK - 29692 s/n 41001.0001;
LI 420 - 30392 s/n 40830.0001;
LI 460 - 30370 s/n 40830.0001;
LI 480 A - 30371 s/n 40830.0001;
LI 660 A - 30304 s/n 40830.0001;
LI 700 DUO - 29515 s/n 40830.0001;
LI 620 - 29511 s/n 40714.0001;
LI 640 A - 29512 s/n 40531.0001;
LI 670 DUO - 29513 s/n 40603.0001;
LI 680 DUO - 29514 s/n 40607.0001;
LIQ 700 DUO JADE - 29952 s/n 40830.0001;
LL 40 EU - 30408 s/n 41001.0001;
LL 42 EU - 30411 s/n 40907.0001;
LL 420 FR - 30397 s/n 40907.0001;
LL 43 S EU - 30412 s/n 40907.0001;
LL 62 FR - 30614 s/n 41001.0001;
LL 62 X FR - 30615 s/n 41001.0001;
LL 63 EU - 29909 s/n 41001.0001;
LL 63 FR - 28460 s/n 41001.0001;
LL 63 TK - 28471 s/n 41001.0001;
LL 63 X EU - 30174 s/n 41001.0001;
LL 64 X AUS - 29917 s/n 41001.0001;
LL 64 77 - 31940 s/n 41001.0001;
LL 64 AG - 29908 s/n 40920.0001;
LL 64 AUS - 29916 s/n 41001.0001;
LL 64 DE - 31941 s/n 41001.0001;
LL 64 EU - 29545 s/n 41001.0001;
LL 64 SK - 29690 s/n 41001.0001;

LL 64 X EU - 29546 s/n 41001.0001;
LL 65 (IT) - 28903 s/n 41001.0001;
LL 65 EU - 29547 s/n 40906.0001;
LL 65 FR - 28462 s/n 41001.0001;
LL 65 TK - 28472 s/n 41001.0001;
LL 65 X EU - 29910 s/n 40906.0001;
LL 65 X FR - 29284 s/n 41001.0001;
LL 6546 FR - 33151 s/n 40916.0001;
LV 460 A BK - 30379 s/n 40830.0001;
LV 460 A IX - 30377 s/n 40830.0001;
LV 460 A WH - 30378 s/n 40830.0001;
LV 460 BK - 30375 s/n 40920.0001;
LV 460 IX - 30372 s/n 40920.0001;
LV 460 WH - 30373 s/n 40920.0001;
LV 620 BK - 29939 s/n 41001.0001;
LV 620 IX - 29941 s/n 41001.0001;
LV 620 WH - 29940 s/n 41001.0001;
LV 640 A BK - 29942 s/n 40902.0001;
LV 640 A IX - 29946 s/n 40902.0001;
LV 640 A R AN - 29944 s/n 40902.0001;
LV 640 A R OW - 29945 s/n 40902.0001;
LV 640 A WH - 29943 s/n 40902.0001;
LV 650 A ALU - 29922 s/n 41001.0001;
LV 650 A BK - 29925 s/n 41001.0001;
LV 650 A IX - 29921 s/n 41001.0001;
LV 650 A OW - 29923 s/n 41001.0001;
LV 650 A WH - 29924 s/n 41001.0001;
LV 660 A BK FR - 30300 s/n 40902.0001;
LV 660 A IX FR - 30301 s/n 40902.0001;
LV 660 A WH FR - 30299 s/n 40902.0001;
LV 670 DUO ALU - 29926 s/n 41001.0001;
LV 670 DUO AN - 29947 s/n 41001.0001;
LV 670 DUO IX - 29948 s/n 41001.0001;
LV 670 R AN - 30302 s/n 40830.0001;
LV 670 R OW - 30303 s/n 40830.0001;
LV 680 DUO IX - 29949 s/n 41001.0001;
LVI 12-44 AN - 29564 s/n 40830.0001;
LVI 12-44 IX - 29562 s/n 40830.0001;
LVI 12-44 WH - 29563 s/n 40830.0001;
LVI 12-55 AN - 29567 s/n 41001.0001;
LVI 12-55 IX - 29565 s/n 41001.0001;
LVI 12-55 WH - 29566 s/n 41001.0001;
LVI 12-66 AN - 29570 s/n 41001.0001;
LVI 12-66 IX - 29568 s/n 41001.0001;
LVI 12-66 M BA - 29573 s/n 41001.0001;
LVI 12-66 M GI - 29571 s/n 41001.0001;
LVI 12-66 M VA - 29572 s/n 41001.0001;
LVI 12-66 WH - 29569 s/n 41001.0001;
LVO 670 DUO IX - 30848 s/n 40830.0001;
LVO 680 DUO IX - 29951 s/n 40902.0001;
LVR 640 A AN - 33614 s/n 40902.0001;
LVR 640 A OW - 33615 s/n 40902.0001;
LVR 670 AN - 33616 s/n 40830.0001;
LVR 670 OW - 33617 s/n 40830.0001;
LVTI 12-55 - 29574 s/n 41001.0001;
LVTI 12-66 - 29575 s/n 41001.0001;
SDW 60 P - 31010 s/n 40906.0001;

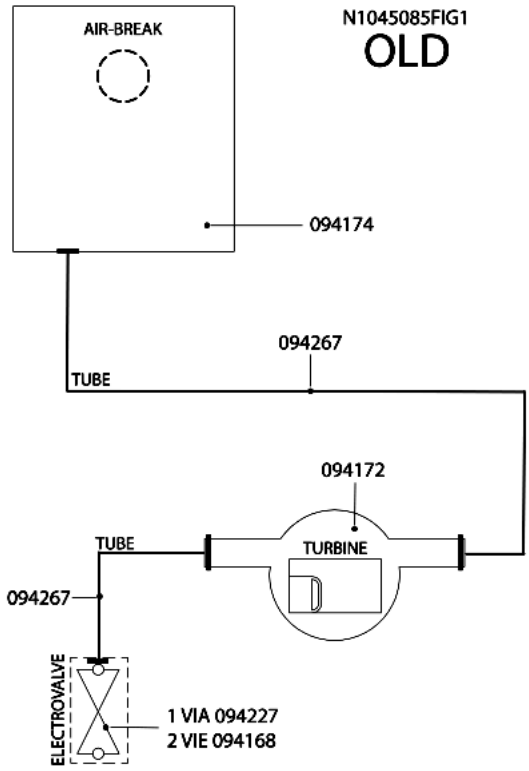

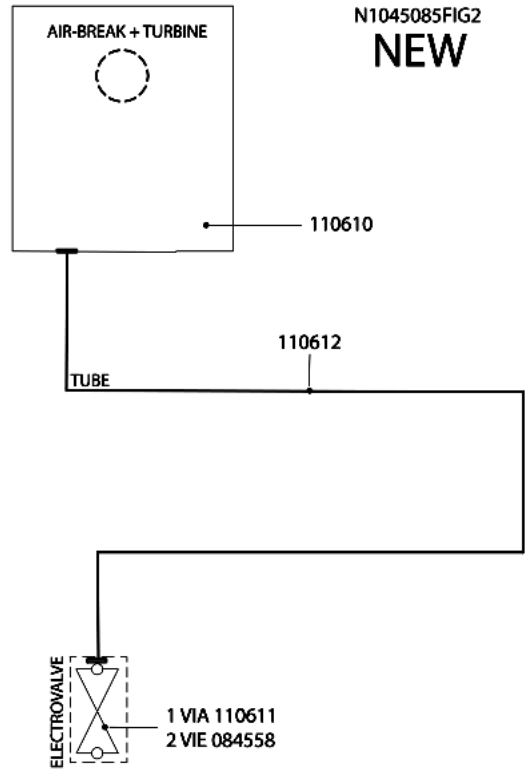

n1045093: Modification of light blue folding shelf attachment.


From serial no. 41109.0001 all models affected by this bulletin feature a modification of the folding shelf to upper basket coupling system.
This modification called for alteration of the relative baskets: the distance between the wire on which the folding shelf is attached and the wire below it has been increased from 9.5 mm to 17 mm, as shown in the attached image.
The altered folding shelves are not interchangeable and cannot be installed on premodification baskets: in the case of service interventions on product with serial number prior to 41109.0001 the entire upper basket must be replaced.
The baskets are reciprocally interchangeable and are managed as assemblies complete with their accessories, inclusive of folding shelves.

The replacement P/Ns affected by the modification are as follows:

UPPER BASKET LIGHT BLUE FOLDING SHELF
new 114799 - premodification 094140.

UPPER BASKET ASSEMBLIES
new 115001 - premodification 094139;
new 115002 - premodification 094222;
new 115003 - premodification 094233.

N1045093FIG1
NEW FLAP UPPER BASKET SAT CODE 114799

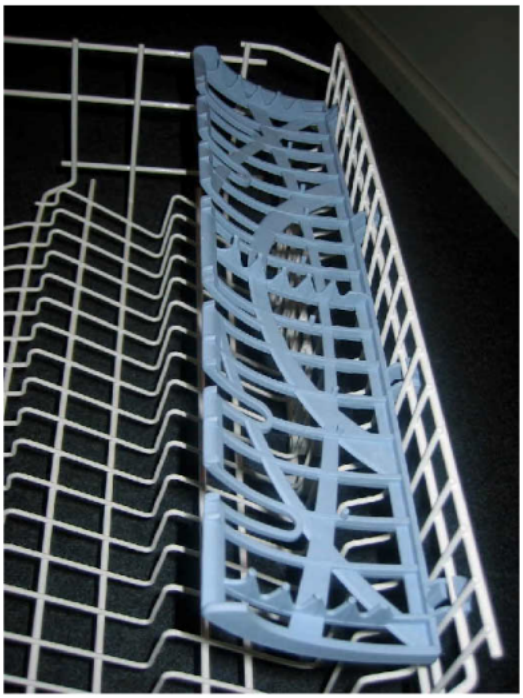

n1045102: Different position of electric distributor.

The position of the electric distributor has been changed as shown in the attached illustration.
The new machines have a new industrial code.

N1045093FIG2
OLD FLAP UPPER BASKET SAT CODE 094140



Introduced items:
C00118143 upper rack
C00109698 inside door

Premodification items:
C00115003 upper rack
C00095276 inside door

The following list shows the affected models with the relevant modification start serial numbers.


cc 30299 s/n 50330.0001 LV660AWHFR
cc 29943 s/n 50330.0001 LV640AWH
cc 33944 s/n 50408.0001 LI661A
cc 33945 s/n 50318.0001 LV661AIX
cc 30301 s/n 50316.0001 LV660AIXFR
cc 30300 s/n 50316.0001 LV660ABKFR
cc 29946 s/n 50318.0001 LV640AIX
cc 29512 s/n 50316.0001 LI640A
cc 29942 s/n 50324.0001 LV640ABK
cc 30304 s/n 50412.0001 LI660A
cc 33614 s/n 51011.0001 LVR640AAN

n1045127: New airbreak - solution of water spurts leaking from base LVS 60 CM

From serial number 50930.0001, to solve the problem of water spurts emitted from the lower right and left side of the door the following modifications were introduced in production:

N1045076FIG1

Mark II

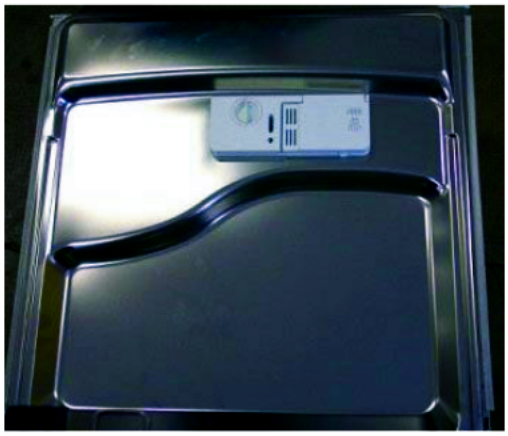

1-Airbreak without insert to allow the necessary pressure venting
2-Honeycomb top panel to protect the kitchen unit from any steam emitted (only on built-under models)
3-Tank seal length increased by 3 cm to improve water tightness
4-Die-cut roof sound-deadening panel
5-Three clips for correct fixing of the tank base seal (in production from serial number 50701.0001)

New parts:
C00141308 - Airbreak
C00141310 - Honeycomb top panel (built-under versions only)
C00141317 - Tank seal
C00141314 - Roof sound-deadening panel
C00140679 - Tank base seal fixing clip

Premodification parts
C00110610 - Airbreak
C00116110 - Tank seal
C00097300 - Roof sound-deadening panel

1) AIRBREAK REPLACEMENT
It is mandatory to use the new part; in the event of replacement with premodification appliances proceed as follows:
- replace the airbreak with the new part C00141308
- if present, refit the roof sound-deadening panel after cutting out a 10x10 cm square from the rear left-hand corner
- on the built-under version, fit honeycomb panel C00141310 on the top of the appliance
- replace tank seal with the new seal P/N C00141317

WARNING: when replacing an airbreak without a litre-counter turbine use exclusively the same type of part (P/N C00094174 - all the relevant details are given in bulletin n1045085)

2) CHANGING THE TANK SEAL
On appliances with serial number from 40101.0001 to 50930.0001, you can use the new tank seal P/N C00141317 after cutting 1.5 cm off each end.

n1045133: New thermoprotected drain pump in parallel with wash electric pump

---

The drain pump electrical connection has been modified from a configuration in series with the wash electric pump to one in parallel.

The drain pump in series with the wash electric pump is fed through the wash electric pump causing a voltage drop equal to -15V (diagram N1045133-134FIG1).

The drain pump in series with the wash electric pump is electrically fed directly by the F-N line, without any voltage drop (diagram N1045133-134FIG1).

New parts:
Wiring in parallel
C00118767(Rohs 143766) - thermoprotected drain pump 220/240V 50HZ 26W - picture (N1045133-134FIG3)

Premodification parts:
Wiring in series
C00112306(Rohs 143739) - drain pump 230V 50HZ 22W - picture (N1045133-134FIG4)

The codes of the new and premodification wirings are given in note N1045129.

Important!!
The thermoprotected drain pump cannot be installed on premodification dishwashers.
The non-thermoprotected drain pump cannot be installed on modified dishwashers.


Models/serial nos. affected by modification:
cc29511 - s/n 60316.0001 - LI620
cc29930 - s/n 60323.0001 - DI6
cc29931 - s/n 60320.0001 - DI620
cc29943 - s/n 60401.0001 - LV640AWH
cc30300 - s/n 60401.0001 - LV660ABKFR
cc30301 - s/n 60401.0001 - LV660AIXFR
cc32006 - s/n 60305.0001 - IDL50EU.2
cc32215 - s/n 60306.0001 - IDL55EU.2
cc32220 - s/n 60306.0001 - IDL55DE.2
cc32221 - s/n 60307.0001 - IDL50SK.2
cc32224 - s/n 60401.0001 - IDL55SDE.2
cc32271 - s/n 60322.0001 - IDLB2EU
cc33223 - s/n 60222.0001 - DVG622IX
cc33614 - s/n 60401.0001 - LVR640AAN
cc34119 - s/n 60307.0001 - IDL55IT.2
cc34120 - s/n 60309.0001 - IDL55SIT.2
cc34457 - s/n 60222.0001 - IDL502FR.2
cc34458 - s/n 60306.0001 - IDL552FR.2
cc34499 - s/n 60222.0001 - IDL50SEU.2
cc34518 - s/n 60222.0001 - L63EU.2
cc34865 - s/n 60222.0001 - IDL500FR.2
cc35314 - s/n 60306.0001 - IDL57PT.2
cc36154 - s/n 60306.0001 - IDL553FR.2
cc39329 - s/n 60222.0001 - IDL506FR.2

cc39330 - s/n 60306.0001 - IDL556FR.2
cc39331 - s/n 60306.0001 - IDL556SFR.2
cc40041 - s/n 60414.0001 - IDL42EU.C
cc40220 - s/n 60430.0001 - IDL42FR.C
cc30299 - s/n 60418.0001 - LV660AWHFR
cc29939 - s/n 60421.0001 - LV620BK
cc29940 - s/n 60421.0001 - LV620WH
cc29941 - s/n 60421.0001 - LV620IX
cc29946 - s/n 60422.0001 - LV640AIX
cc29942 - s/n 60424.0001 - LV640ABK
cc29512 - s/n 60501.0001 - LI640A
cc33942 - s/n 60501.0001 - LI641A
cc40916 - s/n 60502.0001 - L6064EU
cc40911 - s/n 60502.0001 - L6061EU
cc37341 - s/n 60502.0001 - L62IT.2
cc35316 - s/n 60502.0001 - L61EU.2
cc29907 - s/n 60502.0001 - L61AG
cc34283 - s/n 60529.0001 - IDL52EU.2
cc41049 - s/n 60605.0001 - L65IT
cc23510 - s/n 70618.0001 - D61EX50-60
cc29912 - s/n 70320.0001 - L63AUS
cc29913 - s/n 70326.0001 - L63XAUS
cc29921 - s/n 70318.0001 - LV650AIX
cc29922 - s/n 70227.0001 - LV650AALU
cc29923 - s/n 70329.0001 - LV650AOW
cc29924 - s/n 70227.0001 - LV650AWH
cc29925 - s/n 70227.0001 - LV650ABK
cc30304 - s/n 70326.0001 - LI660A
cc30369 - s/n 70323.0001 - DI630A
cc32217 - s/n 70326.0001 - IDL51EU.2
cc33229 - s/n 70326.0001 - DVG652AIX
cc33616 - s/n 70326.0001 - LVR670AN
cc33617 - s/n 70326.0001 - LVR670OW
cc33751 - s/n 70326.0001 - LVX12-45IX
cc33944 - s/n 70329.0001 - LI661A
cc34502 - s/n 70326.0001 - IDL60SAUS.2
cc34519 - s/n 70115.0001 - IDTMEU
cc37546 - s/n 70326.0001 - L6049FR
cc40887 - s/n 70319.0001 - IDL600EU.2
cc40888 - s/n 70319.0001 - IDL600SEU.2
cc40889 - s/n 70129.0001 - IDL750SEU.2
cc40891 - s/n 70122.0001 - IDL750EU.2
cc41165 - s/n 70327.0001 - IDL63EU.2
cc41166 - s/n 70319.0001 - IDL6021EU.2
cc41203 - s/n 70326.0001 - IDL550SIT.2
cc41204 - s/n 70326.0001 - IDL600IT.2
cc41205 - s/n 70326.0001 - IDL600SIT.2
cc42061 - s/n 70326.0001 - DI623A
cc42062 - s/n 70301.0001 - DI650A
cc42063 - s/n 70326.0001 - DVG623BK
cc42065 - s/n 70325.0001 - DVG623WH
cc42242 - s/n 70326.0001 - IDL6049SK.2
cc43218 - s/n 70301.0001 - DI653A
cc43942 - s/n 70326.0001 - DVGN623BK
cc43944 - s/n 70326.0001 - DVGN623WH
cc47650 - s/n 70326.0001 - L64AUS
cc47651 - s/n 70326.0001 - L64XAUS

cc39332 - s/n 70301.0001 - IDL706FR.2
cc34459 - s/n 60306.0001 - IDL555SFR.2
cc32227 - s/n 60222.0001 - L63SK.2
cc33212 - s/n 60222.0001 - DVG621IX


N1045133/134FIG1


Drying pump connected electrically in series to the motor washing

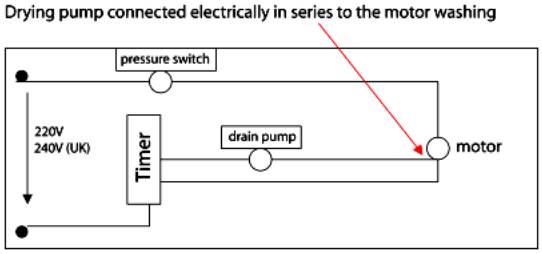

N1045133/134FIG2

Drying pump connected electrically in parallel to the motor washing

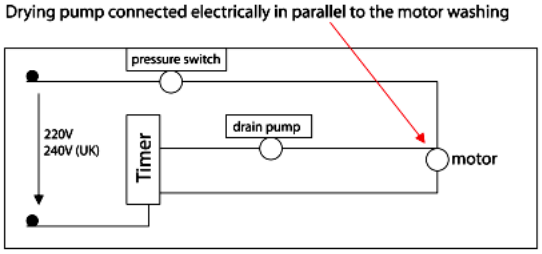

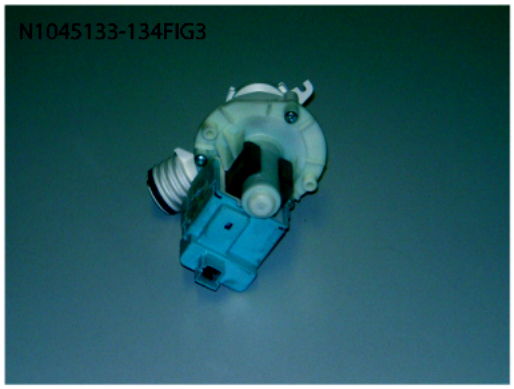



n1045135: New single-pole On/Off switch

The two-pole On/Off switch has been replaced by the single-pole switch.

New parts
Wiring
C00140609 - single-pole On/Off switch
C00063971 - single-pole On/Off switch
C00140607 - single-pole On/Off switch

Premodification parts
Wiring
C00041184 - two-pole On/Off switch
C00058465 - two-pole On/Off switch
C00096884 - two-pole On/Off switch

Models/serial nos. affected by modification:
cc29511 - s/n 60316.0001 - LI620
cc29930 - s/n 60323.0001 - DI6
cc29931 - s/n 60320.0001 - DI620
cc29943 - s/n 60401.0001 - LV640AWH
cc30300 - s/n 60401.0001 - LV660ABKFR
cc30301 - s/n 60401.0001 - LV660AIXFR
cc32006 - s/n 60305.0001 - IDL50EU.2
cc32215 - s/n 60306.0001 - IDL55EU.2
cc32221 - s/n 60307.0001 - IDL50SK.2
cc32271 - s/n 60322.0001 - IDLB2EU
cc33223 - s/n 60222.0001 - DVG622IX
cc33614 - s/n 60401.0001 - LVR640AAN
cc34119 - s/n 60307.0001 - IDL55IT.2
cc34120 - s/n 60309.0001 - IDL55SIT.2
cc34457 - s/n 60222.0001 - IDL502FR.2
cc34499 - s/n 60222.0001 - IDL50SEU.2
cc34518 - s/n 60222.0001 - L63EU.2
cc34865 - s/n 60222.0001 - IDL500FR.2
cc35314 - s/n 60306.0001 - IDL57PT.2
cc39329 - s/n 60222.0001 - IDL506FR.2
cc39330 - s/n 60306.0001 - IDL556FR.2
cc39331 - s/n 60306.0001 - IDL556SFR.2
cc30351 - s/n 60320.0001 - DI620UK
cc30708 - s/n 60401.0001 - BFI620
cc33182 - s/n 60222.0001 - FDW20P
cc34501 - s/n 60222.0001 - IDL535SUK.2
cc30715 - s/n 51115.0001 - BFI680
cc34753 - s/n 51115.0001 - BFQ700T/1
cc29514 - s/n 51115.0001 - LI680DUO
cc29515 - s/n 51115.0001 - LI700DUO
cc33970 - s/n 51115.0001 - LIQ700DUOTI
cc33955 - s/n 51115.0001 - LVTI12-67
cc37869 - s/n 51115.0001 - LI680PLUS
cc37873 - s/n 51115.0001 - LIQ700TIPLUS
cc34142 - s/n 51115.0001 - CISLI700DUO
cc37872 - s/n 51118.0001 - LI700PLUS

cc28472 - s/n 51121.0001 - LL65TK.2
cc33186 - s/n 51121.0001 - FDW65A
cc34380 - s/n 51121.0001 - LL66XFR
cc33183 - s/n 51122.0001 - FDW60P
cc33185 - s/n 51125.0001 - FDW60G
cc33184 - s/n 51201.0001 - FDW60T

n1045136: introduction of new high pressure sensor

In modified products the connector going to the high pressure sensor is part of the wiring assembly (see picture N1045136FIG1).
In premodification products the high pressure sensor is connected to the wiring assembly by a cable that is part of code C00094157 (see pictures N1045136FIG2-3).

New parts
Wiring
C00142435 - high pressure sensor


Premodification parts
Wiring
C00094157 - high pressure sensor + cable

The new parts are not individually interchangeable with premodification ones.


Models / serial nos. affected by the modification:
cc29511 - s/n 60316.0001 - LI620
cc29930 - s/n 60323.0001 - DI6
cc29931 - s/n 60320.0001 - DI620
cc29943 - s/n 60401.0001 - LV640AWH
cc30300 - s/n 60401.0001 - LV660ABKFR
cc30301 - s/n 60401.0001 - LV660AIXFR
cc32006 - s/n 60305.0001 - IDL50EU.2
cc32215 - s/n 60306.0001 - IDL55EU.2
cc32220 - s/n 60306.0001 - IDL55DE.2
cc32221 - s/n 60307.0001 - IDL50SK.2
cc32224 - s/n 60401.0001 - IDL55SDE.2
cc32271 - s/n 60322.0001 - IDLB2EU
cc33223 - s/n 60222.0001 - DVG622IX
cc33614 - s/n 60401.0001 - LVR640AAN
cc34119 - s/n 60307.0001 - IDL55IT.2
cc34120 - s/n 60309.0001 - IDL55SIT.2
cc34457 - s/n 60222.0001 - IDL502FR.2
cc34458 - s/n 60306.0001 - IDL552FR.2
cc34499 - s/n 60222.0001 - IDL50SEU.2
cc34518 - s/n 60222.0001 - L63EU.2
cc34865 - s/n 60222.0001 - IDL500FR.2
cc35314 - s/n 60306.0001 - IDL57PT.2
cc39329 - s/n 60222.0001 - IDL506FR.2
cc39330 - s/n 60306.0001 - IDL556FR.2
cc39331 - s/n 60306.0001 - IDL556SFR.2
cc30351 - s/n 60320.0001 - DI620UK

cc30708 - s/n 60401.0001 - BFI620
cc33182 - s/n 60222.0001 - FDW20P
cc34501 - s/n 60222.0001 - IDL535SUK.2
cc30715 - s/n 51115.0001 - BFI680
cc34753 - s/n 51115.0001 - BFQ700T/1
cc29514 - s/n 51115.0001 - LI680DUO
cc29515 - s/n 51115.0001 - LI700DUO
cc33970 - s/n 51115.0001 - LIQ700DUOTI
cc33955 - s/n 51115.0001 - LVTI12-67
cc37869 - s/n 51115.0001 - LI680PLUS
cc37873 - s/n 51115.0001 - LIQ700TIPLUS
cc34142 - s/n 51115.0001 - CISLI700DUO
cc37872 - s/n 51118.0001 - LI700PLUS
cc28472 - s/n 51121.0001 - LL65TK.2
cc33186 - s/n 51121.0001 - FDW65A
cc34380 - s/n 51121.0001 - LL66XFR
cc33183 - s/n 51122.0001 - FDW60P
cc33185 - s/n 51125.0001 - FDW60G
cc33184 - s/n 51201.0001 - FDW60T
cc30299 - s/n 60418.0001 - LV660AWHFR
cc29939 - s/n 60421.0001 - LV620BK
cc29940 - s/n 60421.0001 - LV620WH
cc29941 - s/n 60421.0001 - LV620IX
cc29946 - s/n 60422.0001 - LV640AIX
cc29942 - s/n 60424.0001 - LV640ABK
cc29512 - s/n 60501.0001 - LI640A
cc33942 - s/n 60501.0001 - LI641A
cc40916 - s/n 60502.0001 - L6064EU
cc40911 - s/n 60502.0001 - L6061EU
cc37341 - s/n 60502.0001 - L62IT.2
cc35316 - s/n 60502.0001 - L61EU.2
cc29907 - s/n 60502.0001 - L61AG
cc34283 - s/n 60529.0001 - IDL52EU.2
cc41049 - s/n 60605.0001 - L65IT
cc42062 - s/n 60701.0001 - DI650A


N1045136FIG1

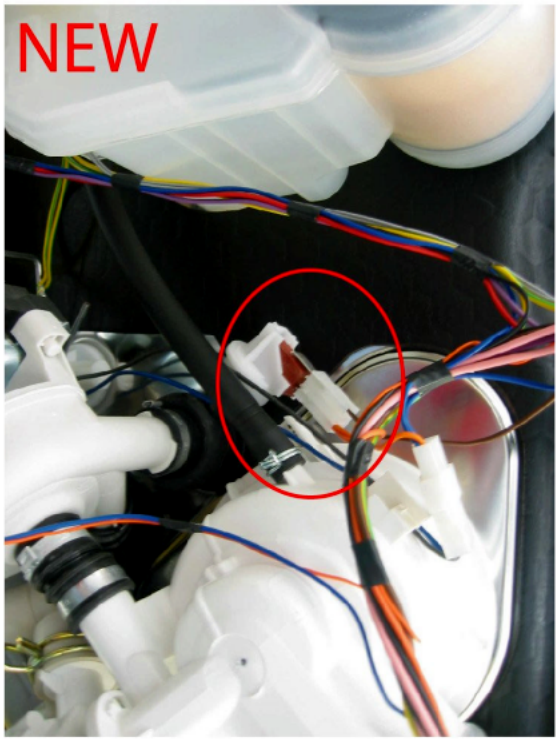

N1045136FIG2

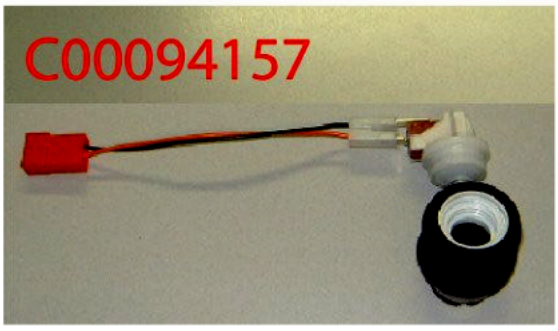


N1045136FIG3

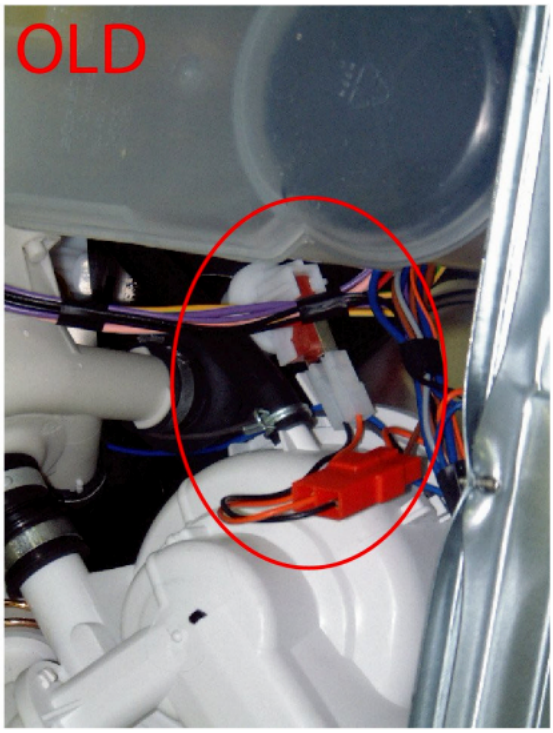

Electric schemes and links

Cod. 16001650204

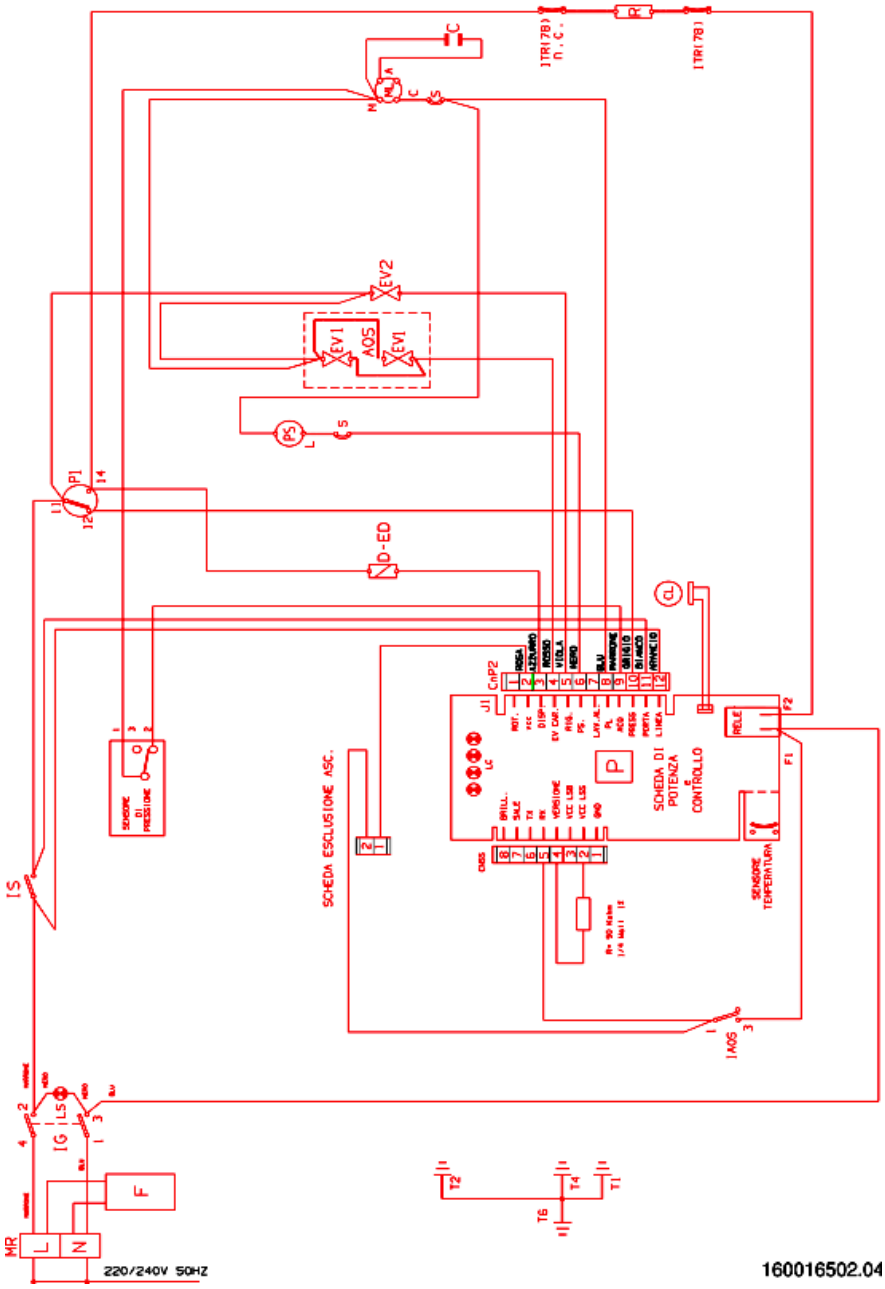

Legend

Legend: 16001650204

A..	Timer contact	LPA	Door open
AQS	Aquastop electrovalve	LPR	Prewash LED
B..	Timer contact	LRI	Rinse LED
C	Condensor	LS	Mains LED -Pilot lampe On/Off
C..	Timer contact	LSB	Polisher LED
CL	Slow cam	LSC	Cycle ranning lamp
CM	Wash pump motor connector	LSE	Acquastop LED
CN	Connector	LSS	Salt LED
CV	Fast cam	LV	Fan off lamp
D-ED	Dispenser - Electric dosing device	M	Terminal box
D..	Timer contact	MB	Polisher dip-switch
DB	Brightener dispenser	ME	Acquastop dip-switch
DD	Display - Detergent dispenser	ML	Wash motor
E1	Cold water electrovalve	MM	Handle dip-switch
E2	Regeneration electrovalve	MP	Door dip-switch
E3	Hot water electrovalve	MR	Delay-timer motor - Terminal board
ECO	Saving switch	MT	Timer motor
ED	Detergent/Brightener dispenser	MTR	Fast forward timer motor
EV1	Cold water electrovalve MM- Handle dip-switch	MV	Motor fan
EV1/2	Half-load electrovalve	P	Pressure switch
EV2	Regeneration electrovalve	P..	Pressure switch contact
EV3	Hot water electrovalve	P1	Stage 1 pressure
EVC	Hot water electrovalve	P2	Stage 2 pressure switch
EVF	Cold water electrovalve	PAP	High pressure switch
EVR	Regeneration water electrovalve	PO	Overflow pressure switch
F	Anti-interference filter ML- Wash motor	PS	Drain pump
FA	Radio interferences	PULS	Push-button panel
I1	On/Off switch - Plus cycle switch -IEC cycle	R	Heating element
I1/2	Switch half-load	R.D.	Delay rotary selector
I2	Fast switch -IEC cycle switch (standard) -	RA	Heating element drying
I2H	2-hour delay switch	ROT D	Delay rotary selector
I3	Saving switch- Switch for cycle with no pre-	ROT.	Rotary selector
I4	Switch for cycle fresh dirty	S	Motor overload cutout

I4H	4-hour delay switch	SC	Selector cycli
I5-ICR	Fast cycle switch	SS	Salt detector
I6	Soak cycle switch	ST	START
I6H	6-hour delay switch	T..	Delay-tymer contact
IAQS	Aquastop switch	T1	Power supply earth cable -Thermostat 45?C
ID	Switch display	T2	Lid earth -Thermostat 55?C
IE	Saving switch	T3	Timer earth -Thermostat 65?C
IEXD	Exstra dray switch	T36	36?C N.O. Thermostat
IG	Main switch	T4	Heating element earth
IMV	Off motor fan switch	T46	46?C N.O. Thermostat
IP	High temperature switch	T5	Drain pump earth
IS	Cut-off switch	T57	57?C N.O. Thermostat
ISB	Polisher led switch	T6	Wash motor earth
ISS	Salt LED switch	T8	External lid earth
ITR	Heating element switch	TE	Relay switch
L	Mains LED	THP	Thermoprotector
L1	Cycle 1 lamp	TM	Timer
L1/2	Lamp cjcle half-load	TS	Safety thermostat
L2	Cycle 2 lamp	TS 40	Thermostat 40 ?C
L3	Cycle 3 lamp	TS 50	Thermostat 50 ?C
L4	Cycle 4 lamp	TS 62	Thermostat 62 ?C
L5	Cycle 5 lamp	TS1	Min. temperature thermostat
L6	Cycle 6 lamp	TS2	Max. temperature thermostat
LA	Drying LED	TT	Terminal box support earth
LAQ	Aquastop on lamp	Tcp	nner-door earthing connection
LC	Cycle ranning lamp	Tfa	Radio interference
LD	Delay activated lamp	Tml	Pump wash motor earthing connection
LE	Saving cycle	Tpg	Large door earthing connection
LH2	2-hour delay lamp	Tpi	Inspection door earthing connection
LH4	4-hour delay lamp	Tpr	Pressure switch
LH6	6-hour delay lamp	Tps	Discharge pump earthing connection
LL	Wash LED	Tr	Heating element
LP	High temperature LED	Tte	Delay-timer earthing connection