
INDESIT company

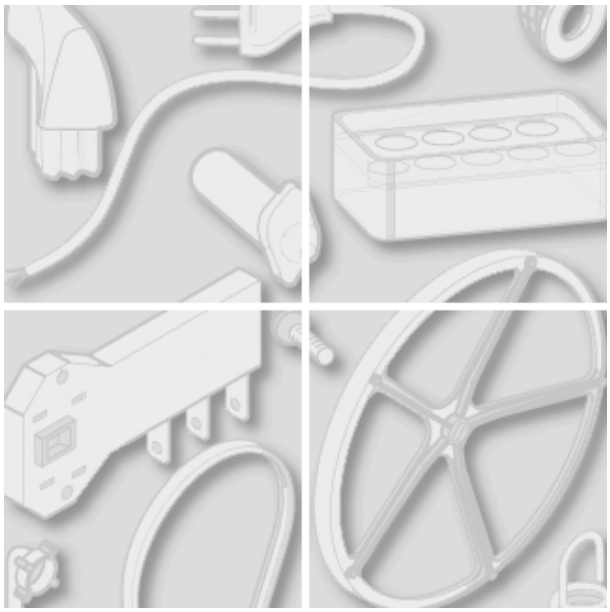

Model type:
IDL75EU

Commercial code:
F030661

General notes

Technical Documentation guidelines

You can find herewith some generic information to simplify cunsulting of technical documentation:

1. Models of same range share the same exploded views, which report the richest set of spare parts:generally, a model does not necessarly have a related spare part for each particular shown on exploded views.

2. Some spare parts can not be represented directly on the exploded views (instruction booklets, specific kit, etc...). You can find those codes in the spare parts list with the same reference of particular where spares are installed or with references 099, 999. Instruction booklets, once managed, appear with 000 reference.

3. On the higher right site of each exploded view there is a serial number which indicates the beginning of the production of certain range:some models might have more than an exploded view for a given category, each distinguished by a different serial no.and linked to another spare parts list, In this case, serial no. is required to supply the right spare part code. Exploded view to be considered is the one with a more recent serial no. but previous than the one of the model that needs assistance.

4.Exploded views might require further updates even after publishing. Addition of new spares will go on following the already existing numeration references. Revision number of an exploded view is shown into last four digits of serial number into upper right hand corner.

5.The spare parts list associated to an exploded view shows related codes of spares managed for a certain model; for each spare part other informations are available:


REF: reference no of spare into a table; SUBSTITUTE: list of spare(s) which can replace a code but that keeps same functional characteristics

INDUSTRIAL CODE: list of variables of a model (shown into model label) where such spare is used; NOTICE: code of information(s) to refer to complete technical intervention, track for changes or to find correct spare part code.

6. Some notices, into a same section are generic therefore cannot be directly linked to a spare part. In order to assist a model in the best way as possible, it is helpful to pay attention to all notices and constantly verify documentation updates

7.Technical documentation cover shows model name and its commercial codes

2220110 Exploded views

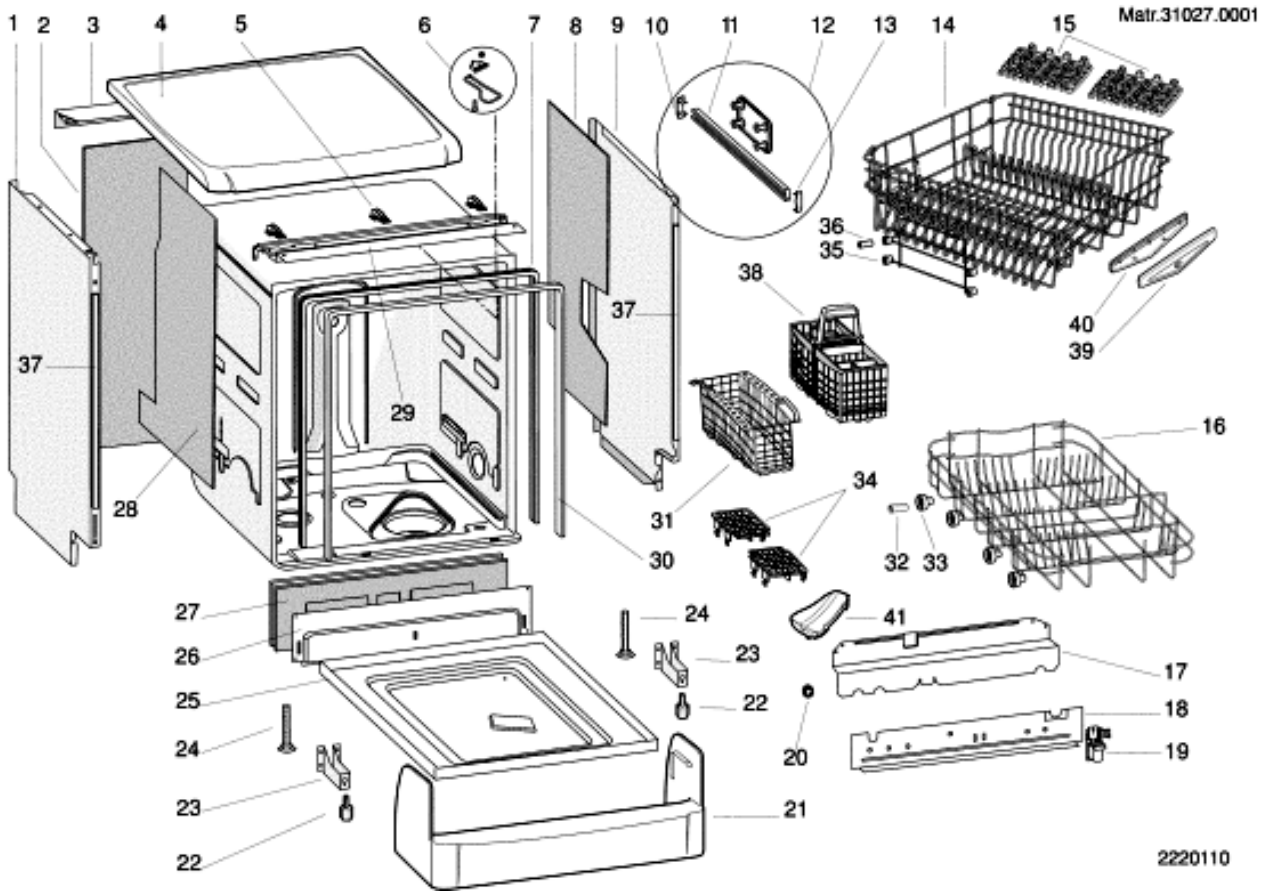


2220110 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
000	C00099308				instruction book it-gb-fr-de-nl-es-		
001	C00092823			1 x C00092833	left side panel lh white27		
002	C00075715				rear cover		
003	C00033591				rear support - top		
004	C00097478			1 x C00142986	cover white27 'indesit evo3'		
005	C00057504				hook - top cover retention		
006	C00085024			1 x C00037135	catch plate (cabinet)		
				1 x C00297907			
				1 x C00297909			
				1 x C00297910			
007	C00116110			1 x C00141317	door seal - top and sides mm1608	n1045127	
007	C00141317				top and side door seal (1638mm)	n1045127	
009	C00092824			1 x C00092833	right side panel white27		
010	C00094117				rail back stop evo3		
011	C00094116			1 x C00094112	basket runner - upper evo3		
012	C00094112				runner assembly		
013	C00094118				runner end stop		
014	C00097875				upper basket noclik/clak evo3		
015	C00097888				flap upper basket evo3		
016	C00056397			1 x C00054825	lower basket 'lsv61ix'		
017	C00091600				rear support - middle		
018	C00091598				lower rear support reflex		
019	C00078395			1 x C00076659	radio interference suppressor		
				1 x C00143383			
020	C00054830				drain hose fastener		
021	C00097476			1 x C00143005	plinth panel swell white27 indesit		
022	C00056414			1 x C00104611	adjustable foot - all plastic	n1045080	
022	C00109991				adjustable foot	n1045080	
023	C00056010				foot support x		
024	C00094605				foot 95mm lvs evo3	N1045072	
025	C00092554			1 x C00118842	tray on bottom of tub 60cm		
026	C00091599			1 x C00119016	front support lower 60cm		
027	C00076390				front panel soundproofing l.i.60cm		
029	C00079013				door spring adjuster		
030	C00054932				frame support for tub seal 60cm	n1045047	

2220110 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
032	C00094189				roller axle upper basket		
033	C00056347				lower basket wheel		
034	C00078869				cutlery basket divider		
035	C00094191			1 x C00109840	upper basket roller evo3		
036	C00104638				basket roller axis		
037	C00082457				sponge		
038	C00097097				cutlery basket		
039	C00097876				basket handle cover outer		
040	C00097877				basket handle cover inner		
041	C00088301				grease box		
099	C00094138				lower basket buffer evo3		

2220220 Exploded views

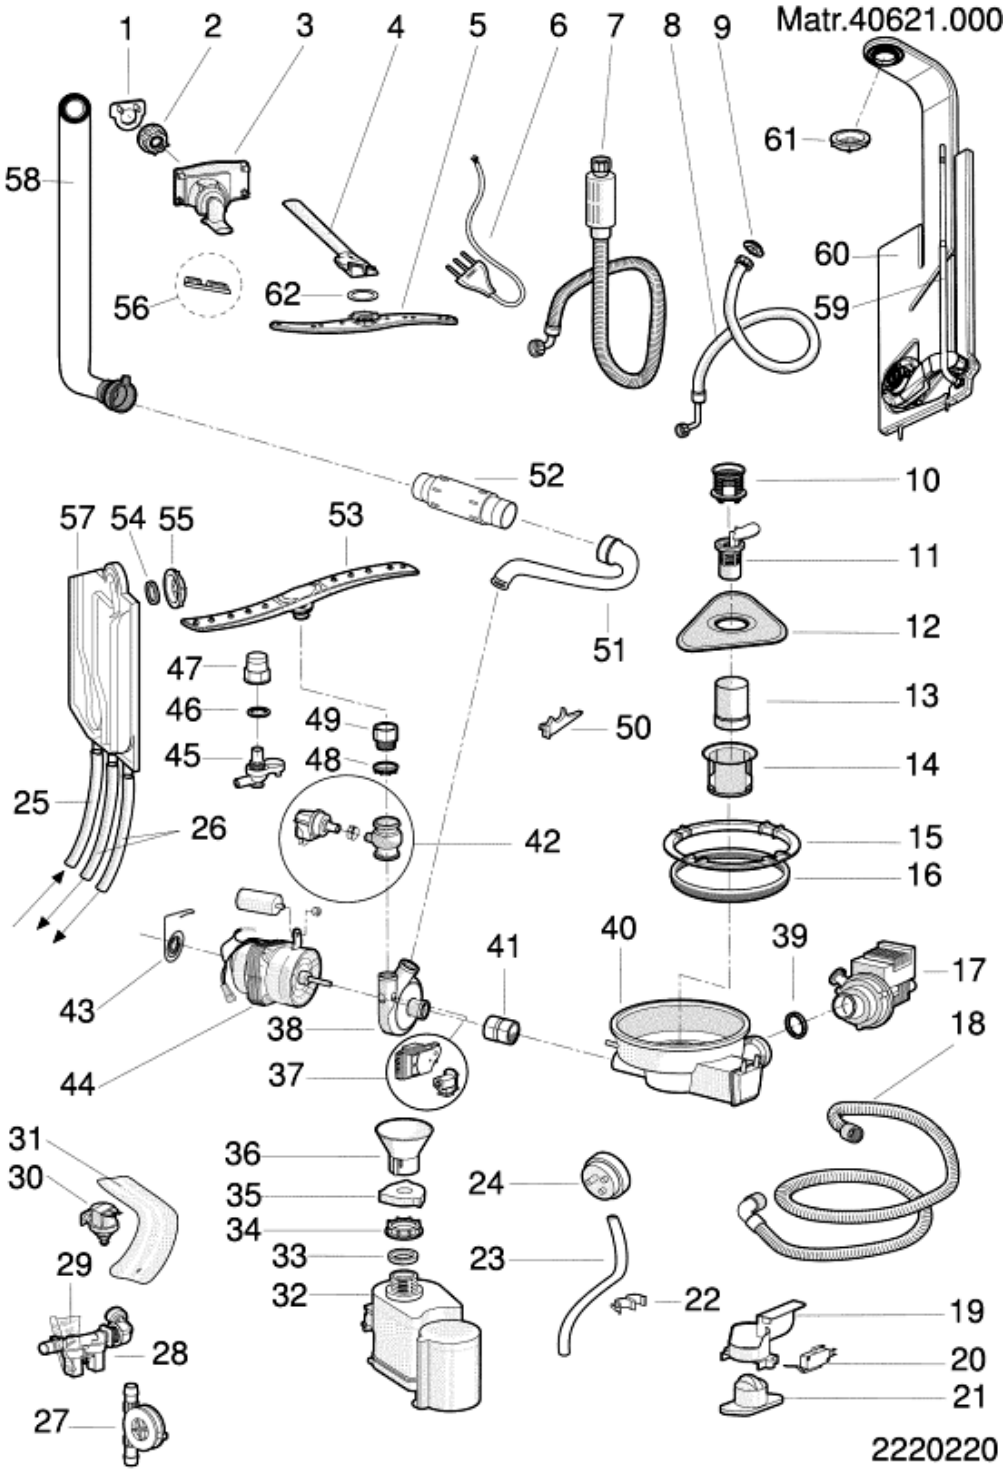

2220220 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
001	C00054925				upper was basket guide casing		
002	C00144315				top spray arm nut with seal (rohs)		
003	C00094134			1 x C00110526 1 x C00110527	water supply distribution assembly	n1045084	
003	C00110526				water supply distribution assembly		
004	C00054926			1 x C00110526 1 x C00110527	upper wash arm feed pipe	n1045084	
004	C00110527				upper wash arm feed pipe		
005	C00075746				upper wash arm curved set		
006	C00143371			1 x C00280937	supply cable schuko rohs		
007	C00083761				inlet hose - includes antioverflow		
010	C00094158			1 x C00142344	filter grid evo3	n1045083	
011	C00054863			1 x C00142344	central filter		
011	C00094156			1 x C00142344	central filter basket/retainer evo3	n1045083	
012	C00145075				stainless steel outlet filter		
013	C00081164			1 x C00142344	filter cylindrical		
013	C00094164			1 x C00142344	filter cylindrical evo3	n1045083	
014	C00061929				outer fine rotating polyester filter		
015	C00054854				sump fixing ferrule		
016	C00054828				gasket - sump fixing ring		
017	C00096072			1 x C00112306	drain pump 230v 50hz evo3		
018	C00054869				drain hose		
019	C00081162				container - overflow unit		
020	C00143107				microswitch acquastop rohs		
021	C00058843				float - overflow unit		
022	C00095801				pressure hose clip evo3		
023	C00094154				pipe pressostat lvs evo3		
024	C00143740				pressure switch 90 71 evo3 rohs		
025	C00094267				tube water inlet air-break/turbine	n1045085	
025	C00110612			1 x C00111855 1 x C00115348	tube water inlet electrovalve/air-	n1045085	
026	C00054868				tube - softener/sump l.(480mm)		
027	C00094172				turbine evo3	n1045085	
028	C00087337				collar seal		
028	C00094168				2-way electrovalve 4lt/1 evo3	n1045085	


2220220 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
028	C00143737				load electrovalve rohs	n1045085	
029	C00094160				protection electrovalve evo3		
032	C00094171				water softener adjustable evo3		
033	C00103610				seal - softener/wash chamber		
034	C00144235				retaining ring - softener rohs		
035	C00041088				salt cap		
036	C00005819				salt funnel		
037	C00054985				solenoid valve half-load		
038	C00054979				pump cover		
039	C00054917				seal 'o'ring (23,81x2,62)		
040	C00094143	41102...		1 x C00141158	set sump evo3	n1045090	
040	C00096409		41101...		set sump x turbo-dry evo3	n1045090	
041	C00079016				pipe rubber sump-pump		
042	C00094157			1 x C00142435 1 x C00144125	high pressure sensor assembly		
043	C00076628				tub spring		
044	C00077140				wash motor/pump assy 220v-75w		
045	C00094159		60903...		overflow connector evo3		
045	C00196353	60904...			overflow connector evo3		
046	C00075695				connection gasket overflow		
047	C00143580		60903...		bodytop overflow evo3 rohs		
047	C00196352	60904...		1 x C00094159 1 x C00143580	bodytop overflow evo3 rohs		
048	C00075057			1 x C00075111	cap corner for support washing		
049	C00144196				support - lower wash arm bush		
050	C00078394				outlet pump support		
051	C00057710			1 x C00091568	suction motor oven bottom		
052	C00057684				washing heating element 2000w		
053	C00094182				lower wash arm		
054	C00084600				o ring seal 38 mm		
055	C00054927			1 x C00144335	ring-nut for air-flow body		
056	C00056342				steel pin fixing upper wash arm	n1045084	
057	C00094174				water inlet air break evo3	n1045085	
057	C00110610			1 x C00115360	air break + turbine evo3	n1045085 n1045127	

2220220 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
057	C00141308			1 x C00141655	air break + turbine evo3	n1045127	
058	C00094152				external pipe (hidden heating		
059	C00096410		41101...		tube turbo-dry/sump 520mm	n1045090	
060	C00096408		41101...		assembly turbo-dry evo3	n1045090	
061	C00094601		41101...		cap corner for turbo-dry evo3	n1045090	
062	C00098769				upper wash arm seal		
099	C00033026			1 x C00292523	ambljgon grease ta 100 gr.		
099	C00073917				clamp for pump cover		
099	C00077010				clamp washing heating element		
099	C00084479				hose clamp		
099	C00094150				clip pressure sensor evo3		
099	C00094162				pipe fixing band on turbine		

2220330 Exploded views

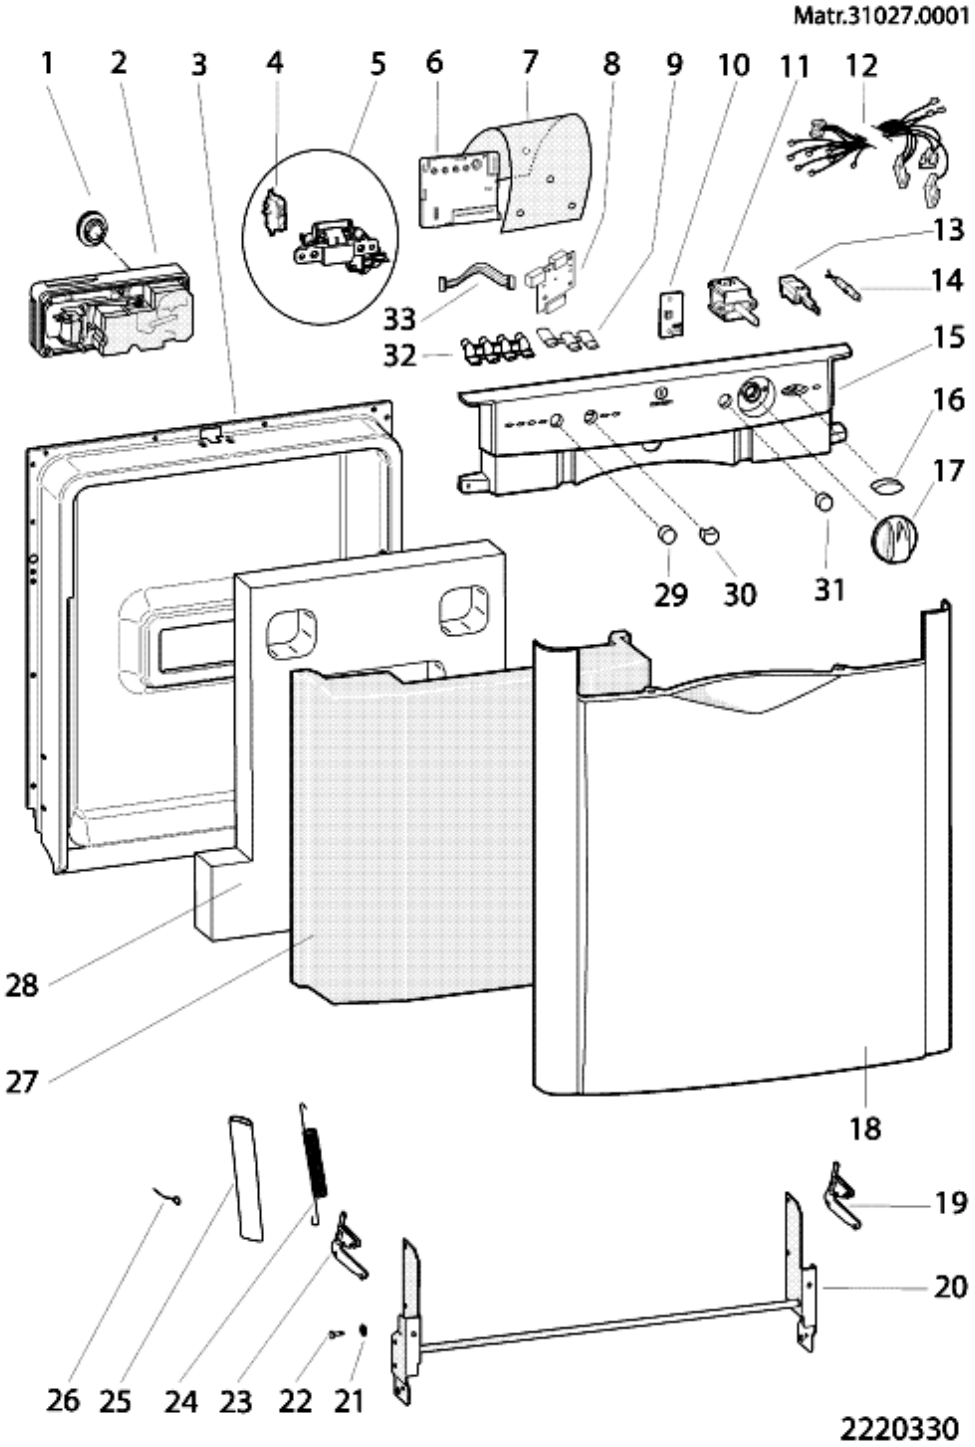

2220330 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
002	C00097874			1 x C00143801	dispenser & reed switch (dw)		
003	C00091543			1 x C00290247	door seal lower 60cm		
003	C00094695				inner door panel stainless evo3	n4509a00	
004	C00085358				microswitch		
005	C00094128			1 x C00195887	locking assembly evo3		
006	C00108957				bracket for timer bit 100		
006	C00143206		41101...		timer control module (e1)	n1045090	
006	C00143209	41102...		1 x C00293398	timer bit100.1 'e4' rohs +	n1045090	
008	C00143802				card 1/2 evo3 rohs		
009	C00097869				light track lamp (3 lamp)		
010	C00143541				start/reset pcb card		
011	C00084910			1 x C00084912	8 functions selector		
012	C00098032		41101...	1 x C00114565	wiring harness assembly	n1045090	
012	C00112901	41102...			wiring harness assembly	n1045090	
013	C00096884			1 x C00142650	on-off switch (double pole)		
014	C00096881			1 x C00112262	pilot light red 230v ra2,5 ind.		
015	C00099601			1 x C00144099	dashboard white27 idl75eu		
016	C00097418			1 x C00143006	white27 push button on-off indesit		
017	C00097475			1 x C00143003	knob white27 indesit evo3		
018	C00097474			1 x C00143000	white27 door shell bowed indesit		
019	C00065127			1 x C00054815	hinge item, right		
020	C00096996				hinge assembly 'lvs evo3'		
021	C00058776				washer d = 6 mm		
022	C00048504				hinge pin		
023	C00065128			1 x C00054817	hinge item, left		
024	C00094111				door spring		
025	C00066426				tube hinge spring		
026	C00075693				gaffel x door spring		
027	C00097477				door spacer assy evo3		
028	C00097501				front panel soundproofing evo3		
029	C00097508			1 x C00143007	white27 push-button indesit evo3		
030	C00097868			1 x C00143010	white27 push-button 1/2 carico		
031	C00097508			1 x C00143007	white27 push-button indesit evo3		
032	C00097419				light track lamp 'indesit' evo3		
033	C00097864				2-way wire 'evo3'		

2220330 Spare parts list


Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
034	C00098134				door detergent electrodispenser		
035	C00140679				seal spring	n1045127	
099	C00076108			1 x C00012687	screw canoe klip		
099	C00084911			1 x C00304782	screw 3.5x9.5		
099	C00094120				fixing bolt inner door/dashboard		
099	C00094141				fixing screw inner/outer door		
099	C00111286				transparent door lvs evo3 60cm ##		

Notices

N1045072: Introduction of fixed rear foot H=31mm on free-standing models.

From serial no. 40218.0001, free-standing dishwashers affected by this modification have been equipped with new fixed rear feet (H=31mm).
The new foot replaces the adjustable one (H=155mm) Service code 092555; on the EVO3 range with TurboDry the new foot replaces the adjustable foot (H=95mm) Service code 094605.
The Spare Part Warehouse will continue to manage only 155mm and 95mm adjustable feet as they are interchangeable with the fixed 31mm foot.
The three feet are shown in illustration N1045072FIG1.

N1045072FIG1

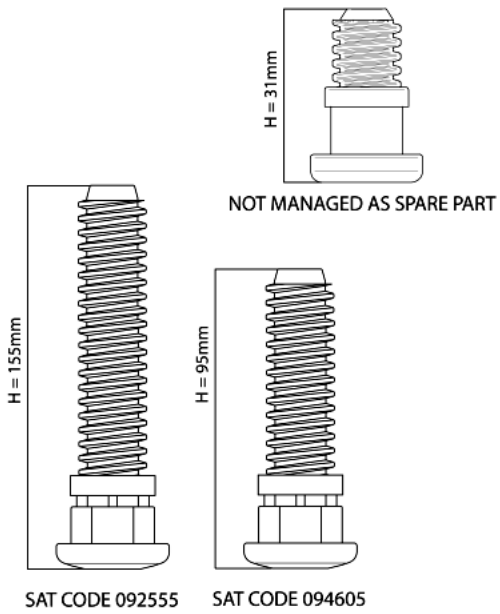

n1045048: BIT 100 CARD INITIALIZATION

Free-standing dishwasher

1- Close the door and switch the dishwasher on.
2- Wait for the test cycle to start (2 LEDs light up or "ROD" appears on dishwashers with display).
3- Wait 10 seconds (dishwasher will start to fill water...)
N.B. If the cycle fails to start the card has probably already initialized, so proceed to point 5.
4- To reset the test cycle turn the programme button to reset or hold down the start/reset button for 5 seconds. (Wait for the buzzer to beep three times or if the dishwasher does not have a buzzer, wait for the programme LEDs to switch off.)
5- To check the aforementioned steps have completed successfully, select a programme and see if it starts; (reset it after this check).
6- The dishwasher is ready for the customer.

Built-in dishwashers

1- Close the door and switch the dishwasher on.
2- Wait for the test cycle to start
3- Wait 10 seconds (the dishwasher will start to fill...)
N.B. If the cycle fails to start the card has probably already initialized, so proceed to point 5.
4- To reset the cycle, open the door (2 LEDs lit up) and press the programme button for three bips of the buzzer (or until the programme LEDs go off for dishwashers with no buzzer).
5- To check the aforementioned steps have completed successfully, press the select programme button and check that the indicator light beside the corresponding programme comes on.
6- The dishwasher is ready for thecustomer.

n1045080: Modification of front feet on free-standing DW.


From serial no. 40413.0001, free-standing dishwashers affected by this modification have been equipped with new front feet Service code 109991 in place of 056414.
The new foot is shown in fig. N1045080FIG1.

n1045083: Modification of filters on EVO3 60 cm dishwashers

All dishwasher models affected by this modification have been equipped with the items listed below, in order to solve the drain pump clooging problem.

Introduction of:
Cylindrical plastic filter code 081164
Central filter code 054863

N1045080FIG1

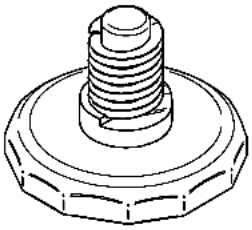

SAT CODE 109991

Elimination of:
Cylindrical plastic filter code 094164
Central filter code 094156
Central filter grid code 094158

The modification has been introduced progressively, starting from serial no. 40516.0001.

n1045084: Elimination of duct fixing pin code 056342


Duct fixing pin code 056342 has been eliminated from all dishwashers affected by this note, modifying the connection between the feeder-distribution assembly and the internal duct.

Introduced items:
Internal duct 110527
Feeder-distribution assembly 110526

Eliminated items:
Internal duct 054926
Feeder-distribution assembly 094134 (EX 054871)
Duct fixing pin 056342

The modification has been introduced progressively, starting from serial no. 40517.0001.

N1045083FIG1

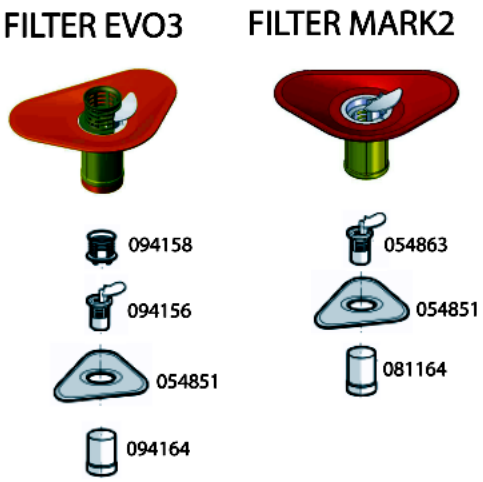

n1045085: Introduction of new litre counter turbine integrated on air-break.

All dishwashers affected by this note have been equipped with a new litre counter turbine on the air-break.
Picture N1045085FIG1 illustrates the premodification structure, picture N1045085FIG2 the new structure.

Items affected by the modification.

AIR-BREAK:
new 110610;
premodification 094174;
the new item features a new integrated litre counter turbine and its water supply hose has a smaller diameter.

LITRE COUNTER TURBINE code 094172 has been eliminated.

SOLENOID VALVES:
new:
1-WAY code 110611;
2-WAY code 084558(Rohs 143737);
premodification:
1-WAY code 094227;
2-WAY code 094168;
the new solenoid valves have a smaller diameter drain hose fitting.

HOSES:
new solenoid valve hose/air-break code 110612;
premodification turbine hose/air-break code 094267;
premodification solenoid valve hose/air-break code 094267;
the new hose has a smaller internal diameter.


WIRING:
the litre counter turbine connecting cable is longer, but since the connector is the same, the new item can be used in place of the premodification one.


Affected models with related modification introduction serial numbers:
BCI 450 - 30386 s/n 41001.0001;
BFI 620 - 30708 s/n 41001.0001;
BFI 680 - 30715 s/n 40902.0001;
BFV 620 B - 30718 s/n 41001.0001;
BFV 620 K - 30717 s/n 41001.0001;
BFV 620 W - 30719 s/n 41001.0001;
BFV 620 X - 30720 s/n 41001.0001;
DI 6 - 29930 s/n 41001.0001;
DI 620 A - 29932 s/n 40830.0001;
DI 620 - 29931 s/n 41001.0001.
DI 620 UK - 30351 s/n 41001.0001;
DI 630 A - 30369 s/n 41001.0001;
DV 620 BK - 29927 s/n 41001.0001;
DV 620 BK UK - 30349 s/n 41001.0001;
DV 620 K IX UK - 30350 s/n 41001.0001;
DV 620 WH - 29928 s/n 41001.0001;
DV 620 WH UK - 30348 s/n 41001.0001;
DV 630 A BR - 30695 s/n 40830.0001;
DV 630 A IX - 30693 s/n 40830.0001;
DV 630 A WH - 30694 s/n 40830.0001;
DV 640 A IX - 30368 s/n 40830.0001;
DV 650 A IX - 30696 s/n 40830.0001;
DV 650 A WH - 30697 s/n 40830.0001;
DV 670 A BR - 30701 s/n 40830.0001;
DV 670 A IX - 30699 s/n 40830.0001;
DV 670 A WH - 30700 s/n 40830.0001;
DV 620 IX - 29929 s/n 40531.0001;
DVG 621 BK - 33220 s/n 40830.0001;
DVG 621 IX - 33212 s/n 40830.0001;
DVG 621 WH - 33221 s/n 40830.0001;
DWM 55 A - 29793 s/n 41001.0001;
DWT 10 P.2 - 32228 s/n 40830.0001;
FDW 20 P - 33182 s/n 41001.0001;
FDW 80 G - 33189 s/n 41001.0001;
FDW 80 P - 33187 s/n 41001.0001;
FDW 80 T - 33188 s/n 41001.0001;
FDW 85 A - 33190 s/n 41001.0001;
FDW 60 G - 33185 s/n 41001.0001;
FDW 60 P - 33183 s/n 41001.0001;
FDW 60 T - 33184 s/n 41001.0001;
FDW 65 A - 33186 s/n 41001.0001;
IDE 100 (EU) - 30666 s/n 41001.0001;
IDE 100 S (IT) - 30216 s/n 41001.0001;
IDE 100 SK - 30758 s/n 41001.0001;
IDE 1000 UK - 30044 s/n 41001.0001;
IDE 1005 S UK - 30045 s/n 41001.0001;
IDE 44 EU - 30423 s/n 40911.0001;
IDE 44 UK - 30394 s/n 40916.0001;
IDL 40 DE - 32308 s/n 41001.0001;
IDL 40 EU - 30417 s/n 41001.0001;
IDL 40 FR - 30403 s/n 41001.0001;
IDL 40 S UK - 31956 s/n 41001.0001;

IDL 40 UK - 30393 s/n 41001.0001;
IDL 42 DE - 32309 s/n 40830.0001;
IDL 42 EU - 30419 s/n 40911.0001;
IDL 42 FR - 30404 s/n 40911.0001;
IDL 50 EU.2 - 32006 s/n 40916.0001;
IDL 50 SK.2 - 32221 s/n 41001.0001;
IDL 500 FR - 30014 s/n 40916.0001;
IDL 505 S UK.2 - 32001 s/n 41001.0001;
IDL 51 (EU) - 31075 s/n 40906.0001;
IDL 51 EU.2 - 32217 s/n 40906.0001;
IDL 55 (DE) - 30561 s/n 40909.0001;
IDL 55 (EU) - 30634 s/n 40916.0001;
IDL 55 (IT) - 30212 s/n 40916.0001;
IDL 55 DE.2 - 32220 s/n 40909.0001;
IDL 55 EU.2 - 32215 s/n 40917.0001;
IDL 55 S (DE) - 30565 s/n 40909.0001;
IDL 55 S (IT) - 30213 s/n 40916.0001;
IDL 55 S DE.2 - 32224 s/n 40909.0001;
IDL 57 (PT) - 31086 s/n 40916.0001;
IDL 60 (EU) - 30644 s/n 40909.0001;
IDL 60 (IT) - 30214 s/n 41001.0001;
IDL 60 EU.2 - 32216 s/n 40909.0001;
IDL 60 NL.2 - 32219 s/n 41001.0001;
IDL 60 S (EU) - 30647 s/n 40909.0001;
IDL 60 S EU.2 - 32225 s/n 40909.0001;
IDL 60 SK - 30755 s/n 41001.0001;
IDL 60 SK.2 - 32222 s/n 41001.0001;
IDL 61 (EU) - 30680 s/n 41001.0001;
IDL 61 EU.2 - 32218 s/n 41001.0001;
IDL 62 (EU) - 30686 s/n 40911.0001;
IDL 62 EU.2 - 32223 s/n 40911.0001;
IDL 63 S NL.2 - 32226 s/n 41001.0001;
IDL 70 (EU) - 30654 s/n 40902.0001;
IDL 70 (IT) - 30215 s/n 41001.0001;
IDL 70 D EU - 30600 s/n 41001.0001;
IDL 700 FR - 30016 s/n 41001.0001;
IDL 700 UK - 30042 s/n 41001.0001;
IDL 7021 (SP) - 30603 s/n 40902.0001;
IDL 710 FR - 30017 s/n 41001.0001;
IDL 75 (EU) - 30661 s/n 41001.0001;
IDL 75 EU.2 - 32627 s/n 41001.0001;
IDL 75 S (EU) - 30604 s/n 41001.0001;
IDL 75 S EU.2 - 32845 s/n 41001.0001;
IDL B2 EU - 32271 s/n 40917.0001;
IDL 500 UK.2 - 31984 s/n 40524.0001 ;
IDL 50 EU - 30217 s/n 40531.0001;
IDL 550 FR - 30015 s/n 40531.0001;
IDL 705 SUK - 30043 s/n 40531.0001;
L 6047 FR - 33150 s/n 40830.0001;
L 61 (IT) - 28169 s/n 40917.0001;
L 61 AG - 29907 s/n 40917.0001;
L 61 EU - 28470 s/n 40917.0001;
L 63 (IT) - 28453 s/n 41001.0001;
L 63 AUS - 29912 s/n 41001.0001;
L 63 EU - 29544 s/n 40909.0001;
L 63 SK - 31080 s/n 41001.0001;
L 63 SK.2 - 32227 s/n 41001.0001;

L 63 X (IT) - 28904 s/n 41001.0001;
L 63 X AUS - 29913 s/n 41001.0001;
L 64 AUS - 29914 s/n 41001.0001;
L 64 X AUS - 29915 s/n 41001.0001;
LD 85 (IT) - 28454 s/n 41001.0001;
LD 85 X (IT) - 28457 s/n 41001.0001;
LD 87 (IT) - 28455 s/n 41001.0001;
LD 87 EU - 28473 s/n 41001.0001;
LD 87 FR - 29285 s/n 41001.0001;
LD 87 X (IT) - 28458 s/n 41001.0001;
LD 87 X AUS - 29918 s/n 41001.0001;
LD 87 X EU - 28474 s/n 41001.0001;
LD 87 X SK - 29692 s/n 41001.0001;
LI 420 - 30392 s/n 40830.0001;
LI 460 - 30370 s/n 40830.0001;
LI 480 A - 30371 s/n 40830.0001;
LI 660 A - 30304 s/n 40830.0001;
LI 700 DUO - 29515 s/n 40830.0001;
LI 620 - 29511 s/n 40714.0001;
LI 640 A - 29512 s/n 40531.0001;
LI 670 DUO - 29513 s/n 40603.0001;
LI 680 DUO - 29514 s/n 40607.0001;
LIQ 700 DUO JADE - 29952 s/n 40830.0001;
LL 40 EU - 30408 s/n 41001.0001;
LL 42 EU - 30411 s/n 40907.0001;
LL 420 FR - 30397 s/n 40907.0001;
LL 43 S EU - 30412 s/n 40907.0001;
LL 62 FR - 30614 s/n 41001.0001;
LL 62 X FR - 30615 s/n 41001.0001;
LL 63 EU - 29909 s/n 41001.0001;
LL 63 FR - 28460 s/n 41001.0001;
LL 63 TK - 28471 s/n 41001.0001;
LL 63 X EU - 30174 s/n 41001.0001;
LL 64 X AUS - 29917 s/n 41001.0001;
LL 64 77 - 31940 s/n 41001.0001;
LL 64 AG - 29908 s/n 40920.0001;
LL 64 AUS - 29916 s/n 41001.0001;
LL 64 DE - 31941 s/n 41001.0001;
LL 64 EU - 29545 s/n 41001.0001;
LL 64 SK - 29690 s/n 41001.0001;
LL 64 X EU - 29546 s/n 41001.0001;
LL 65 (IT) - 28903 s/n 41001.0001;
LL 65 EU - 29547 s/n 40906.0001;
LL 65 FR - 28462 s/n 41001.0001;
LL 65 TK - 28472 s/n 41001.0001;
LL 65 X EU - 29910 s/n 40906.0001;
LL 65 X FR - 29284 s/n 41001.0001;
LL 6546 FR - 33151 s/n 40916.0001;
LV 460 A BK - 30379 s/n 40830.0001;
LV 460 A IX - 30377 s/n 40830.0001;
LV 460 A WH - 30378 s/n 40830.0001;
LV 460 BK - 30375 s/n 40920.0001;
LV 460 IX - 30372 s/n 40920.0001;
LV 460 WH - 30373 s/n 40920.0001;
LV 620 BK - 29939 s/n 41001.0001;
LV 620 IX - 29941 s/n 41001.0001;
LV 620 WH - 29940 s/n 41001.0001;

LV 640 A BK - 29942 s/n 40902.0001;
LV 640 A IX - 29946 s/n 40902.0001;
LV 640 A R AN - 29944 s/n 40902.0001;
LV 640 A R OW - 29945 s/n 40902.0001;
LV 640 A WH - 29943 s/n 40902.0001;
LV 650 A ALU - 29922 s/n 41001.0001;
LV 650 A BK - 29925 s/n 41001.0001;
LV 650 A IX - 29921 s/n 41001.0001;
LV 650 A OW - 29923 s/n 41001.0001;
LV 650 A WH - 29924 s/n 41001.0001;
LV 660 A BK FR - 30300 s/n 40902.0001;
LV 660 A IX FR - 30301 s/n 40902.0001;
LV 660 A WH FR - 30299 s/n 40902.0001;
LV 670 DUO ALU - 29926 s/n 41001.0001;
LV 670 DUO AN - 29947 s/n 41001.0001;
LV 670 DUO IX - 29948 s/n 41001.0001;
LV 670 R AN - 30302 s/n 40830.0001;
LV 670 R OW - 30303 s/n 40830.0001;
LV 680 DUO IX - 29949 s/n 41001.0001;
LVI 12-44 AN - 29564 s/n 40830.0001;
LVI 12-44 IX - 29562 s/n 40830.0001;
LVI 12-44 WH - 29563 s/n 40830.0001;
LVI 12-55 AN - 29567 s/n 41001.0001;
LVI 12-55 IX - 29565 s/n 41001.0001;
LVI 12-55 WH - 29566 s/n 41001.0001;
LVI 12-66 AN - 29570 s/n 41001.0001;
LVI 12-66 IX - 29568 s/n 41001.0001;
LVI 12-66 M BA - 29573 s/n 41001.0001;
LVI 12-66 M GI - 29571 s/n 41001.0001;
LVI 12-66 M VA - 29572 s/n 41001.0001;
LVI 12-66 WH - 29569 s/n 41001.0001;
LVO 670 DUO IX - 30848 s/n 40830.0001;
LVO 680 DUO IX - 29951 s/n 40902.0001;
LVR 640 A AN - 33614 s/n 40902.0001;
LVR 640 A OW - 33615 s/n 40902.0001;
LVR 670 AN - 33616 s/n 40830.0001;
LVR 670 OW - 33617 s/n 40830.0001;
LVTI 12-55 - 29574 s/n 41001.0001;
LVTI 12-66 - 29575 s/n 41001.0001;
SDW 60 P - 31010 s/n 40906.0001;
XLV 670 DUO IX - 29950 s/n 41001.0001.

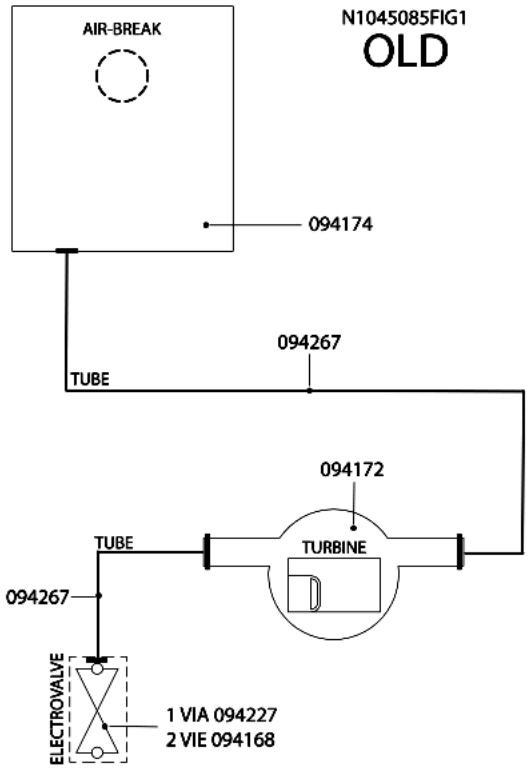

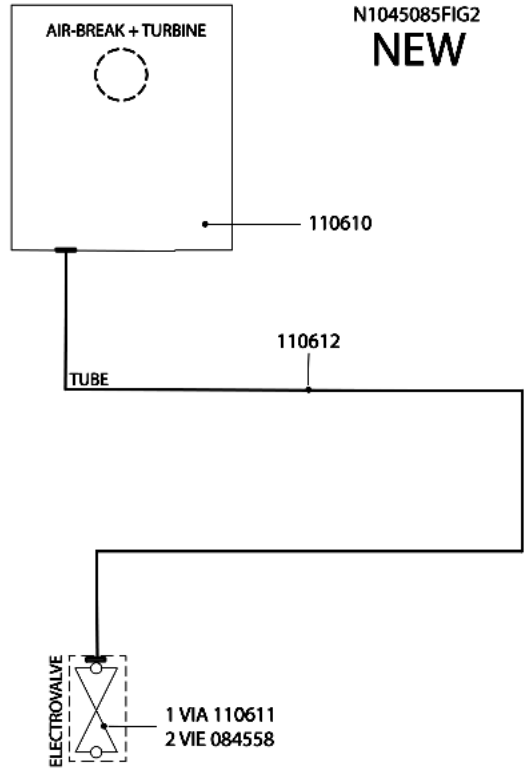

n1045090: Elimination of Turbo Dry drying system

The Turbo Dry drying system has been eliminated from all dishwashers affected by this bulletin.

ELIMINATED PARTS:
Turbo Dry Assembly P/N 096408
Turbo Dry ring nut P/N 094601
Turbo Dry Hose / Sump P/N 096410
Turbo Dry sump trap assembly P/N 096409

PARTS INTRODUCED:
Sump trap assembly P/N 094143
RH lateral sound insulation P/N 076388

This modification also concerns the timer and wiring; the following list shows the affected models with the relevant modification start serial numbers.

FDW60P (commercial code 33183)
Serial no.: 41011.0001
Wiring: premodification 114457 - new 114458
Bit 100 Timer: premodification 097481(Rohs 143207)‘E2'- new114403 (Rohs 143209) E4'

FDW60T (commercial code 33184)
Serial no.: 41011.0001
Wiring: premodification 114457 - new 114458
Bit 100 Timer: premodification 097481(Rohs 143207) ‘E2' - new 114403(Rohs 143209) ‘E4'

FDW60G (commercial code 33185)
Serial no.: 41011.0001
Wiring: premodification 114457 - new 114458
Bit 100 Timer: premodification 097481(Rohs 143207)‘E2' - new 114403(Rohs 143209) ‘E4'

FDW65A (commercial code 33186)
Serial no.: 41011.0001
Wiring: premodification 114457 - new 114458
Bit 100 Timer: premodification 097481(Rohs 143207)‘E2'- new 114403(Rohs 143209) ‘E4'

FDW20P (commercial code 33182)
Serial no: 41020.0001
Wiring: premodification 114574 - new 112933
Bit 100 Timer: premodification 109875(Rohs 143211)‘S1'-new114767(Rohs144314)‘E5'

LL65XFR (commercial code 29284)
Serial no.: 41102.0001
Wiring: premodification 114457 - new 114458
Bit 100 Timer: premodification 097481(Rohs 143207)‘E2' – new 14403(Rohs143209) ‘E4'

IDL61EU (commercial code 30680)
Serial no.: 41102.0001
Wiring: premodification 114567 - new 112915
Bit 100 Timer: premodification 097481(Rohs 143207) ‘E2' - new 114403(Rohs143209) ‘E4'

IDL61EU.2 (commercial code 32218)
Serial no.: 41102.0001
Wiring: premodification 114567 - new 112915
Bit 100 Timer: premodification 109875(Rohs 143211)‘S1' - new 114403(Rohs143209) ‘E4'

IDL70IT (commercial code 30215)
Serial no.: 41102.0001
Wiring: premodification 114565 - new 112901

Bit 100 Timer: premodification 097481(Rohs 143207)‘E2' - new 114403(Rohs143209) ‘E4'

IDL75EU.2 (commercial code 32627)
Serial no.: 41102.0001
Wiring: premodification 114565 - new 112901
Bit 100 Timer: premodification 097481(Rohs 143207)‘E2' - new 114403(Rohs143209) ‘E4'

IDL75SEU.2 (commercial code 32845)
Serial no.: 41102.0001
Wiring: premodification 114565 - new 112901
Bit 100 Timer: premodification 097481(Rohs 143207)‘E2' - new 114403(Rohs143209) ‘E4'

IDL75EU (commercial code 30661)
Serial no.: 41102.0001
Wiring: premodification 114565 - new 112901
Bit 100 Timer: premodification 097481(Rohs 143207)‘E2' - new 114403(Rohs143209) ‘E4'

IDL75SEU (commercial code 30604)
Serial no.: 41102.0001
Wiring: premodification 114565 - new 112901
Bit 100 Timer: premodification 097481(Rohs 143207)‘E2' - new 114403(Rohs143209) ‘E4'

IDL710FR (commercial code 30017)
Serial no.: 41102.0001
Wiring: premodification 114563m - new 114633
Bit 100 Timer: premodification 097481(Rohs 143207)‘E2' - new 114403(Rohs143209) ‘E4'

LL65FR (commercial code 28462)
Serial no: 41103.0001
Wiring: premodification 114457 - new 114458
Bit 100 Timer: premodification 097481(Rohs 143207)‘E2' - new 114403(Rohs143209) ‘E4'

LVZ680DUOIX (commercial code 33662)
Serial no: 41223.0001
Wiring: premodification 114494 – new 115692
Bit 100 Timer: premodification 111884(Rohs 143217)‘F1’ – new 115691(Rohs 143219) ‘F3’

LZ700DUOIX (commercial code 33663)
Serial no: 41223.0001
Wiring: premodification 113150 – new 115693
Bit 100 Timer: premodification 111884(Rohs 143217)‘F1’ – new 115691(Rohs 143219) ‘F3’

BFI680 (commercial code 30715)
Serial no: 50121.0001
Wiring: premodification 111353 - new 114552
Bit 100 Timer: premodification 097481(Rohs 143207)'E2' - new 115691(Rohs 143219) 'F3'

LI680DUO (commercial code 29514)
Serial no: 50121.0001
Wiring: premodification 111353 - new 114552
Bit 100 Timer: premodification 097481(Rohs 143207)'E2' - new 115691(Rohs 143219) 'F3'

LI700DUO (commercial code 29515)
Serial no: 50121.0001
Wiring: premodification 111353 - new 114552
Bit 100 Timer: premodification 097481(Rohs 143207) 'E2'-new115691(Rohs 143219)'F3'

LIQ700DUOTI (commercial code 33970)
Serial no: 50121.0001
Wiring: premodification 111353 - new 114552
Bit 100 Timer: premodification 097481(Rohs 143207)'E2' -new115691(Rohs 143219)'F3'

LVA12-56AN (commercial code 33610)
Serial no: 50206.0001
Wiring: premodifica 112165 – new 116170
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

LVA12-56WH (commercial code 33611)
Serial no: 50206.0001
Wiring: premodifica 112165 – new 116170
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

LVI12-66IX (commercial code 29568)
Serial no: 50206.0001
Wiring: premodifica 113039 – new 116172
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

LVI12-66MGI (commercial code 29571)
Serial no: 50206.0001
Wiring: premodifica 113039 – new 116172
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

LVX12-67IX (commercial code 33950)
Serial no: 50207.0001
Wiring: premodifica 113039 – new 116172
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

LVX12-56AN (commercial code 33749)
Serial no: 50207.0001
Wiring: premodifica 112165 – new 116170
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

LVX12-56WH (commercial code 33750)
Serial no: 50207.0001
Wiring: premodifica 112165 – new 116170
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

LVX12-56IX (commercial code 33748)
Serial no: 50207.0001
Wiring: premodifica 112165 – new 116170
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

LVX12-67WH (commercial code 33952)
Serial no: 50207.0001
Wiring: premodifica 113039 – new 116172
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

LVX12-67AN (commercial code 33951)
Serial no: 50207.0001
Wiring: premodifica 113039 – new 116172
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

LVM12-67BA (commercial code 33953)
Serial no: 50207.0001

Wiring: premodifica 113039 – new 116172
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

LVM12-67GI (commercial code 33954)
Serial no: 50207.0001
Wiring: premodifica 113039 – new 116172
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

FDW80T (commercial code 33188)
Serial no: 50207.0001
Wiring: premodifica 114573 – new 116173
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

FDW80P (commercial code 33187)
Serial no: 50208.0001
Wiring: premodifica 114573 – new 116173
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

FDW85A (commercial code 33190)
Serial no: 50208.0001
Wiring: premodifica 114573 – new 116173
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

FDW80G (commercial code 33189)
Serial no: 50208.0001
Wiring: premodifica 114573 – new 116173
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

LD87XSK (commercial code 29692)
Serial no: 50214.0001
Wiring: premodifica 114546 – new 116174
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

LD87FR (commercial code 29285)
Serial no: 50214.0001
Wiring: premodifica 114551 – new 116173
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

IDE1000UK.2 (commercial code 34121)
Serial no: 50214.0001
Wiring: premodifica 114052 – new 116175
Bit 100 Timer: premodifica 099892(Rohs 143208)‘E3’ – new 114403(Rohs 143209)‘E4’

IDE1005SUK.2 (commercial code 34122)
Serial no: 50214.0001
Wiring: premodifica 114052 – new 116175
Bit 100 Timer: premodifica 099892(Rohs 143208)‘E3’ – new 114403(Rohs 143209)‘E4’

LL6546FR (commercial code 33151)
Serial no: 50214.0001
Wiring: premodifica 112896 – new 116177
Bit 100 Timer: premodifica 111884(Rohs 143217)‘F1’ – new 115691(Rohs 143219)‘F3’

IDE100SK (commercial code 30758)
Serial no: 50216.0001
Wiring: premodifica 114566 – new 116179

Bit 100 Timer: premodifica 099892(Rohs 143208)‘E3’ – new 114403(Rohs 143209)‘E4’

IDE100SIT (commercial code 30216)
Serial no: 50217.0001
Wiring: premodifica 114566 – new 116179
Bit 100 Timer: premodifica 099892(Rohs 143208)‘E3’ – new 114403(Rohs 143209)‘E4’

IDE100EU (commercial code 30666)
Serial no: 50217.0001
Wiring : premodifica 114566 – new 116179
Bit 100 Timer: premodifica 099892(Rohs 143208)‘E3’ – new 114403(Rohs 143209)‘E4’

LVTI12-67 (commercial code 33955)
Serial no: 50218.0001
Wiring: premodifica 111353 – new 114552
Bit 100 Timer: premodifica 097481(Rohs 143207)‘E2’ – new 115691(Rohs 143219) ‘F3’

CISLI700DUO (commercial code 34142)
Serial no: 50224.0001
Wiring: old 111353 – new 114552
Bit 100 Timer: old 097481(Rohs 143207)‘E2’ – new 115691(Rohs 143219)‘F3’

LL68XFR (commercial code 34382)
Serial no: 50225.0001
Wiring: old 112896 – new 116177
Bit 100 Timer: old 111884(Rohs 143217)‘F1’ – new 115691(Rohs 143219)‘F3’

LD87IT (commercial code 28455)
Serial no: 50228.0001
Wiring: old 114546 – new 116174
Bit 100 Timer: old 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

LD87XIT (commercial code 28458)
Serial no: 50228.0001
Wiring: old 114546 – new 116174
Bit 100 Timer: old 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

LD87XEU (commercial code 28474)
Serial no: 50228.0001
Wiring : old 114546 – new 116174
Bit 100 Timer: old 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

LD87EU (cod. comm 28473)
Serial no: 50228.0001
Wiring: old 114546 – new 116174
Bit 100 Timer: old 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

LD87XAUS (commercial code 29918)
Serial no: 50228.0001
Wiring: old 114551 – new 116173
Bit 100 Timer: old 111886(Rohs 143220)‘F2’ – new 116171(Rohs 143220)‘F4’

LL68FR (commercial code 34381)
Serial no: 50303.0001
Wiring: old 112896 – new 116177
Bit 100 Timer: old 111884(Rohs 143217)‘F1’ – new 115691(Rohs 143219)‘F3’

LV661AIX (commercial code 33945)
Serial no: 50704.0001
Wiring: old 113064 – new 119244
Bit 100 Timer: old 111886(Rohs 143220)‘F2’ – new 119420(Rohs 143221)‘F5’

LI661A (commercial code 33944)
Serial no: 60413.0001
Wiring: old 113080 – new 112909
Bit 100 Timer: old 099892(Rohs 143208)‘E3’ – new 119420(Rohs 143221)‘F5’

n1045127: New airbreak - solution of water spurts leaking from base LVS 60 CM

From serial number 50930.0001, to solve the problem of water spurts emitted from the lower right and left side of the door the following modifications were introduced in production:

1-Airbreak without insert to allow the necessary pressure venting
2-Honeycomb top panel to protect the kitchen unit from any steam emitted (only on built-under models)
3-Tank seal length increased by 3 cm to improve water tightness
4-Die-cut roof sound-deadening panel
5-Three clips for correct fixing of the tank base seal (in production from serial number 50701.0001)

New parts:
C00141308 - Airbreak
C00141310 - Honeycomb top panel (built-under versions only)
C00141317 - Tank seal
C00141314 - Roof sound-deadening panel
C00140679 - Tank base seal fixing clip

Premodification parts
C00110610 - Airbreak
C00116110 - Tank seal
C00097300 - Roof sound-deadening panel


1) AIRBREAK REPLACEMENT
It is mandatory to use the new part; in the event of replacement with premodification appliances proceed as follows:
- replace the airbreak with the new part C00141308
- if present, refit the roof sound-deadening panel after cutting out a 10x10 cm square from the rear left-hand corner
- on the built-under version, fit honeycomb panel C00141310 on the top of the appliance
- replace tank seal with the new seal P/N C00141317

WARNING: when replacing an airbreak without a litre-counter turbine use exclusively the same type of part (P/N C00094174 - all the relevant details are given in bulletin n1045085)

2) CHANGING THE TANK SEAL
On appliances with serial number from 40101.0001 to 50930.0001, you can use the new tank seal P/N C00141317 after cutting 1.5 cm off each end.

Electric schemes and links

Cod. 16001702600

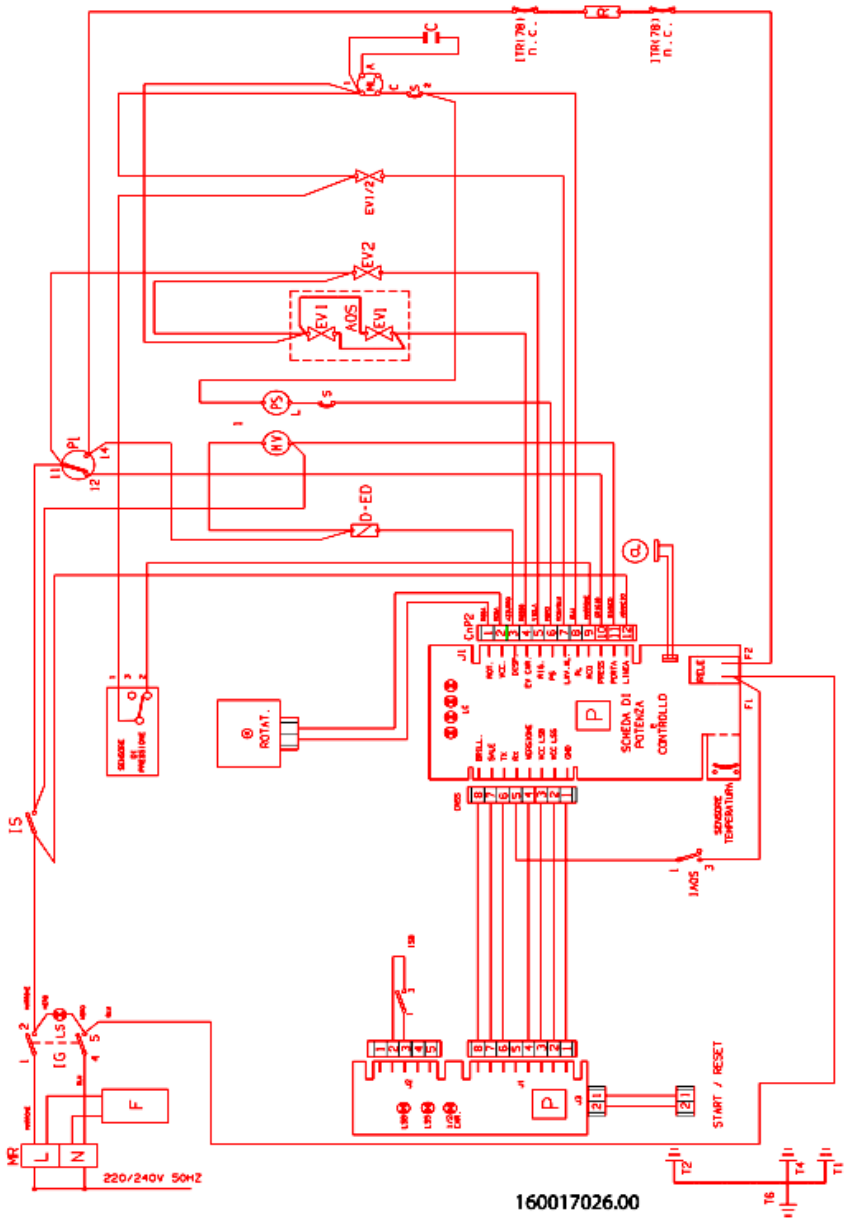

Legend

Legend: 16001702600

A..	Timer contact	LPA	Door open
AQS	Aquastop electrovalve	LPR	Prewash LED
B..	Timer contact	LRI	Rinse LED
C	Condensor	LS	Mains LED -Pilot lampe On/Off
C..	Timer contact	LSB	Polisher LED
CL	Slow cam	LSC	Cycle ranning lamp
CM	Wash pump motor connector	LSE	Acquastop LED
CN	Connector	LSS	Salt LED
CV	Fast cam	LV	Fan off lamp
D-ED	Dispenser - Electric dosing device	M	Terminal box
D..	Timer contact	MB	Polisher dip-switch
DB	Brightener dispenser	ME	Acquastop dip-switch
DD	Display - Detergent dispenser	ML	Wash motor
E1	Cold water electrovalve	MM	Handle dip-switch
E2	Regeneration electrovalve	MP	Door dip-switch
E3	Hot water electrovalve	MR	Delay-timer motor - Terminal board
ECO	Saving switch	MT	Timer motor
ED	Detergent/Brightener dispenser	MTR	Fast forward timer motor
EV1	Cold water electrovalve MM- Handle dip-switch	MV	Motor fan
EV1/2	Half-load electrovalve	P	Pressure switch
EV2	Regeneration electrovalve	P..	Pressure switch contact
EV3	Hot water electrovalve	P1	Stage 1 pressure
EVC	Hot water electrovalve	P2	Stage 2 pressure switch
EVF	Cold water electrovalve	PAP	High pressure switch
EVR	Regeneration water electrovalve	PO	Overflow pressure switch
F	Anti-interference filter ML- Wash motor	PS	Drain pump
FA	Radio interferences	PULS	Push-button panel
I1	On/Off switch - Plus cycle switch -IEC cycle	R	Heating element
I1/2	Switch half-load	R.D.	Delay rotary selector
I2	Fast switch -IEC cycle switch (standard) -	RA	Heating element drying
I2H	2-hour delay switch	ROT D	Delay rotary selector
I3	Saving switch- Switch for cycle with no pre-	ROT.	Rotary selector
I4	Switch for cycle fresh dirty	S	Motor overload cutout

I4H	4-hour delay switch	SC	Selector cycli
I5-ICR	Fast cycle switch	SS	Salt detector
I6	Soak cycle switch	ST	START
I6H	6-hour delay switch	T..	Delay-tymer contact
IAQS	Aquastop switch	T1	Power supply earth cable -Thermostat 45?C
ID	Switch display	T2	Lid earth -Thermostat 55?C
IE	Saving switch	T3	Timer earth -Thermostat 65?C
IEXD	Exstra dray switch	T36	36?C N.O. Thermostat
IG	Main switch	T4	Heating element earth
IMV	Off motor fan switch	T46	46?C N.O. Thermostat
IP	High temperature switch	T5	Drain pump earth
IS	Cut-off switch	T57	57?C N.O. Thermostat
ISB	Polisher led switch	T6	Wash motor earth
ISS	Salt LED switch	T8	External lid earth
ITR	Heating element switch	TE	Relay switch
L	Mains LED	THP	Thermoprotector
L1	Cycle 1 lamp	TM	Timer
L1/2	Lamp cjcle half-load	TS	Safety thermostat
L2	Cycle 2 lamp	TS 40	Thermostat 40 ?C
L3	Cycle 3 lamp	TS 50	Thermostat 50 ?C
L4	Cycle 4 lamp	TS 62	Thermostat 62 ?C
L5	Cycle 5 lamp	TS1	Min. temperature thermostat
L6	Cycle 6 lamp	TS2	Max. temperature thermostat
LA	Drying LED	TT	Terminal box support earth
LAQ	Aquastop on lamp	Tcp	nner-door earthing connection
LC	Cycle ranning lamp	Tfa	Radio interference
LD	Delay activated lamp	Tml	Pump wash motor earthing connection
LE	Saving cycle	Tpg	Large door earthing connection
LH2	2-hour delay lamp	Tpi	Inspection door earthing connection
LH4	4-hour delay lamp	Tpr	Pressure switch
LH6	6-hour delay lamp	Tps	Discharge pump earthing connection
LL	Wash LED	Tr	Heating element
LP	High temperature LED	Tte	Delay-timer earthing connection