
INDESIT company

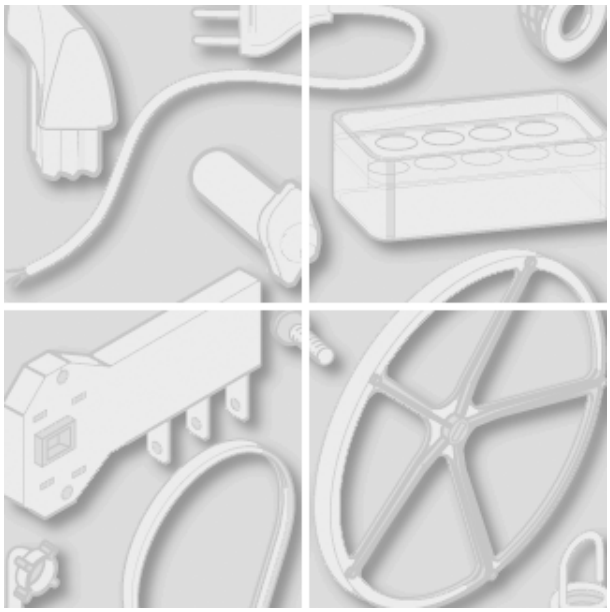

Model type:

WISL105XEX

Commercial code:

F030566

General notes

Technical Documentation guidelines

You can find herewith some generic information to simplify cunsulting of technical documentation:

1. Models of same range share the same exploded views, which report the richest set of spare parts:generally, a model does not necessarly have a related spare part for each particular shown on exploded views.

2. Some spare parts can not be represented directly on the exploded views (instruction booklets, specific kit, etc...). You can find those codes in the spare parts list with the same reference of particular where spares are installed or with references 099, 999. Instruction booklets, once managed, appear with 000 reference.

3. On the higher right site of each exploded view there is a serial number which indicates the beginning of the production of certain range:some models might have more than an exploded view for a given category, each distinguished by a different serial no.and linked to another spare parts list, In this case, serial no. is required to supply the right spare part code. Exploded view to be considered is the one with a more recent serial no. but previous than the one of the model that needs assistance.

4.Exploded views might require further updates even after publishing. Addition of new spares will go on following the already existing numeration references. Revision number of an exploded view is shown into last four digits of serial number into upper right hand corner.

5.The spare parts list associated to an exploded view shows related codes of spares managed for a certain model; for each spare part other informations are available:


REF: reference no of spare into a table; SUBSTITUTE: list of spare(s) which can replace a code but that keeps same functional characteristics

INDUSTRIAL CODE: list of variables of a model (shown into model label) where such spare is used; NOTICE: code of information(s) to refer to complete technical intervention, track for changes or to find correct spare part code.

6. Some notices, into a same section are generic therefore cannot be directly linked to a spare part. In order to assist a model in the best way as possible, it is helpful to pay attention to all notices and constantly verify documentation updates

7.Technical documentation cover shows model name and its commercial codes

1140230 Exploded views

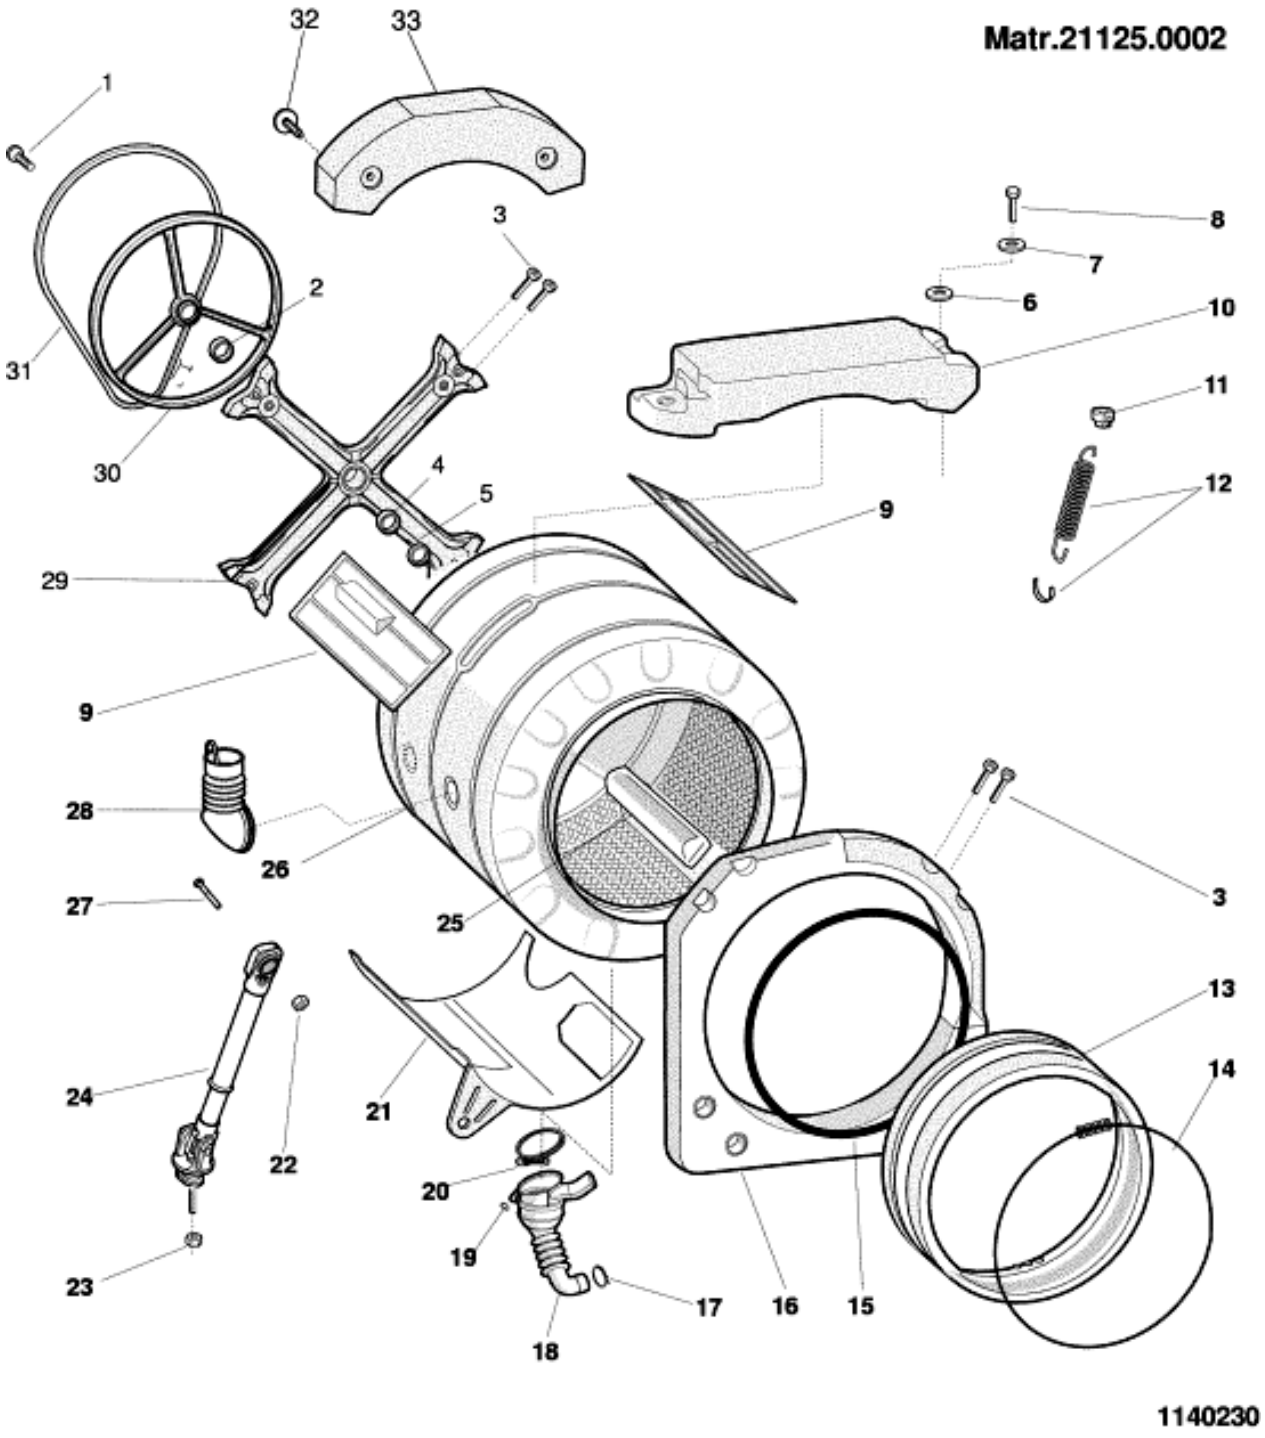

1140230 Spare parts list


Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
001	C00064786			1 x C00143260	bolt m8x23 torx tefl		
002	C00013563				bearing fits light/heavy spider 25		
002	C00026299				circlip 60 x 1.5	n1040326	
003	C00064785			1 x C00193879	bolt m8x22 tb6lt		
004	C00002591				bearing 20x47x14		
004	C00026298				bearing ba2b 633667 30x60.03x37	n1040326	
005	C00039667				oil seal bearing + spider/tank seal	n1040326	
005	C00096186				standard oil seal	n1040300 n1040326	
008	C00088408				bolt + washer		
009	C00065918				support left right lb		
010	C00064548				upper counterweight 11 kg		
011	C00064515				anchorage pad - suspension		
012	C00064502				suspension spring - tank		
013	C00095328		40613...		door bellows seal avsd avsl		
013	C00110330	40614...			door bellows seal avsd avsl d= 30		
014	C00092156				door seal retainer front		
015	C00092155				door seal- rear retainer		
016	C00092178				front counterweight		
017	C00092411			1 x C00094908	hose clamp		
018	C00094312				hose tank to filter oko ws - abs		
019	C00092412				hose clamp		
020	C00091148			1 x C00094908	clamp d=79 mm		
021	C00093878				cradle outer- set	n1040325	
022	C00030443			1 x C00047136 1 x C00144571	nut romob m8		
023	C00065152				nut romob m6x22x1,5		
024	C00303582				kit shock absorber 80 n 8.15 mm		
025	C00065463				lifter 40 - 46l		
026	C00094289			1 x C00094275 1 x C00094290	outer- set 40 l. evo ii	n1040326	
027	C00093750				bolt zink m8x40		
028	C00092161				hose dispenser to tank		
029	C00074137				bearing spider assembly	n1040326	
029	C00110340				bearing spider assembly	n1040326	

1140230 Spare parts list


Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
030	C00064527				drum pulley cone d=280 mm h=		
030	C00081875				drum pulley d=280mm h=25mm	n1040326	
031	C00059721				belt l=1181/1187 mm h7		
099	C00001109				loctite 270 10 gr.		
099	C00033026			1 x C00292523	ambljgon grease ta 100 gr.		

1140960 Exploded views

The new wiring when fitted, must be securely attacched to the machine wiring with insulating tape. **Matr. 61116.0001**



WIRING P = DRUM BLOCK COD. C00141995

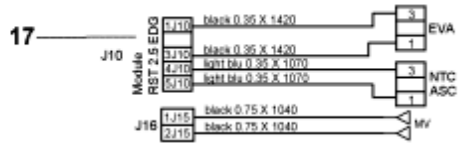


WIRING F = EVA+NTCAS / WIRING G = MTV COD. C00141769




WIRING P = DRUM BLOCK COD. C00112822




WIRING B2 = DISPLAY CONNECTION COD. C00111227

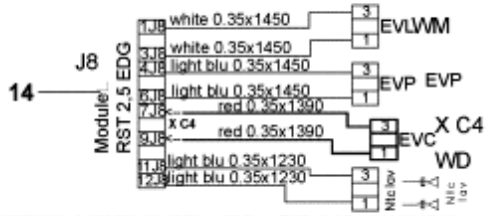


WIRING C1(WM) C3(WD) = EVL + EVP COD. C00093713
WIRING C4 (WD) = EVL + EVP + EVC COD. C00109960




WIRING D = INTERLOCK. + MICRO SWITCH COD. C00093714




WIRING D1 = INTERLOCK. COD. C00093715




WIRING H = DRYING ELEMENT COD. C00093716

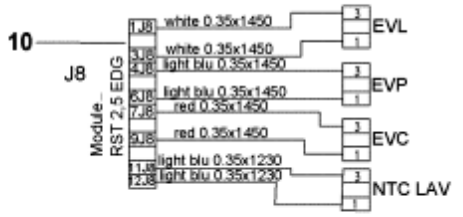


WIRING C = EVL + EVP + EVC COD. C00093724




WIRING A COD.C00141139 (ex C00093722)

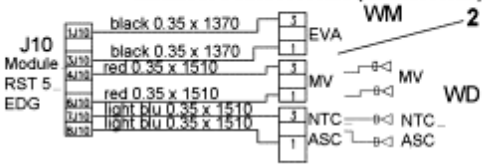


WIRING F = EVA + MV + NTCAS COD.C00093717

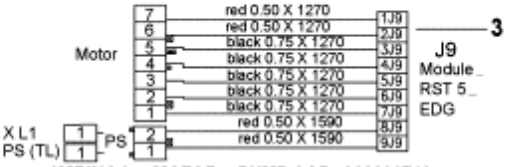


WIRING L = MOTOR + PUMP COD. C00093718
WIRING L1 (TL) = MOTOR + PUMP COD. C00195340




WIRING I = CONDUCTIVITI SENSOR COD. C00093725

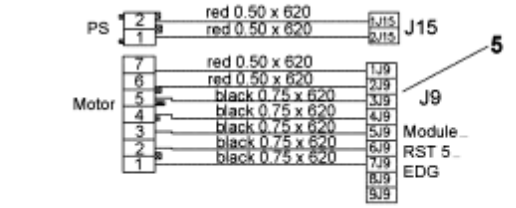


WIRING N = MOTOR + PUMP COD. C00093719




WIRING X = EART STD MACCHINE COD. C00093720



WIRING Y = EART TRI-PHASE MACCHINE COD. C00093721



WIRING B1 = MAIN-DISPLAY CONNECTION COD. C00093726

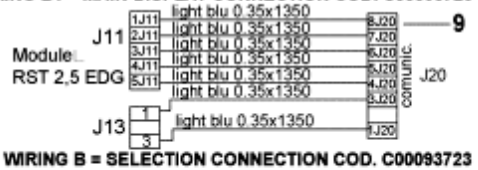

WIRING B = SELECTION CONNECTION COD. C00093723


1140960

1140960 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
001	C00141139				wiring		
003	C00093718				wiring pump-motor-module j9 (hl)		
006	C00093720				wiring standard earth		
008	C00093726				wiring display		
012	C00093715			1 x C00259857	wiring door lock-module j4		
014	C00093713				wiring ntc-evl+evp-module j8		

1180160 Exploded views

Matr. 30901.0002

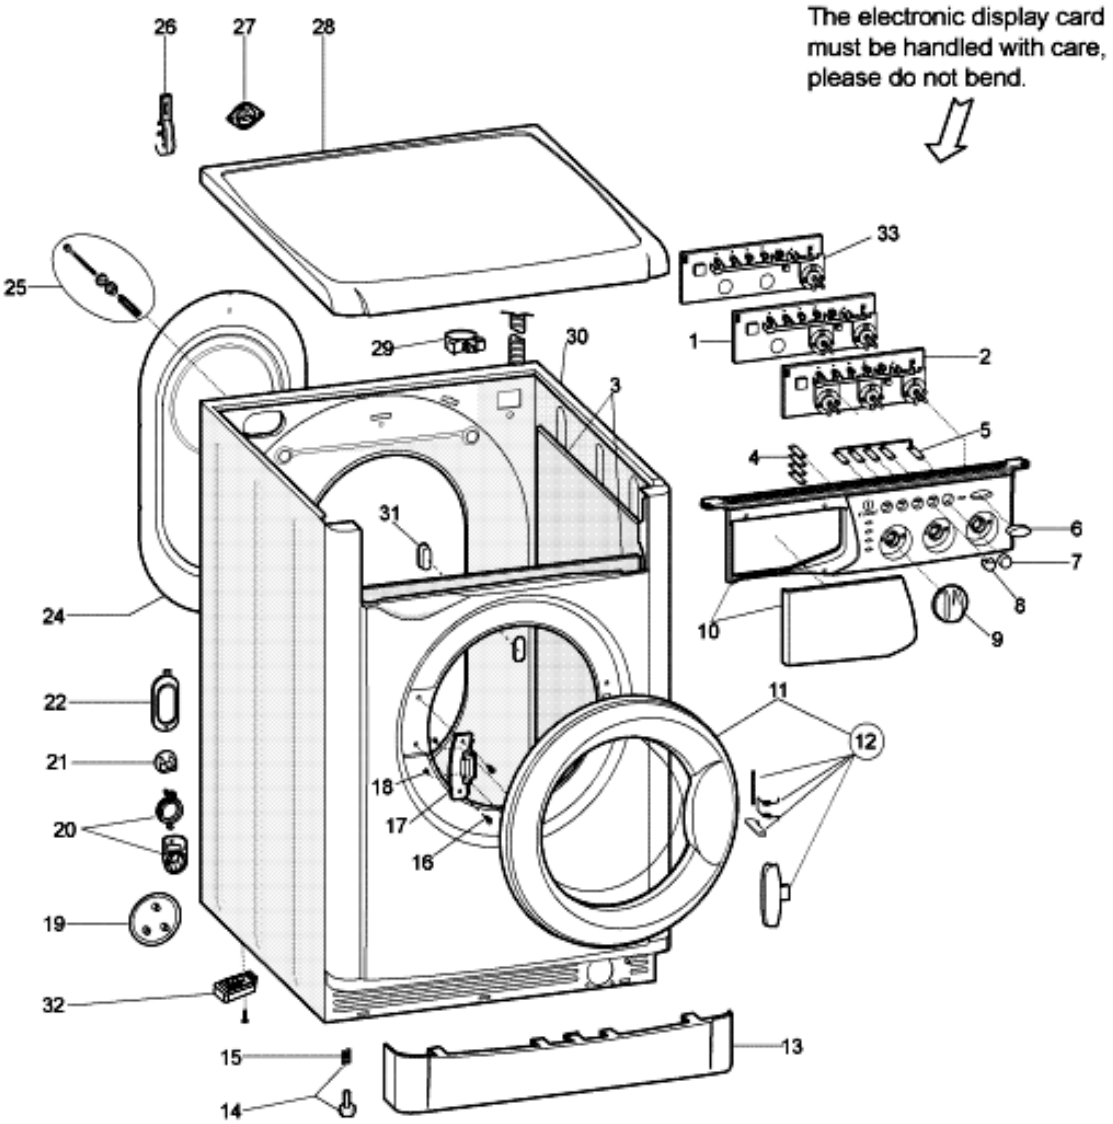

1180160


1180160 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
000	C00098877				user instruct.bookl gb-d-cz-sk-gr		
000	C00098878				user instruct.bookl rs-ro-sb-hr-sl-		
002	C00096998			1 x C00111959 1 x C00114634	control card led 3 knobs ind.evoii	n1040334	
002	C00143332				control card (3 x control knobs)		
004	C00097012				pilot lamp lens vertical evoii		
005	C00097011			1 x C00203127	pilot lamp lens horizontals		
006	C00096932				on/off push button white	n1040359	80305660000
006	C00116243				pushbutton b pw on/off		80305660900
007	C00096933				push button white	n1040359	80305660000
007	C00116245				push button white		80305660900
008	C00096935				pushbutton white 27 ind.evoii	n1040359	80305660000
008	C00116244				pushbutton white pw ind.evoii		80305660900
009	C00096857			1 x C00115924	components knob white 27 ind.	n1040359	80305660000
009	C00115924				knob white		80305660900
010	C00098883				cruscotto + maniglia wisl105xex	n1040359	80305660000
010	C00116742				control panel + handle pw		80305660900
011	C00110134			1 x C00116383	door frame and glass assy b27	n1040359	80305660000
011	C00116383				door frame and glass assy pw		80305660900
012	C00096865				door handle kit		
013	C00096930				plinth white ind. comun. evoii	n1040359	80305660000
013	C00116556				plinth white		80305660900
014	C00087084				foot		
015	C00083828				foot spring (11x8.5mm)		
016	C00096210				screw self tapping		
017	C00075325			2 x C00096210 1 x C00255430	hinge door 3.5 mm indesit		
018	C00065185				bolt m4,5 x 8		
019	C00089803				blanking plug d = 53 mm		
020	C00046666				collar for drain hose		
021	C00065871				blanking plug		
024	C00064501			1 x C00099313 1 x C00116923	rear cover - white	n1040359	80305660000
024	C00116923				rear cover - white pw		80305660900
025	C00077411				transit bolts kit (1 screw + 1		

1180160 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
028	C00097617			1 x C00116555	worktop - white ind.comu. evoii	n1040319 n1040359	80305660000
028	C00116555				worktop - white pw ind.comu.		80305660900
029	C00046667				wiring stop		
029	C00064550				drain hose holder		
030	C00097614			1 x C00116541	cabinet white indes. evoii wisl	n1040359	80305660000
030	C00116541				cabinet pw indes. evoii wisl		80305660900
031	C00084817				blanking plate-rear(test plug)		

1180330 Exploded views

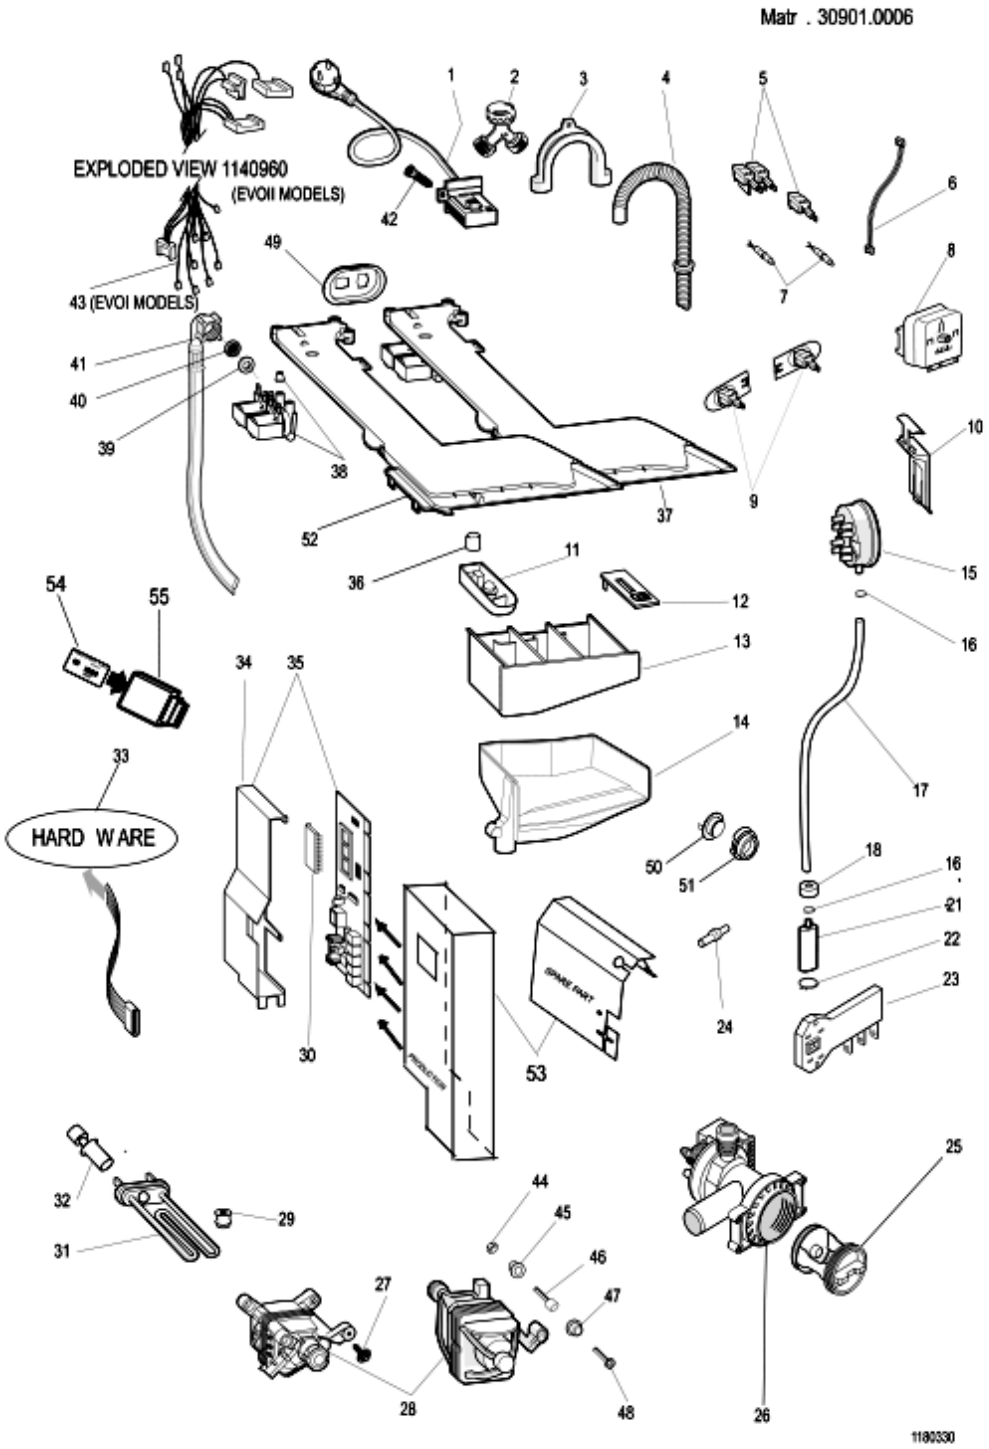

1180330 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
001	C00091633				supply cable 3x1 schuko		
003	C00019902				plastic -u- to make drain hose		
004	C00027466				drain hose - to sink l=1860mm		
010	C00064537			1 x C00263210	support - pressure switch		
011	C00075459				additive container		
012	C00047069			1 x C00097834	additive cover		
013	C00075352			1 x C00097732	soap dispenser drawer		
014	C00092314				dispenser body		
015	C00092312			1 x C00145174	pressure switch 1 l.80 -55 +	n1040299	
016	C00092412				hose clamp		
017	C00092170			1 x C00041785	pipe pressostat l= 470mm. evo ii		
018	C00019755				anti-vibration bush (foam)		
021	C00092173				air trap x oko		
022	C00008612				tube clamp 34,6-36,4		
023	C00065185				bolt m4,5 x 8		
023	C00085194				door interlock		
025	C00045023				filter handle		
025	C00045025				filter seal		
025	C00045027				pump filter kit	n1040376	
025	C00141034				filter element kit		
025	C00297161				filter element kit copreci		
026	C00119307				drain pump		
028	C00095348				motor 850 1000 rpm 940n1snm		
028	C00097255			1 x C00196543	brush motor ceset 6170 a0946		
028	C00097257			1 x C00140558	tacho generator for motor ceset		
028	C00114885				carbon brush for motor sole		
028	C00114886				tachogenerator for motor sole		
029	C00058523				pillar retainer-heating element		
031	C00087188				heat element + sensor hole	n1040300	
032	C00083915				thermistor ntc		
033	C00066292				insulated tweezers		
033	C00084943			1 x C00099862	serial cable lb2000 - pc	n1040317	
033	C00095669			1 x C00145046	hardware key mk1	n1040317	
034	C00091908				bracket for module st		
034	C00091909				support cover		

1180330 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
035	C00254297				power board module evoii (rhos)	n4008c01	
036	C00046157				stopper detergent container		
037	C00097624			2 x C00064534 1 x C00110333 1 x C00140605	hopper cover 1e 2u ind.evoii		
038	C00064534				seal - dispenser to valve		
038	C00110333				fill valve 2 way (7lt rst 2.5)		
039	C00005572				sealing washer-mains inlet hose		
040	C00005781				inlet hose filter		
041	C00003070				mains inlet hose cold 25c 10bar		
042	C00092348				self-scraping screw 3,5x8		
044	C00040932				self locking nut m6		
047	C00074151				rubber bush - motor mount		
048	C00084029				bolt motor m6x34		
049	C00064946				electrovalve support 1 ev		
054	C00260080				card wisl105xex evoii 8kb sw	n4008c01	
055	C00263927			1 x C00272306	smart card reader		

Notices

n1040242: Power card with welded eeprom.

From serial number 20304.0001, IDC power card with welded eeprom is used to ensure the perfect connection of all parts, in the Comunanza, Teverola and Brembate factories.
To replace the module with welded eeprom, it will be necessary to use the eeprom indicated in the SAT document of the model concerned.
To replace the module on a unit with welded eeprom both the SAT module and the eeprom are required, because the latter cannot be reused.

n1040296: List of EVOII FAULTS and troubleshooting.

In case of washing-machine fault in carrying out the self-test function, the machine reproposes the fault previously signalled and the same fault is shown on the display of the new hardware key.
The type of fault can be signalled in different ways:
- on AVD models the fault is shown directly on the machine display.
- on AVL models the fault is signalled by LEDs.

Reading of Faults signalled by LEDs
When the machine has a fault:
1. The window is locked
2. The door lock light flashes fast (> 1 Hz)
3. The control panel LEDs light up, to signal the fault, according to the table (fig. 01).
The example shown in fig. 02 (Example Fault F03) below indicates which LEDs are flashing if the machine has Fault F03

List of faults, malfunctions and Warnings:

F01: Triac Motor short circuit
- Check for water leaks that may affect connector J9 causing the relevant contacts to short
- Check the motor terminal block (possible problems due to chemical effects of work residuals on the contacts which may cause short-circuiting)
- Replace Card

F02: Motor blocked, Tachometrics in Short Circuit/Open
- Check motor if blocked

- Check efficiency of J9 connector on card
- Check the tachometric winding verifying an ohmic resistance reading of 115 - 170 ohm between pins
1 and 2 on wiring connector J9. In case of short circuit/open circuit check the wiring between pins 1 and 2 of J9 relevant to the tachometrics. With three-phase motor, make sure there is ohmic continuity between J9 pins 6 and 7.
- Replace motor
- Replace card

F03: NTC Open or in Short Circuit or washing heater relay stuck (signalled in presence of full load)
- Check efficiency of J8 connector contacts on card
- Check NTC verifying that the ohmic resistance value at room temperature 20°C is approx. 20Kohm on J8 wiring connector pin 11 and 12.
- If the measurement is incorrect check J8/NTC wiring continuity
Check the same parameter directly on NTC
- Replace NTC
- Replace Card

F04: Simultaneous empty and overflow (pressure switch stuck on empty).
If the pressure switch contact is stuck on empty the washing-machine loads water until reaching the overflow. The drain pump is automatically started by the contact on the overflow pressure switch.
- Check efficiency of J3 connector contacts on card
- Check pressure switch status by checking ohmic continuity on wiring connector J3 pins 2 and 4 (it must only be present with tub empty), pins 2 and 3 (it must only be present with water in the drum) and pins 2 and 1 (it must only be present with water in the tub above normal level, more than halfway up door glass).
- Check wiring of connector J3/pressure switch
- Replace pressure switch
- Replace card.

F05: Pump Blocked or pressure switch empty not reached
- Check efficiency of J9 connector on card, verifying a voltage of 220V between pins 8 and 9
- Check that pump if being fed
- Check Pump Filter + wall drain
- Change Pump
- Replace Card

F06: No on AVD and AVL

F07: No Wash Heating Element Absorption (the fault is only signalled with the pressure switch on empty)
- Check efficiency of J3 connector contacts on card
- Check continuity of the wash heating element on J3 connector pins 5 and 6. The 1800W 230V heating element has a resistance of 25 ohm.
- Check connection of pressure switch J3 connector pins 2 and 3: there must not be ohmic continuity (shared with full load).
Check connection of pressure switch J3 connector pins 2 and 4: there must be ohmic continuity
- Replace Heating Element
- Replace Pressure Switch
- Replace Card

F08: Wash Heater Relay Stuck (signalled in presence of empty) or pressure switch stuck on Full (simultaneously empty and full)
- Check efficiency of J3 connector contacts on card
- Check pressure switch status by checking ohmic continuity on wiring connector J3 pins 2 and 4 (it must only be present with tub empty), pins 2 and 3 (it must only be present with water in the drum) and
pins 2 and 1 (it must only be present with water in the tub above normal level, more than halfway up door glass).
- Check wiring J3/pressure switch
- Check connection of heating element J3 connector pins 5 and 6.
- Replace pressure switch
- Replace Card

F09: Machine Setup Error (Eeprom error)

- In case of production card with Eeprom soldered: replace the card and Eeprom
- In case of replacement of Eeprom and card, check correct housing of Eeprom on card socket

F10: No full and empty signal
- Check efficiency of J3 connector contacts on card
- Check pressure switch status by checking ohmic continuity on wiring connector J3 pins 2 and 4 (it must only be present with tub empty), pins 2 and 3 (it must only be present with water in the drum) and
pins 2 and 1 (it must only be present with water in the tub above normal level, more than halfway up door glass).
- Check wiring of connector J3/Pressure switch
- Replace Pressure Switch
- Replace Card

F11: No Pump Feedback (Drain pump disconnected or winding broken)
- Check efficiency of J9 connector on card
- Check continuity of the Pump on J15 connector pins 1 and 2 (in case of washing-machine with Easy Door door lock) or on J9 connector pins 8 and 9 (in case of conventional door lock), checking a resistive value equal to 170 ohm.
- Check wiring of connector J15 (or J9)/Pump
- Replace Pump
- Replace Card

F12: No Communication Display/LED Card-Main Board
- Check efficiency of contacts on card of J11 connector
- Check the continuity of J11 connector-display card 5-pin connector
- Replace Main Board
- Replace Display Card/LED

F13: Drying NTC sensor open / Drying system NTC wiring disconnected
Check efficiency of J10 connector on card
Check NTC on J10 connector pins 7 and 8 verifying that the ohmic value of the sensor at room temperature 20°C is approx. 20Kohm
Check continuity of NTC/J10 connectors wiring
Replace NTC
Replace card

F14: Drying heater open or not connected
Check efficiency of J2 connector contacts on card
Check continuity of drying heater on J2 wiring connector pins 1 and 2, verifying that the ohmic value of the 1300W 230V heating element is approx. 40Kohm
Check wiring of connector J10/drying heater
Replace heating element
Replace card

F15: Drying heater always on (drying relay contact stuck or drying Triac short circuit)
Check efficiency of J2 connector contacts on card of
Check wiring of connector J2/drying heater
Check wiring of connector J3/pressure switch
Replace card

F16: Drum locking (top-loading only)

F17: Door lock unfed/open (with Easy Door)
- Check presence of 230V mains power on J4 wiring connector inserted on card between pins 3 and 4,
(not present with machine on standby) and presence of power from 230V door lock between pins 3 and 5
- Check ohmic continuity of the door microswitch on J4 connector inserted on card between pins 1 and 2 (with door closed/on open/off)
- Check continuity of J4/door lock wiring
- Check door hooking

- Replace door lock
- Replace card

F17: Door lock unfed/open (conventional door lock, not Easy Door)
- Check presence of 230V mains power on J4 wiring connector inserted on card between pins 2 and 3,
(not present with machine on standby) and presence of power from 230V door lock between pins 3 and 1
- Check door hooking
- Replace door lock
- Replace card

F18 --> Communication error microprocessor / DSP (Digital Signal Processor)
- Replace card

COMBINAZIONE LED

SIMBOLOGIA:
= LED ACCESO = LED SPENTO

FAULT	LED Fasi	TASTI FUNZIONI			
F01	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F02	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F03	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F04	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F05	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F06	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F07	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F08	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F09	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F10	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F11	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F12	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F13	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F14	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F15	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F16	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F17	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F18	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4




ARISTON



INDESIT


FIG. 01

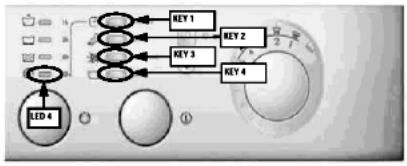

Fault	Key 1	Key 2	Key 3	Key 4	Led 4
01	Off	Off	Off	Flash	Off
02	Off	Off	Flash	Off	Off
03	Off	Off	Flash	Flash	Off
04	Off	Flash	Off	Off	Off
05	Off	Flash	Off	Flash	Off
06	Off	Flash	Flash	Off	Off
07	Off	Flash	Flash	Flash	Off
08	Flash	Off	Off	Off	Off
09	Flash	Off	Off	Flash	Off
10	Flash	Off	Flash	Off	Off
11	Flash	Off	Flash	Flash	Off
12	Flash	Flash	Off	Off	Off
13	Flash	Flash	Off	Flash	Off
14	Flash	Flash	Flash	Off	Off
15	Flash	Flash	Flash	Flash	Off
16	Off	Off	Off	Off	Flash
17	Off	Off	Off	Flash	Flash

Table Fault LED

FIG. 02

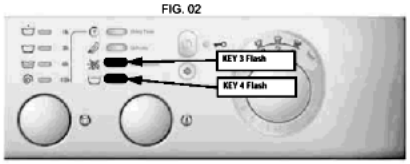

Example Fault F03

Tabla de averías para lavadora EVO II



FAULT	CAUSA	COMBINACIÓN LED: LED Fase	TECLAS FUNCIONES			
F01	Triac control motor en corto	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F02	Motor bloqueado, taquímetro motor abierto / en corto	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F03	Sonda NTC lavado abierta / en corto	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F04	Vacío + sobrenivel presostato simultaneamente	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F05	No se logra vacío presostato bomba desagua bloqueada	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F06	Error de selector (no encuentra código)	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F07	Falta absorción en la resistencia de lavado	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F08	Relé resistencia de lavado con el contacto NA/NC pegado	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F09	Error umap file (EEPROM no programada o correcta)	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F10	Presostato en Rotor+Vacio o sin salial de vacio ni lleno	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F11	Falta alimentación a la bomba de desague	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F12	Falta comunicación entre módulo display y modulo de control	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F13	Sonda NTC secado abierta/corto. Ventilador secado bloqueado	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F14	Falta alimentación a la resistencia de secado	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F15	Contacto relé resistencia de secado pegado	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F16	Bloqueo de cesto (sobe carga superior)	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F17	Bloqueo puerta desalineado /abierto	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F18	Error de comunicación Micro/DSP (MODULO)	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4


– LED

SIMBOLOGIA:

– led encendido

– led apagado


ABB. 01

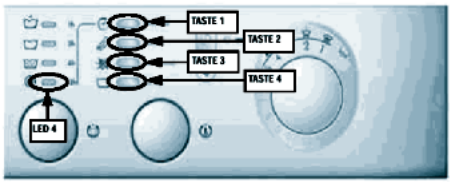

Fault	Taste 1	Taste 2	Taste 3	Taste 4	Led 4
01	Ausgeschaltet	Ausgeschaltet	Ausgeschaltet	Blinkt	Ausgeschaltet
02	Ausgeschaltet	Ausgeschaltet	Blinkt	Ausgeschaltet	Ausgeschaltet
03	Ausgeschaltet	Ausgeschaltet	Blinkt	Blinkt	Ausgeschaltet
04	Ausgeschaltet	Blinkt	Ausgeschaltet	Ausgeschaltet	Ausgeschaltet
05	Ausgeschaltet	Blinkt	Ausgeschaltet	Blinkt	Ausgeschaltet
06	Ausgeschaltet	Blinkt	Blinkt	Ausgeschaltet	Ausgeschaltet
07	Ausgeschaltet	Blinkt	Blinkt	Blinkt	Ausgeschaltet
08	Blinkt	Ausgeschaltet	Ausgeschaltet	Ausgeschaltet	Ausgeschaltet
09	Blinkt	Ausgeschaltet	Ausgeschaltet	Blinkt	Ausgeschaltet
10	Blinkt	Ausgeschaltet	Blinkt	Ausgeschaltet	Ausgeschaltet
11	Blinkt	Ausgeschaltet	Blinkt	Blinkt	Ausgeschaltet
12	Blinkt	Blinkt	Ausgeschaltet	Ausgeschaltet	Ausgeschaltet
13	Blinkt	Blinkt	Ausgeschaltet	Blinkt	Ausgeschaltet
14	Blinkt	Blinkt	Blinkt	Ausgeschaltet	Ausgeschaltet
15	Blinkt	Blinkt	Blinkt	Blinkt	Ausgeschaltet
16	Ausgeschaltet	Ausgeschaltet	Ausgeschaltet	Ausgeschaltet	Blinkt
17	Ausgeschaltet	Ausgeschaltet	Ausgeschaltet	Blinkt	Blinkt


Tab. Störung Led

ABB. 02

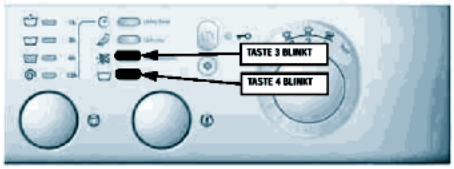

Beispiel Störung F03


FIG. 01

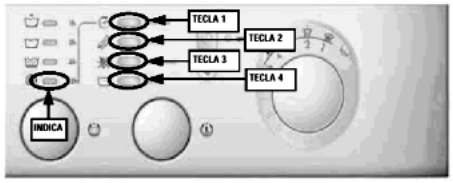

Fault	Tecla 1	Tecla 2	Tecla 3	Tecla 4	Indicador luminoso 4
01	Apagado	Apagado	Apagado	Pisca	Apagado
02	Apagado	Apagado	Pisca	Apagado	Apagado
03	Apagado	Apagado	Pisca	Pisca	Apagado
04	Apagado	Pisca	Apagado	Apagado	Apagado
05	Apagado	Pisca	Apagado	Pisca	Apagado
06	Apagado	Pisca	Pisca	Apagado	Apagado
07	Apagado	Pisca	Pisca	Pisca	Apagado
08	Pisca	Apagado	Apagado	Apagado	Apagado
09	Pisca	Apagado	Apagado	Pisca	Apagado
10	Pisca	Apagado	Pisca	Apagado	Apagado
11	Pisca	Apagado	Pisca	Pisca	Apagado
12	Pisca	Pisca	Apagado	Apagado	Apagado
13	Pisca	Pisca	Apagado	Pisca	Apagado
14	Pisca	Pisca	Pisca	Apagado	Apagado
15	Pisca	Pisca	Pisca	Pisca	Apagado
16	Apagado	Apagado	Apagado	Apagado	Pisca
17	Apagado	Apagado	Apagado	Pisca	Pisca

Tab. Fault indicador luminoso

FIG. 02

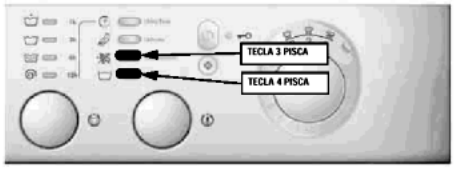

Exemplo Fault F03

n1040319: Elimination of metal bar on INDESIT cabinets.


From serial no. 40223.0001 Indesit EVOII Washing Machines produced in the Comunanza - Brembate factory have been equipped with a wooden reinforcing strip on the top, whereas the metal bar on the cabinet has been eliminated.



Cruscotto - Tableau de borde - Belde - Control panel
Painel frontal - Quadro Mandos - Kontrol paneli

The modified tops have the same Service code as premodification items (096937, 097617, 098440, 099929 and 097806).
When using the new top on a premodification appliance the metal bar (see N1040319FIG1) must be removed, whereas the old top can be used in place of the new one without any modification.
The new top can be used in place of the old one and vice versa; the Service code remains the same.

N1040319FIG1

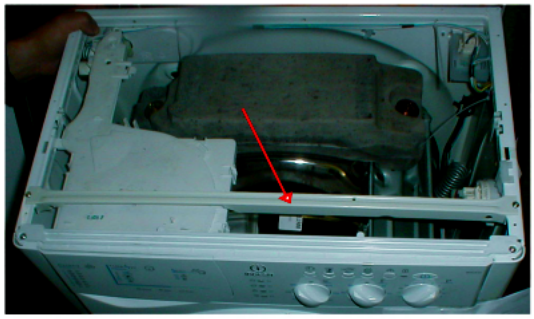


n1040325: New shock absorber fixing system with pin

From serial no. 40427.0001, shock absorbers have been fixed to the tank unit cradle with two 11 mm pins code C00110163 (see fig. 01 and 02 enclosed) in place of the 8 mm screws code 093750 and relevant locking nuts code 030443, on all washing machines and dryers produced in the Comunanza factory.
The items affected by this modification are:
1) The cradles have the same Service code, as they can be used in place of the new ones after widening the shock absorber fixing holes to a diameter of 10 mm.
Code 093848 - Tank unit cradle 46 lt
Code 093878 - Tank unit cradle 40 lt.

2) The new shock absorbers, with fixing bushing having no s/steel spacer, are not managed as they are interchangeable with the premodified items (make sure they are CIMA type, as the managed items), fixed with M8 screws code 093750 and related locking nut code 030443 (see figs. 05 and 06).
Code 093884 - Shock absorber 80 N
Code 093885 - Shock absorber 100 N

To remove the shock absorber from the tank, first extract the pin with a few hammer taps (see fig.03) until it is aligned with the tank bracket and then pull it out with a pair of pliers (see fig. 04).
(To refit the shock absorber use a new pin. Insert the pin until the toroidal edge is aligned with the bracket.)

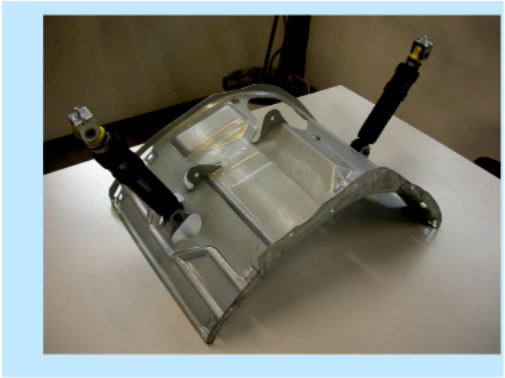









n1040326: Two-bearing mechanism on Slim range washing machines

---

From serial no. 40428.0001, all Slim range models produced in the Comunanza factory have been equipped with a two-bearing mechanism in place of the single-bearing one.




The Service codes of the new mechanism are:
Service code C00096186 - SEAL RING CV4;
Service code C00002591 - BEARING 20X47X14 6204 SKF;
Service code C00013563 - BEARING 25 X52 X 15 6205 - 2Z SKF;
Service code C00110340 - CROSS WITH SEAL RING (2C) SNELLA;
Service code C00094289 - EVO 40L TANK SLIM (1-C) > (2-C)EVOII;
Service code C00094290 - OUTER- SET 40 L.(1-C)>(2-C)EVOII;
Service code C00064527 - DRIVEN PULLEY CONE D=280 MM H= 17MM;
Service code C00066080 - DRIVEN PULLEY CONE D= 210 MM H=17 MM.

The tank assembly with the new two-bearing cross has the same Service code as the single-bearing one (C00094289); the latter will be available until stocks run out.
When replacing the tank, make sure that the value H (17 mm or 25 mm) of the basket cross shaft corresponds to the value H of the pulley (see Fig.001).

The following premodified items will continue to be used:
Service code C00026298 - BEARING BA2B 633667 30X60.03X37;
Service code C00039667 - SEAL RING;
Service code C00074137 - CROSS WITH SEAL RING;
Service code C00081875 - DRIVEN PULLEY D=280MM H=25MM;
Service code C00074138 - DRIVEN PULLEY D = 210MM H=25MM;
Service code C00026299 - SEEGER RING SB 60X1,5.

n1040334: INDESIT Led and Digit modules with side connector.

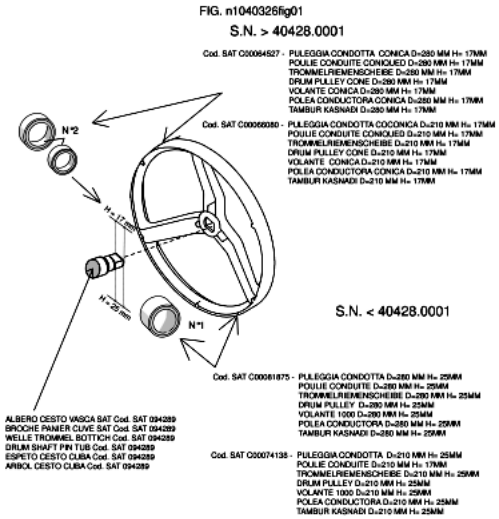

From serial no. 40802.0001, WIL and WISE models produced in the Teverola factory are gradually being equipped with LED and DIGIT modules with connector on the side instead of on the top, near the microprocessor.

The new modules are:
C00143085 - LED MODULE ASSEMBLY 2 KNOBS WITH CONNECTOR EDG IND.EVOII;
C00143332 - LED MODULE ASSEMBLY 3 KNOBS WITH CONNECTOR EDG IND.EVOII;
C00143086 - DIGIT MODULE ASSEMBLY WITH CONNECTOR EDG IND.EVOII.

Premodified modules C00096997, C00096998 and C00096999 will continue to be available until stocks run out, after which they will be interchangeable with the new modules that will be provided with a specific wiring to enable interchangeability (C00114634).

Brembate (cod.ind 91...) - s/n 40802.0001
Comunanza (cod.ind. 80...) - s/n 40818.0001
Teverola (cod.ind 46...) - s/n 40824.0001

WIDE126DE cod. comm. 31982 Matr. 40818.0001;
WIDE127UK cod. comm. 30563 Matr. 40818.0001;
WIDL102UK cod. comm. 30536 Matr. 40818.0001;
WIDL102UK cod. comm. 30536 Matr. 40818.0001;
WIDL106AUS cod. comm. 32305 Matr. 40906.0001;
WIDL106EX cod. comm. 31966 Matr. 40818.0001;
WIDL126DE cod. comm. 31980 Matr. 40818.0001;
WIDL126EX cod. comm. 30570 Matr. 40818.0001;
WIDL126FR cod. comm. 30534 Matr. 40818.0001;
WIDL126SDE cod.comm.31981 Matr.40818.0001;
WIDL126SEX cod.comm.31983 Matr.40818.0001;
WIDL126SUK cod.comm.30599 Matr.40818.0001;
WIDL126UK cod. comm. 30538 Matr. 40818.0001;
WIDL146DE cod.comm. 31979 Matr.40818.0001;
WIDL146EX cod.comm. 30573 Matr.40818.0001;

WIDL146UK cod.comm. 30567 Matr.40818.0001;
WIDL86EX cod.comm. 31965 Matr.40818.0001;
WIE107EX cod. comm. 30548 Matr. 40910.0001 ;
WIE107IT cod. comm. 30222 Matr. 40927.0001;
WIE107XSEX cod. comm. 30549 Matr. 40818.0001;
WIE127EX cod. comm. 30551 Matr. 40910.0001 ;
WIE127UK cod. comm. 30028 Matr. 40906.0001 ;
WIE127XEX cod. comm. 30552 Matr. 40818.0001;
WIE127XSEX cod. comm. 30550 Matr. 40818.0001;
WIE127SDE cod. comm. 30468 Matr. 40818.0001;
WIE137SUK cod. comm. 30202 Matr. 40818.0001;
WIE147DE cod. comm. 30478 Matr. 40818.0001;
WIE147UK cod. comm. 33625 Matr. 40805.0001;
WIE147XEX cod. comm. 30554 Matr. 40818.0001;
WIE148NL cod. comm. 30450 Matr. 40818.0001;
WIE157SUK cod. comm. 30203 Matr. 40818.0001;
WIE167DE cod. comm. 30480 Matr. 40818.0001;
WIE167UK cod. comm. 30204 Matr. 40818.0001;
WIE168NL cod. comm. 30451 Matr. 40818.0001;
WIL101TK cod. comm. 30492 Matr. 40824.0001;
WIL105DE cod. comm. 30455 Matr. 40908.0001;
WIL105EU cod. comm. 30233 Matr. 40825.0001;
WIL105EX cod.comm.30356 Matr. 40802.0001;
WIL105SEX cod.comm.31072 Matr. 40818.0001;
WIL105XEX cod. comm. 30539 Matr. 40818.0001;
WIL106IT cod. comm. 30144 Matr. 40824.0001;
WIL106IT cod. comm. 30144 Matr. 40824.0001;
WIL12FR cod. comm.30001 Matr. 40903.0001;
WIL125DE cod. comm. 30459 Matr. 40904.0001;
WIL125EX cod. comm. 30540 Matr. 40903.0001 ;
WIL126NL cod. comm. 30443 Matr. 40903.0001;
WIL123SUK cod. comm. 30199 Matr. 40818.0001;
WIL133UKTE cod. comm. 33624 Matr. 40908.0001;
WIL14FR cod. comm. 30140 Matr. 40818.0001;
WIL143DE cod.comm.32252 Matr. 40802.0001;
WIL143SUK comm.30200 Matr. 408180001;
WIL145CH cod. comm. 30463 Matr. 40818.0001;
WIL145DE cod. comm. 30463 Matr. 40818.0001;
WIL145DETE cod. comm. 33178 Matr. 40915.0001;
WIL145EU cod.comm.33622 Matr. 40802.0001;
WIL145XEX cod. comm. 30542 Matr. 40818.0001;
WIL146NLTE cod.comm.32540 Matr. 40802.0001;
WIL146NL cod.comm.30448 Matr. 40818.0001;
WIL153UK cod.comm.30020 Matr. 40818.0001;
WIL162DE cod. comm. 30466 Matr. 40818.0001;
WIL163DE cod. comm. 32253 Matr. 40818.0001;
WIL163SUK cod. comm. 30201 Matr. 40904.0001;
WIL165DE cod. comm. 30465 Matr. 40818.0001;
WIL165XEX cod. comm. 30543 Matr. 40818.0001;
WIL166NL cod. comm. 30449 Matr. 40818.0001;
WIL62EX cod. comm. 30526 Matr. 40806.0001;
WIL62XEX cod. comm. 30527 Matr. 40818.0001;
WIL66IT cod. comm. 30146 Matr. 40806.0001;
WIL81TK cod.comm.30490 Matr. 40802.0001;
WIL85EX cod. comm. 30354 Matr. 40909.0001 ;
WIL85XEX cod. comm. 30539 Matr. 40818.0001;
WIL85XSEX cod. comm. 30530 Matr. 40818.0001;

WIL86IT cod.comm.30145 Matr. 40803.0001;
WIL95EX cod. comm. 31546 Matr. 40818.0001;
WIL95KW cod. comm. 30535 Matr. 40806.0001;
WILM64IT cod. comm. 30235 Matr. 40914.0001;
WISE107IT cod. comm. 30232 Matr. 40818.0001;
WISE107PL cod. comm. 30569 Matr. 40818.0001;
WISE107SEX cod. comm. 30441 Matr. 40818.0001;
WISE107XEX cod. comm. 30571 Matr. 40818.0001;
WISE127XEX cod. comm. 30574 Matr. 40818.0001;
WISE87PL cod. comm. 30568 Matr. 40818.0001;
WISL10FR cod. comm. 30141 Matr. 40818.0001;
WISL105PL cod. comm. 30557 Matr. 40818.0001;
WISL105XEX cod. comm. 30566 Matr. 40818.0001;
WISL125XEX cod. comm. 30560 Matr. 40818.0001;
WISL62XEX cod. comm. 30555 Matr. 40818.0001;
WISL65PL cod. comm. 30556 Matr. 40818.0001;
WISL66IT cod. comm. 30142 Matr. 40818.0001;
WISL85PL cod. comm.30562 Matr. 40818.0001;
WISL86IT cod. comm. 30085 Matr. 40804.0001;
WISL85XEX cod. comm. 30564 Matr. 40818.0001;

n1040359: Polar White Factory 80 (Comunanza)

From serial no. 50315.0001, the new "Polar White" colour is used on all washing machines and washer-dryers produced in factory 80 in place of White 27.
The third last number of the Industrial Code given on the rating plate of the modified models is 9 (e.g. 80286390900).
To determine the new Polar White codes, it is necessary to know the industrial code or serial number of the appliance being repaired.
The new items, which bear the initials "PW" in place of "B27", are not aesthetically interchangeable with premodification items as the whites are different. Both colours will be available for some time.
The items affected by this modification are:
Body, rear panel, top, control panel, handles, buttons, knobs, knob disc, door and plinth.


n1040376: Drain pump with filter with pin.

A new drain pump with filter with pin has been introduced progressively as from serial no. 50609.0001.

New parts:
C00119307 - Drain pump with pin filter;
C00141034 - Askoll / Plaset drain pump with pin filter kit (figure 001);

Premodification parts:
C00092264 - Drain pump;
C00045027 - Askoll / Plaset pump filter kit (figure 001);

The new parts can be used on all WASHING MACHINES previously equipped with the premodification parts.

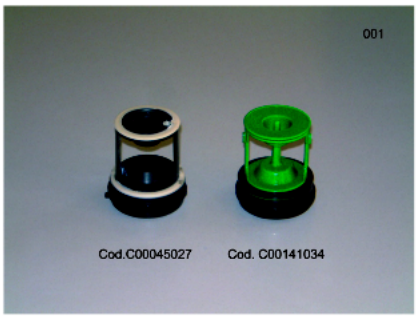

n4008c01: Smart Card - LVB/DRYERS

Beginning April 2008 spare parts warehouse started to manage the EVOII modules with eeprom fixed, these can only be programmed with smart card/palmare/pc.

Attention!! The premodification with eeprom socket can be programmed with smart card/palmare/pc using a blank eeprom or with pre programmed eeprom.

Spare parts of modules with eeprom fixed/eeprom socket:

C00265676 with eeprom fixed - C00143068 with eeprom socket - for models with conducibility sensor
C00254298 with eeprom fixed - C00143068 with eeprom socket - for models without conducibility sensor
C00254297 with eeprom fixed - C00259941 with eeprom socket
C00254531 with eeprom fixed - C00143058 with eeprom socket
C00254297 with eeprom fixed - C00143057 with eeprom socket - for models without blocking drum
C00265697 with eeprom fixed - C00143057 with eeprom socket - for models with blocking drum
C00254297 with eeprom fixed - C00143056 with eeprom socket
C00254530 with eeprom fixed - C00259738 with eeprom socket
C00254533 with eeprom fixed - C00143060 with eeprom socket
C00254535 with eeprom fixed - C00145013 with eeprom socket
C00254530 with eeprom fixed - C00145551 with eeprom socket
C00254529 with eeprom fixed - C00142293 with eeprom socket


C00257406 with eeprom fixed - C00143989 with eeprom socket
C00257409 with eeprom fixed - C00144151 with eeprom fixed
C00254530 with eeprom fixed - C00143069 with eeprom fixed

DRYERS
C00255835 with eeprom fixed - C00258789 with eeprom socket
C00255835 with eeprom fixed - C00194077 with eeprom socket


This notice has a "reference list" specific for each product where you can find the link between smart card and the eeprom code with the same software.

Electric schemes and links


Cod. 16001628301

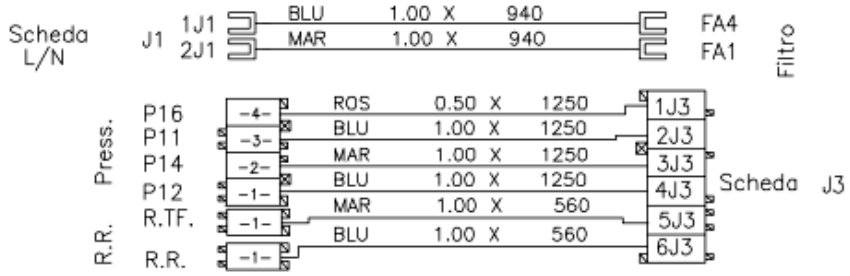


COMPLESSIVO A




COMPLESSIVO D1 MICRORITARDATORE

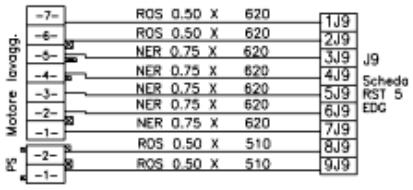

COMPLESSIVO L MOTORE + POMPA

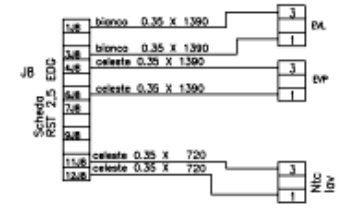

COMPLESSIVO C1 EVL + EVP



COMPLESSIVO X TERRA STANDARD



COMPLESSIVO B1 COMUNICAZIONE DISPLAY


16001628301 / 16001632202 / 16001723700

Legend

Legend: 16001628301

Electric schemes and links

Cod. 21500759100

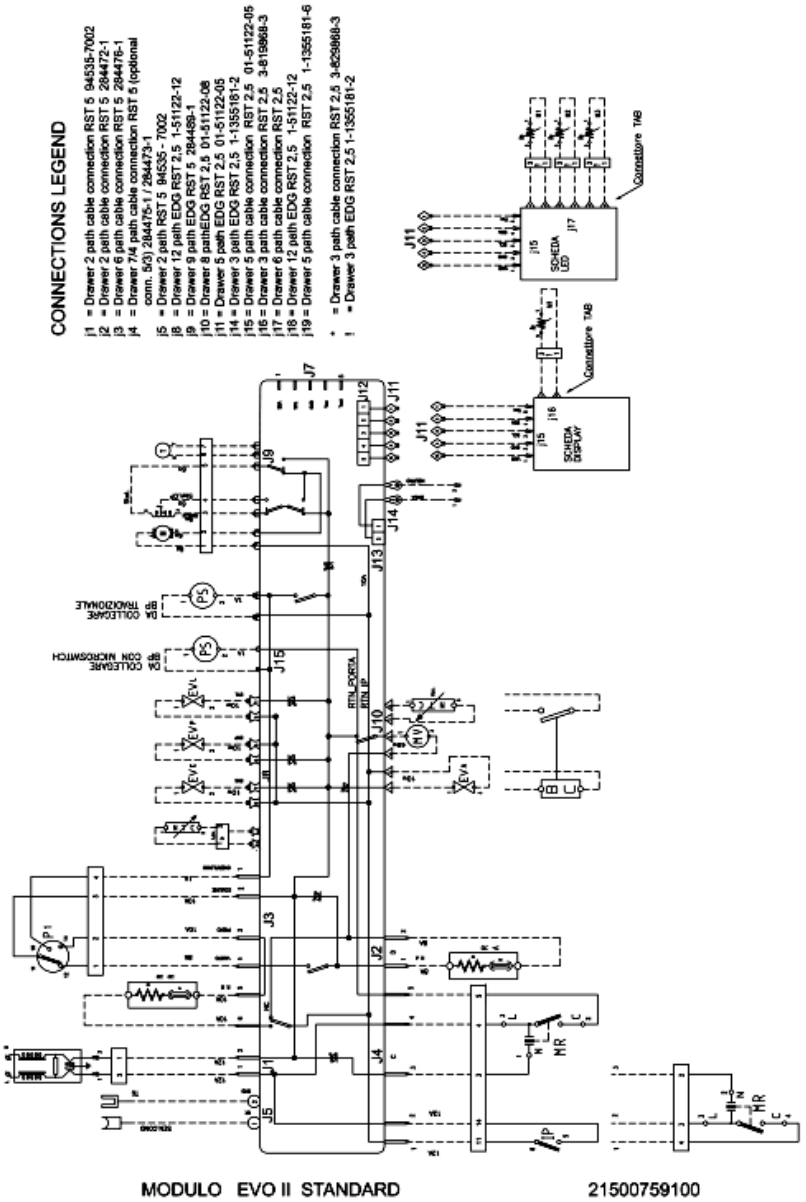

Legend

Legend: 21500759100