
INDESIT company

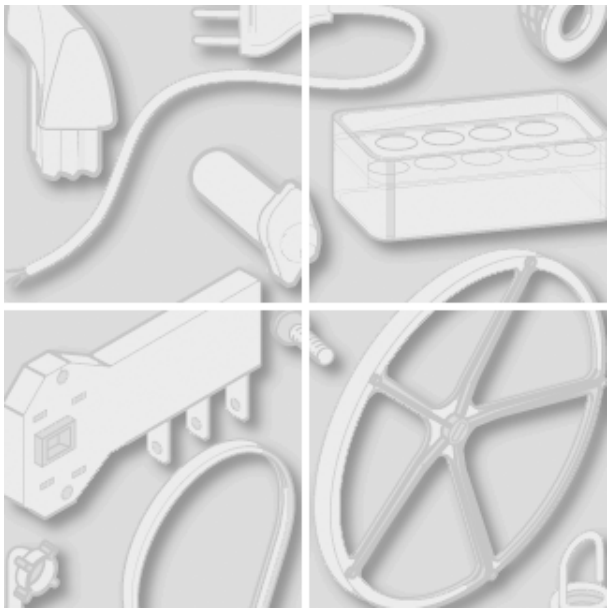

Model type:
WIL125EX

Commercial code:
F030540

General notes

Technical Documentation guidelines

You can find herewith some generic information to simplify cunsulting of technical documentation:

1. Models of same range share the same exploded views, which report the richest set of spare parts:generally, a model does not necessarly have a related spare part for each particular shown on exploded views.

2. Some spare parts can not be represented directly on the exploded views (instruction booklets, specific kit, etc...). You can find those codes in the spare parts list with the same reference of particular where spares are installed or with references 099, 999. Instruction booklets, once managed, appear with 000 reference.

3. On the higher right site of each exploded view there is a serial number which indicates the beginning of the production of certain range:some models might have more than an exploded view for a given category, each distinguished by a different serial no.and linked to another spare parts list, In this case, serial no. is required to supply the right spare part code. Exploded view to be considered is the one with a more recent serial no. but previous than the one of the model that needs assistance.

4.Exploded views might require further updates even after publishing. Addition of new spares will go on following the already existing numeration references. Revision number of an exploded view is shown into last four digits of serial number into upper right hand corner.

5.The spare parts list associated to an exploded view shows related codes of spares managed for a certain model; for each spare part other informations are available:

REF: reference no of spare into a table; SUBSTITUTE: list of spare(s) which can replace a code but that keeps same functional characteristics


INDUSTRIAL CODE: list of variables of a model (shown into model label) where such spare is used; NOTICE: code of information(s) to refer to complete technical intervention, track for changes or to find correct spare part code.

6. Some notices, into a same section are generic therefore cannot be directly linked to a spare part. In order to assist a model in the best way as possible, it is helpful to pay attention to all notices and constantly verify documentation updates


7.Technical documentation cover shows model name and its commercial codes

1140960 Exploded views


The new wiring when fitted, must be securely attacched to the machine wiring with insulating tape. **Matr. 61116.0001**



WIRING P = DRUM BLOCK COD. C00141995

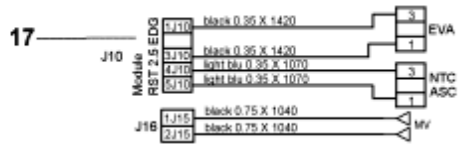


WIRING F = EVA+NTCAS / WIRING G = MTV COD. C00141769




WIRING P = DRUM BLOCK COD. C00112822




WIRING B2 = DISPLAY CONNECTION COD. C00111227

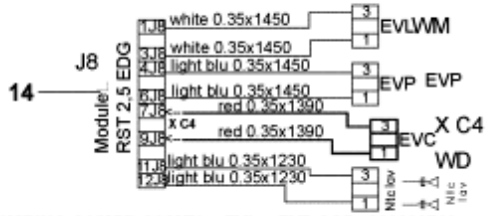


WIRING C1(WM) C3(WD) = EVL + EVP COD. C00093713
WIRING C4 (WD) = EVL + EVP + EVC COD. C00109950




WIRING D = INTERLOCK. + MICRO SWITCH COD. C00093714




WIRING D1 = INTERLOCK. COD. C00093715




WIRING H = DRYING ELEMENT COD. C00093716

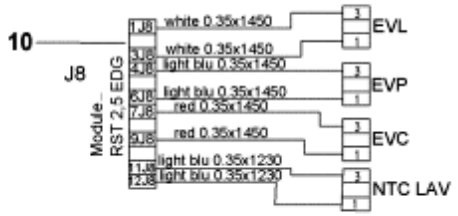


WIRING C = EVL + EVP + EVC COD. C00093724

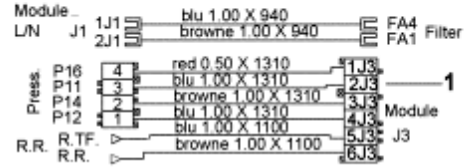


WIRING A COD.C00141139 (ex C00093722)

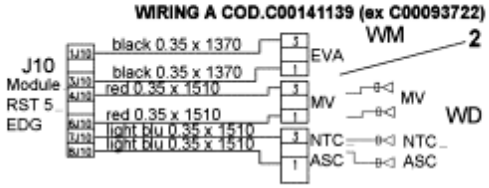


WIRING F = EVA + MV + NTCAS COD.C00093717

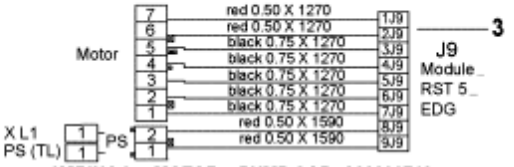


WIRING L = MOTOR + PUMP COD. C00093718
WIRING L1 (TL) = MOTOR + PUMP COD. C00195340




WIRING I = CONDUCTIVITI SENSOR COD. C00093725

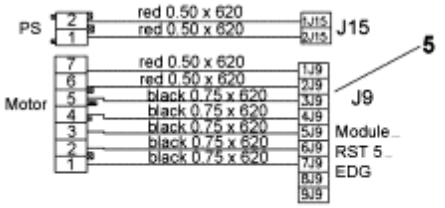


WIRING N = MOTOR + PUMP COD. C00093719



WIRING X = EART STD MACCHINE COD. C00093720



WIRING Y = EART TRI-PHASE MACCHINE COD. C00093721



WIRING B1 = MAIN-DISPLAY CONNECTION COD. C00093726



WIRING B = SELECTION CONNECTION COD. C00093723


1140960

1140960 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
001	C00141139				wiring		
005	C00093719				wiring pump-motor-module		
007	C00093721				wiring earth triphase		
008	C00093726				wiring display		
013	C00093714				wiring door lock-module j4		
014	C00093713				wiring ntc-evl+evp-module j8		

1180160 Exploded views

Matr. 30901.0002

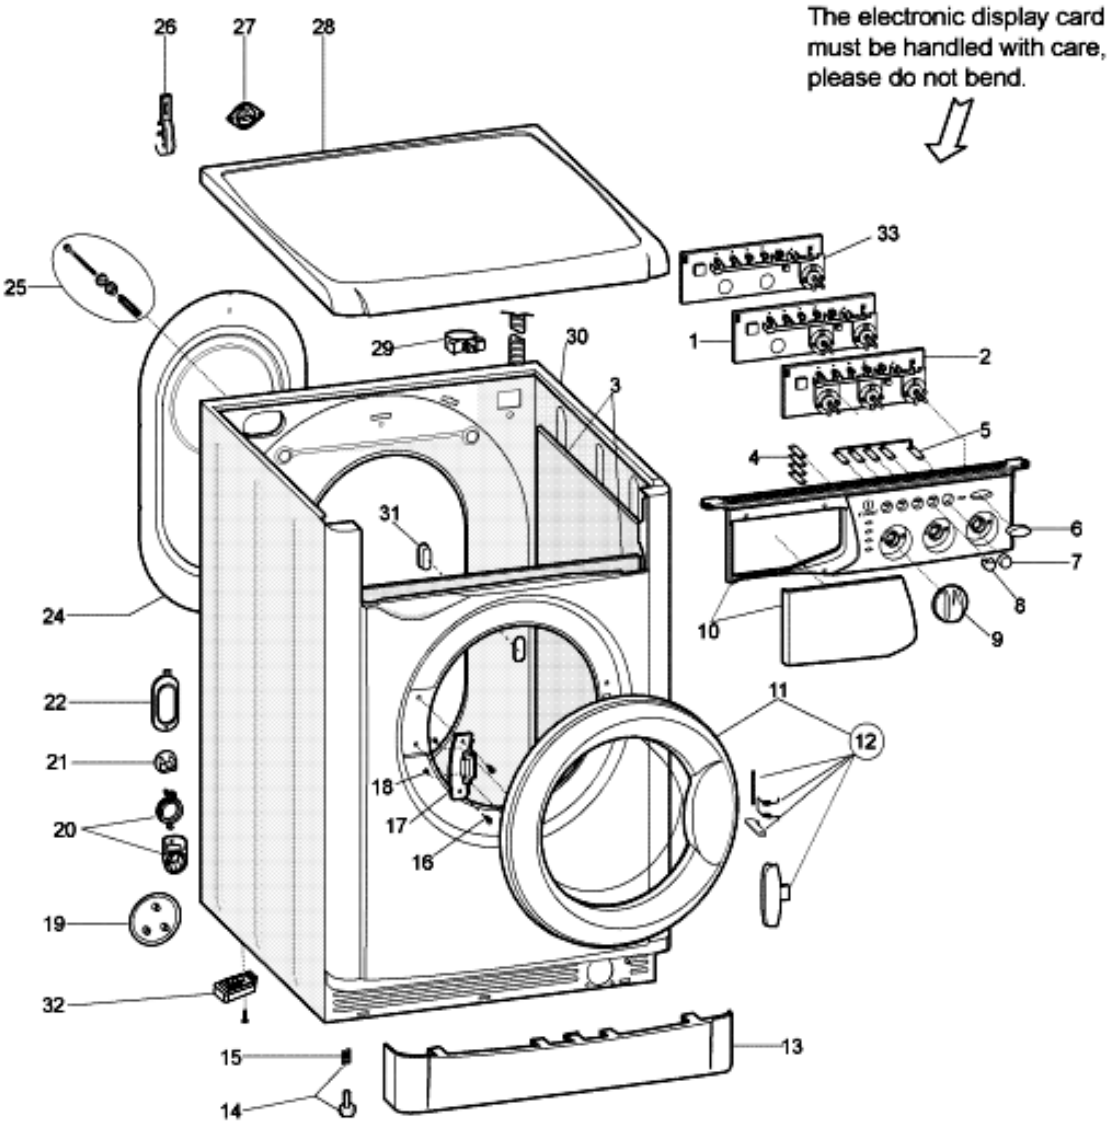

1180160


1180160 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
000	C00099794				user instructions book es-pt-gb-de-		
000	C00099795				user instructions sv-fi-dk-no-ro-hu		
000	C00099796				user instructions rs-cz-sk-hr-ar-sl		
002	C00096998			1 x C00111959 1 x C00114634	control card led 3 knobs ind.evoii	n1040334	
002	C00143332				control card (3 x control knobs)		
004	C00097012				pilot lamp lens vertical evoii		
005	C00097011			1 x C00203127	pilot lamp lens horizontals		
006	C00096932				on/off push button white	n1040356	46305400000
006	C00116243				pushbutton b pw on/off		46305400900 46305400902
007	C00096933				push button white	n1040356	46305400000
007	C00116245				push button white		46305400900 46305400902
008	C00096935				pushbutton white 27 ind.evoii	n1040356	46305400000
008	C00116244				pushbutton white pw ind.evoii		46305400900 46305400902
009	C00096857			1 x C00115924	components knob white 27 ind.	n1040356	46305400000
009	C00115924				knob white		46305400900 46305400902
010	C00099800			1 x C00116483	control panel + handle wil125	n1040356	46305400000
010	C00116483				control panel + handle pw wil125		46305400900 46305400902
011	C00096860			1 x C00115842	door frame b27 and glass assy	n1040356	46305400000
011	C00115842				door frame & glass assy		46305400900 46305400902
012	C00096865				door handle kit		
013	C00096855			1 x C00115813	plinth white ind. tev. evoii	n1040356	46305400000
013	C00115813				plinth white		46305400900 46305400902
014	C00143730			1 x C00264036	foot m8 h=2,9 cm rohs thread 8	n4007j00	
015	C00059869				spring for foot d =11 mm h = 21		
016	C00096210				screw self tapping		
017	C00075325			2 x C00096210 1 x C00255430	hinge door 3.5 mm indesit		

1180160 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
018	C00065185				bolt m4,5 x 8		
019	C00089803				blanking plug d = 53 mm		
020	C00064755				drain hose collar		
021	C00089804				blanking plug		
024	C00046924				rear cover white	n1040356	46305400000
024	C00115812				rear panel white pw		46305400900
							46305400902
025	C00077411				transit bolts kit (1 screw + 1		
027	C00083796				cap for electrovalve		
028	C00096859			1 x C00115814	worktop - white ind.tev. evoii	n1040356	46305400000
028	C00115814				worktop - white		46305400900
							46305400902
029	C00046667				wiring stop		
029	C00064550				drain hose holder		
030	C00096852			1 x C00115811	cabinet white evo ii tev ind.	n1040356	46305400000
030	C00285207				cabinet white pw indesit (1 hole)		46305400900
							46305400902
031	C00084817				blanking plate-rear(test plug)		
032	C00254045				back foot - rear h= 10 mm	n4007j00	

1180250 Exploded views

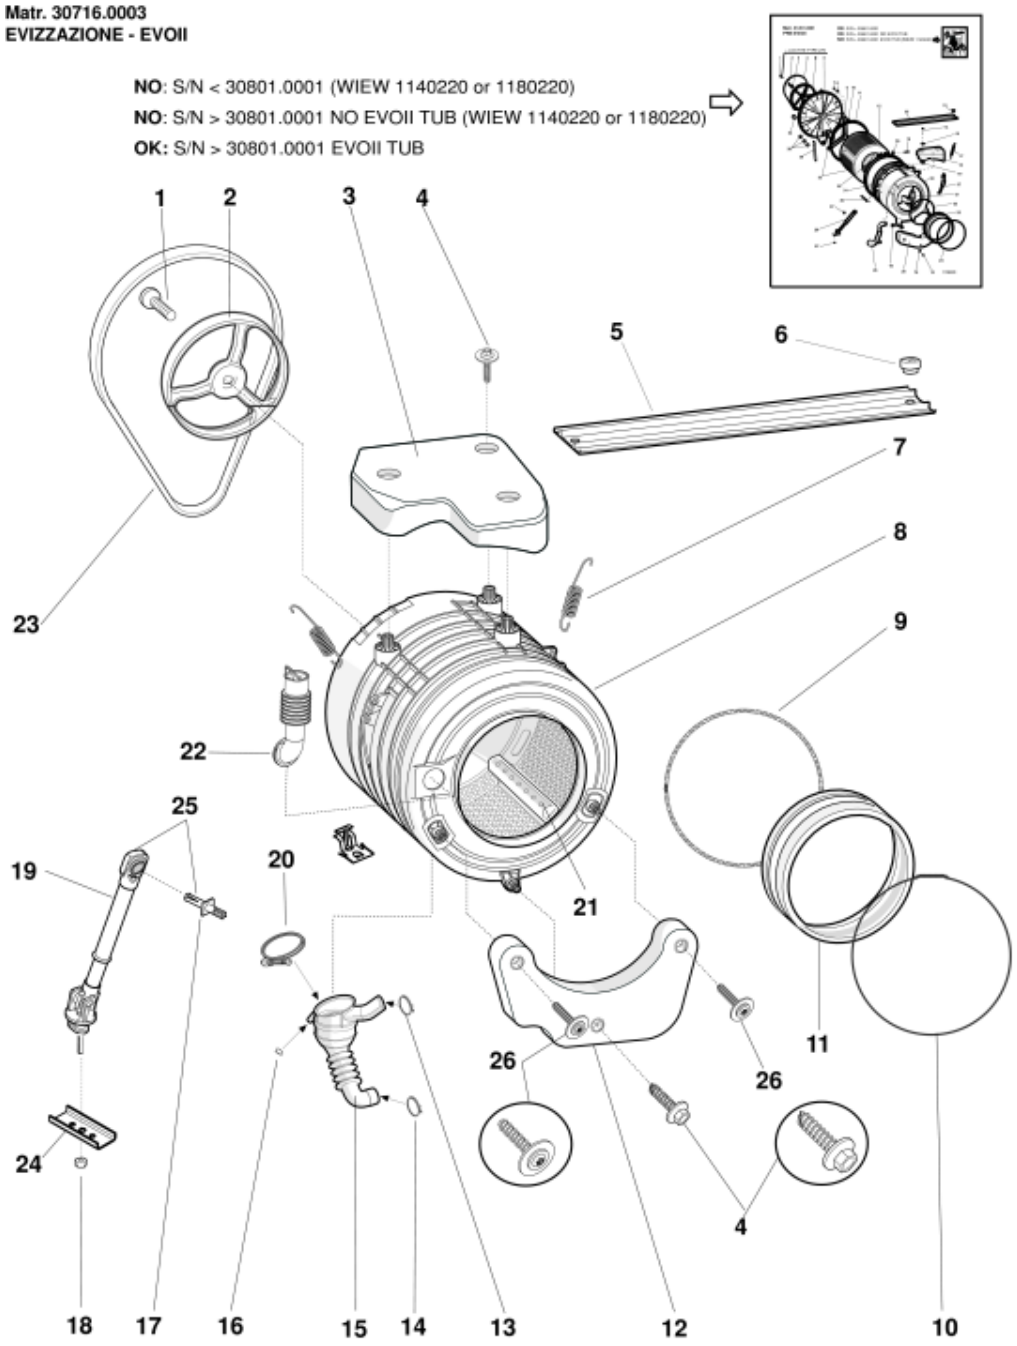


1180250 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
001	C00064786			1 x C00143260	bolt m8x23 torx tefl		
002	C00066080				drum pulley cone d=210 mm h=	n1040335	46305400000
							46305400900
002	C00074211				drum pulley d=210 mm h=20 mm	n1040327	46305400000
						n1040386	46305400900
002	C00097269				drum pulley d=280 mm h=20 mm		46305400902
							46305401002
003	C00094710				top ballance weight 15kg		
004	C00094741			1 x C00118612	screw locking counterweight/tub		
004	C00194611				screw.pl28 9.5x50 tmtfr t40	n4011c00	
005	C00055397				tank cradle channel top		
006	C00047133				spring support top white 1 per pick		
007	C00096195				suspension spring		
008	C00096198				tank plastic 46l+pul d280		
009	C00092155				door seal- rear retainer		
010	C00092156				door seal retainer front		
011	C00092154		41231...		door seal		
011	C00111416	50101...			door seal (30cm) (hl)		
012	C00094711				front ballance weight 9,4kg		
013	C00008612				tube clamp 34,6-36,4		
014	C00092411			1 x C00094908	hose clamp		
015	C00092174				hose tank to filter with oko ball		
017	C00055037				plastic expansion rivet	n1040372	
017	C00118593			1 x C00280757	plastic expansion peg		46305400000
							46305400900
018	C00065152				nut romob m6x22x1,5		
019	C00097259			1 x C00140744	shock absorber 100 n	n1040372	
020	C00094908				hose clamp		
021	C00065463				lifter 40 - 46l		
022	C00066183				hose dispenser to tank		
023	C00082812				belt 1061h8 (hl)	n1040386	46305400000
							46305400900
023	C00141664				belt 1205j5/1208j5		46305400902
							46305401002
024	C00110233				cabinet plate		

1180250 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
025	C00140744				shock absorber 100 n kit		46305400000
							46305400900
026	C00194612				screw larger diameter 11.3x50 kit	n4011c00	
099	C00001109				loctite 270 10 gr.		
099	C00033026			1 x C00292523	ambljgon grease ta 100 gr.		

1180330 Exploded views

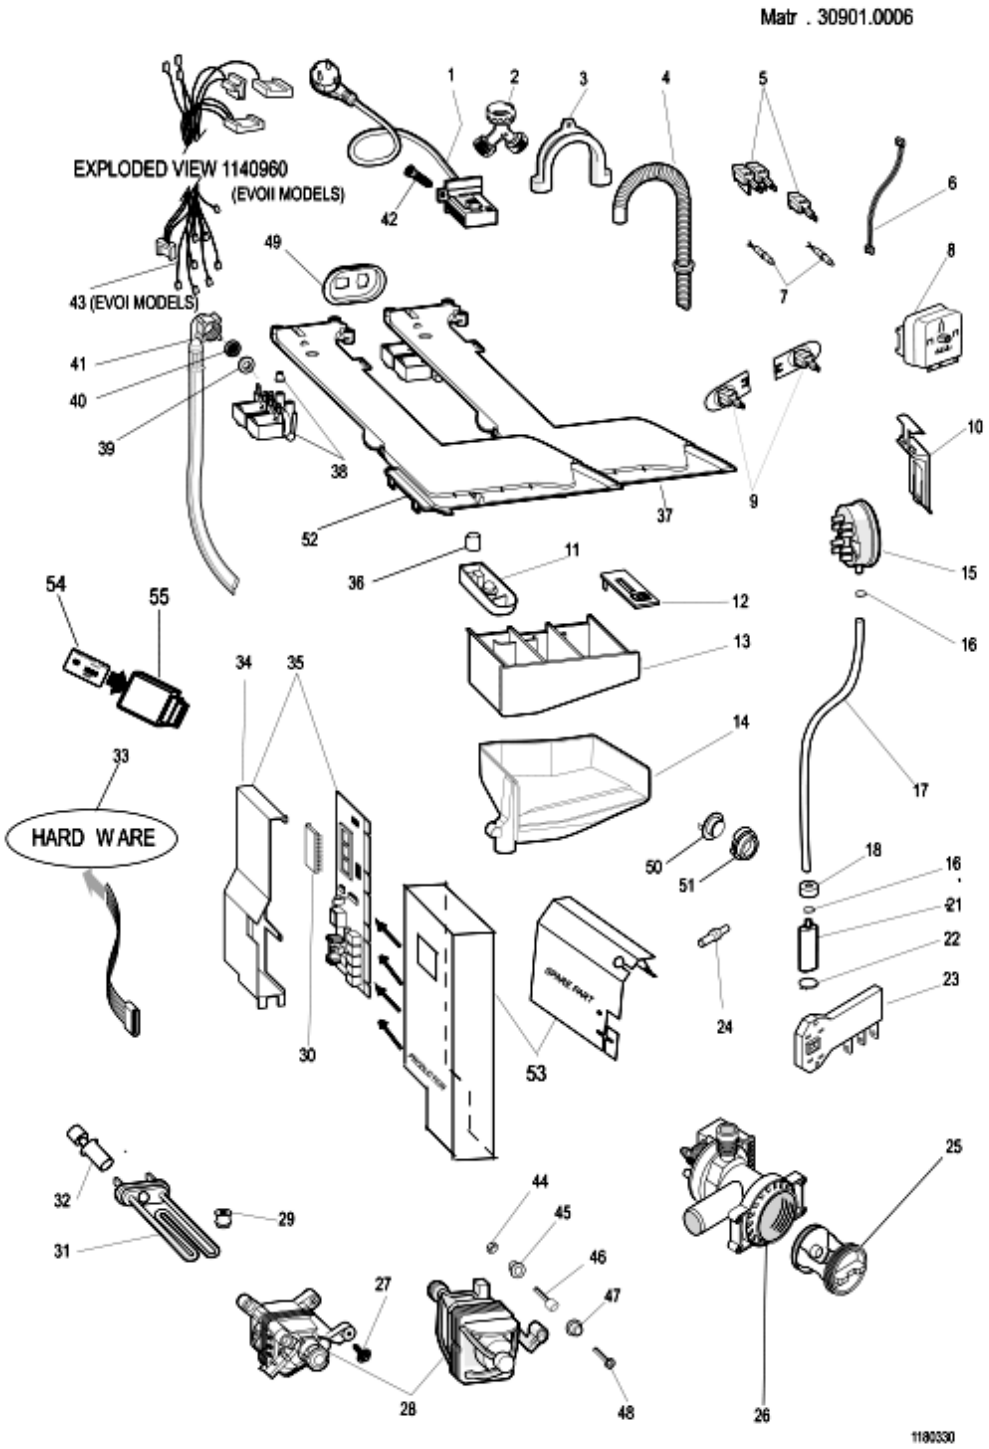

1180330 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
001	C00091633				supply cable 3x1 schuko		
003	C00019902				plastic -u- to make drain hose		
004	C00027466				drain hose - to sink l=1860mm		
010	C00050186				bracket - pressure switch		
011	C00075459				additive container		
012	C00047069			1 x C00097834	additive cover		
013	C00097732				soap dispenser drawer		
014	C00099206				dispenser body		
015	C00096880				pressure switch (hl)		
016	C00092412				hose clamp		
017	C00094746				pipe pressostat l=505		
018	C00019755				anti-vibration bush (foam)		
021	C00092173				air trap x oko		
022	C00008612				tube clamp 34,6-36,4		
023	C00065185				bolt m4,5 x 8		
023	C00085194				door interlock		
026	C00085618			1 x C00119307	self cleaning pump 240v./50hz.idc		
027	C00094744				screw locking motor/tub		
028	C00094185				motor 1200 r.p.m./min. 2040m3	n1040386	46305400000 46305400900
028	C00097255			1 x C00196543	brush motor ceset 6170 a0946		
028	C00097256				tacho generator for motor ceset		
028	C00141663				motor 1200 r.p.m./min. p52 evo2		46305400902 46305401002
028	C00145001			1 x C00196554	carbon brush motor ceset eame		
028	C00145003			1 x C00115310	tacho generator motor eame 6170		
028	C00296122				carbon brush motor imep l94mf7		
029	C00058523				pillar retainer-heating element		
031	C00094715				heating element 1700w		
032	C00083915				thermistor ntc		
033	C00066292				insulated tweezers		
033	C00084943			1 x C00099862	serial cable lb2000 - pc	n1040317	
033	C00095669			1 x C00145046	hardware key mk1	n1040317	
034	C00091908				bracket for module st		
034	C00091909				support cover		

1180330 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
035	C00254297				power board module evoii (rhos)	n4008c01	
036	C00046157				stopper detergent container		
037	C00096877			2 x C00064534	hopper cover 1e 2u ind.evoii tev		
				1 x C00110333			
				1 x C00115294			
038	C00064534				seal - dispenser to valve		
038	C00110333				fill valve 2 way (7lt rst 2.5)		
039	C00005572				sealing washer-mains inlet hose		
040	C00005781				inlet hose filter		
041	C00003070				mains inlet hose cold 25c 10bar		
042	C00092348				self-scraping screw 3,5x8		
044	C00040932				self locking nut m6		
054	C00260522				card wil125ex evoii 8kb s/w	n4008c01	
055	C00263927			1 x C00272306	smart card reader		

Notices

n1040242: Power card with welded eeprom.

From serial number 20304.0001, IDC power card with welded eeprom is used to ensure the perfect connection of all parts, in the Comunanza, Teverola and Brembate factories.
To replace the module with welded eeprom, it will be necessary to use the eeprom indicated in the SAT document of the model concerned.
To replace the module on a unit with welded eeprom both the SAT module and the eeprom are required, because the latter cannot be reused.

n1040296: List of EVOII FAULTS and troubleshooting.

In case of washing-machine fault in carrying out the self-test function, the machine reproposes the fault previously signalled and the same fault is shown on the display of the new hardware key.
The type of fault can be signalled in different ways:
- on AVD models the fault is shown directly on the machine display.
- on AVL models the fault is signalled by LEDs.

Reading of Faults signalled by LEDs
When the machine has a fault:
1. The window is locked
2. The door lock light flashes fast (> 1 Hz)
3. The control panel LEDs light up, to signal the fault, according to the table (fig. 01).
The example shown in fig. 02 (Example Fault F03) below indicates which LEDs are flashing if the machine has Fault F03

List of faults, malfunctions and Warnings:

F01: Triac Motor short circuit
- Check for water leaks that may affect connector J9 causing the relevant contacts to short
- Check the motor terminal block (possible problems due to chemical effects of work residuals on the contacts which may cause short-circuiting)
- Replace Card

F02: Motor blocked, Tachometrics in Short Circuit/Open
- Check motor if blocked

- Check efficiency of J9 connector on card
- Check the tachometric winding verifying an ohmic resistance reading of 115 - 170 ohm between pins
1 and 2 on wiring connector J9. In case of short circuit/open circuit check the wiring between pins 1 and 2 of J9 relevant to the tachometrics. With three-phase motor, make sure there is ohmic continuity between J9 pins 6 and 7.
- Replace motor
- Replace card

F03: NTC Open or in Short Circuit or washing heater relay stuck (signalled in presence of full load)
- Check efficiency of J8 connector contacts on card
- Check NTC verifying that the ohmic resistance value at room temperature 20°C is approx. 20Kohm on J8 wiring connector pin 11 and 12.
- If the measurement is incorrect check J8/NTC wiring continuity
Check the same parameter directly on NTC
- Replace NTC
- Replace Card

F04: Simultaneous empty and overflow (pressure switch stuck on empty).
If the pressure switch contact is stuck on empty the washing-machine loads water until reaching the overflow. The drain pump is automatically started by the contact on the overflow pressure switch.
- Check efficiency of J3 connector contacts on card
- Check pressure switch status by checking ohmic continuity on wiring connector J3 pins 2 and 4 (it must only be present with tub empty), pins 2 and 3 (it must only be present with water in the drum) and pins 2 and 1 (it must only be present with water in the tub above normal level, more than halfway up door glass).
- Check wiring of connector J3/pressure switch
- Replace pressure switch
- Replace card.

F05: Pump Blocked or pressure switch empty not reached
- Check efficiency of J9 connector on card, verifying a voltage of 220V between pins 8 and 9
- Check that pump if being fed
- Check Pump Filter + wall drain
- Change Pump
- Replace Card

F06: No on AVD and AVL

F07: No Wash Heating Element Absorption (the fault is only signalled with the pressure switch on empty)
- Check efficiency of J3 connector contacts on card
- Check continuity of the wash heating element on J3 connector pins 5 and 6. The 1800W 230V heating element has a resistance of 25 ohm.
- Check connection of pressure switch J3 connector pins 2 and 3: there must not be ohmic continuity (shared with full load).
Check connection of pressure switch J3 connector pins 2 and 4: there must be ohmic continuity
- Replace Heating Element
- Replace Pressure Switch
- Replace Card

F08: Wash Heater Relay Stuck (signalled in presence of empty) or pressure switch stuck on Full (simultaneously empty and full)
- Check efficiency of J3 connector contacts on card
- Check pressure switch status by checking ohmic continuity on wiring connector J3 pins 2 and 4 (it must only be present with tub empty), pins 2 and 3 (it must only be present with water in the drum) and
pins 2 and 1 (it must only be present with water in the tub above normal level, more than halfway up door glass).
- Check wiring J3/pressure switch
- Check connection of heating element J3 connector pins 5 and 6.
- Replace pressure switch
- Replace Card

F09: Machine Setup Error (Eeprom error)

- In case of production card with Eeprom soldered: replace the card and Eeprom
- In case of replacement of Eeprom and card, check correct housing of Eeprom on card socket

F10: No full and empty signal
- Check efficiency of J3 connector contacts on card
- Check pressure switch status by checking ohmic continuity on wiring connector J3 pins 2 and 4 (it must only be present with tub empty), pins 2 and 3 (it must only be present with water in the drum) and
pins 2 and 1 (it must only be present with water in the tub above normal level, more than halfway up door glass).
- Check wiring of connector J3/Pressure switch
- Replace Pressure Switch
- Replace Card

F11: No Pump Feedback (Drain pump disconnected or winding broken)
- Check efficiency of J9 connector on card
- Check continuity of the Pump on J15 connector pins 1 and 2 (in case of washing-machine with Easy Door door lock) or on J9 connector pins 8 and 9 (in case of conventional door lock), checking a resistive value equal to 170 ohm.
- Check wiring of connector J15 (or J9)/Pump
- Replace Pump
- Replace Card

F12: No Communication Display/LED Card-Main Board
- Check efficiency of contacts on card of J11 connector
- Check the continuity of J11 connector-display card 5-pin connector
- Replace Main Board
- Replace Display Card/LED

F13: Drying NTC sensor open / Drying system NTC wiring disconnected
Check efficiency of J10 connector on card
Check NTC on J10 connector pins 7 and 8 verifying that the ohmic value of the sensor at room temperature 20°C is approx. 20Kohm
Check continuity of NTC/J10 connectors wiring
Replace NTC
Replace card

F14: Drying heater open or not connected
Check efficiency of J2 connector contacts on card
Check continuity of drying heater on J2 wiring connector pins 1 and 2, verifying that the ohmic value of the 1300W 230V heating element is approx. 40Kohm
Check wiring of connector J10/drying heater
Replace heating element
Replace card

F15: Drying heater always on (drying relay contact stuck or drying Triac short circuit)
Check efficiency of J2 connector contacts on card of
Check wiring of connector J2/drying heater
Check wiring of connector J3/pressure switch
Replace card

F16: Drum locking (top-loading only)

F17: Door lock unfed/open (with Easy Door)
- Check presence of 230V mains power on J4 wiring connector inserted on card between pins 3 and 4,
(not present with machine on standby) and presence of power from 230V door lock between pins 3 and 5
- Check ohmic continuity of the door microswitch on J4 connector inserted on card between pins 1 and 2 (with door closed/on open/off)
- Check continuity of J4/door lock wiring
- Check door hooking

- Replace door lock
- Replace card

F17: Door lock unfed/open (conventional door lock, not Easy Door)
- Check presence of 230V mains power on J4 wiring connector inserted on card between pins 2 and 3,
(not present with machine on standby) and presence of power from 230V door lock between pins 3 and 1
- Check door hooking
- Replace door lock
- Replace card

F18 --> Communication error microprocessor / DSP (Digital Signal Processor)
- Replace card

COMBINAZIONE LED


SIMBOLOGIA:
= LED ACCESO = LED SPENTO

FAULT	LED Fasi	TASTI FUNZIONI			
F01	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F02	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F03	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F04	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F05	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F06	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F07	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F08	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F09	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F10	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F11	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F12	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F13	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F14	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F15	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F16	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F17	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4
F18	LED 4	Tasto 1	Tasto 2	Tasto 3	Tasto 4



ARISTON INDESIT


FIG. 01

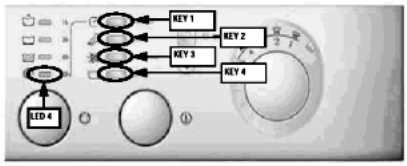

Fault	Key 1	Key 2	Key 3	Key 4	Led 4
01	Off	Off	Off	Flash	Off
02	Off	Off	Flash	Off	Off
03	Off	Off	Flash	Flash	Off
04	Off	Flash	Off	Off	Off
05	Off	Flash	Off	Flash	Off
06	Off	Flash	Flash	Off	Off
07	Off	Flash	Flash	Flash	Off
08	Flash	Off	Off	Off	Off
09	Flash	Off	Off	Flash	Off
10	Flash	Off	Flash	Off	Off
11	Flash	Off	Flash	Flash	Off
12	Flash	Flash	Off	Off	Off
13	Flash	Flash	Off	Flash	Off
14	Flash	Flash	Flash	Off	Off
15	Flash	Flash	Flash	Flash	Off
16	Off	Off	Off	Off	Flash
17	Off	Off	Off	Flash	Flash

Table Fault LED

FIG. 02

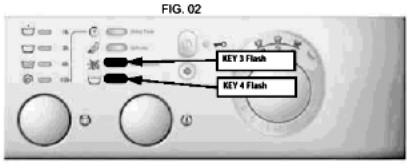

Example Fault F03

Tabla de averías para lavadora EVO II



	CO	MBINACIÓN LED				
FAULT	CAU SA	LED Fase	TECLAS FUNCIONES			
F01	Triac control motor en corto	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F02	Motor bloqueado, taquimetro motor abierto / en corto	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F03	Sonda NTC lavado abierta / en corto	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F04	Vacio + sobrenivel presostato simultaneamente	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F05	No se logra vacio presostato bomba desagua bloqueada	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F06	Error de selector (no encuentra código)	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F07	Falta absorción en la resistencia de lavado	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F08	Relé resistencia de lavado con el contacto NA/NC pegado	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F09	Error umap file (EEPROM no programada o correcta)	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F10	Presostato en Rotor+Vacio o sin señal de vacio ni lleno	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F11	Falta alimentación a la bomba de desague	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F12	Falta comunicación entre módulo display y modulo de control	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F13	Sonda NTC secado abierta/corto. Ventilador secado bloqueado	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F14	Falta alimentación a la resistencia de secado	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F15	Contacto relé resistencia de secado pegado	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F16	Bloqueo de cesto (sobe carga superior)	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F17	Bloqueo puerto desalineado /abierto	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4
F18	Error de comunicación Micro/DSP (MODULO)	LED 4	Tecla 1	Tecla 2	Tecla 3	Tecla 4


– LED

SIMBOLOGIA:

– led encendido

– led apagado


ABB. 01

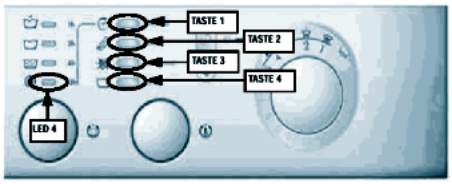

Fault	Taste 1	Taste 2	Taste 3	Taste 4	Led 4
01	Ausgeschaltet	Ausgeschaltet	Ausgeschaltet	Blinkt	Ausgeschaltet
02	Ausgeschaltet	Ausgeschaltet	Blinkt	Ausgeschaltet	Ausgeschaltet
03	Ausgeschaltet	Ausgeschaltet	Blinkt	Blinkt	Ausgeschaltet
04	Ausgeschaltet	Blinkt	Ausgeschaltet	Ausgeschaltet	Ausgeschaltet
05	Ausgeschaltet	Blinkt	Ausgeschaltet	Blinkt	Ausgeschaltet
06	Ausgeschaltet	Blinkt	Blinkt	Ausgeschaltet	Ausgeschaltet
07	Ausgeschaltet	Blinkt	Blinkt	Blinkt	Ausgeschaltet
08	Blinkt	Ausgeschaltet	Ausgeschaltet	Ausgeschaltet	Ausgeschaltet
09	Blinkt	Ausgeschaltet	Ausgeschaltet	Blinkt	Ausgeschaltet
10	Blinkt	Ausgeschaltet	Blinkt	Ausgeschaltet	Ausgeschaltet
11	Blinkt	Ausgeschaltet	Blinkt	Blinkt	Ausgeschaltet
12	Blinkt	Blinkt	Ausgeschaltet	Ausgeschaltet	Ausgeschaltet
13	Blinkt	Blinkt	Ausgeschaltet	Blinkt	Ausgeschaltet
14	Blinkt	Blinkt	Blinkt	Ausgeschaltet	Ausgeschaltet
15	Blinkt	Blinkt	Blinkt	Blinkt	Ausgeschaltet
16	Ausgeschaltet	Ausgeschaltet	Ausgeschaltet	Ausgeschaltet	Blinkt
17	Ausgeschaltet	Ausgeschaltet	Ausgeschaltet	Blinkt	Blinkt


Tab. Störung Led

ABB. 02

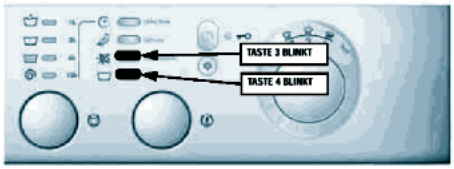

Beispiel Störung F03


FIG. 01

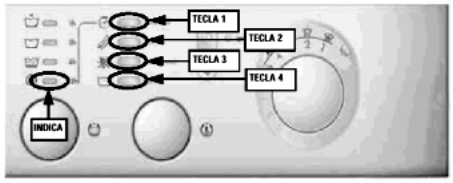

Fault	Tecla 1	Tecla 2	Tecla 3	Tecla 4	Indicador luminoso 4
01	Apagado	Apagado	Apagado	Pisca	Apagado
02	Apagado	Apagado	Pisca	Apagado	Apagado
03	Apagado	Apagado	Pisca	Pisca	Apagado
04	Apagado	Pisca	Apagado	Apagado	Apagado
05	Apagado	Pisca	Apagado	Pisca	Apagado
06	Apagado	Pisca	Pisca	Apagado	Apagado
07	Apagado	Pisca	Pisca	Pisca	Apagado
08	Pisca	Apagado	Apagado	Apagado	Apagado
09	Pisca	Apagado	Apagado	Pisca	Apagado
10	Pisca	Apagado	Pisca	Apagado	Apagado
11	Pisca	Apagado	Pisca	Pisca	Apagado
12	Pisca	Pisca	Apagado	Apagado	Apagado
13	Pisca	Pisca	Apagado	Pisca	Apagado
14	Pisca	Pisca	Pisca	Apagado	Apagado
15	Pisca	Pisca	Pisca	Pisca	Apagado
16	Apagado	Apagado	Apagado	Apagado	Pisca
17	Apagado	Apagado	Apagado	Pisca	Pisca

Tab. Fault indicador luminoso

FIG. 02

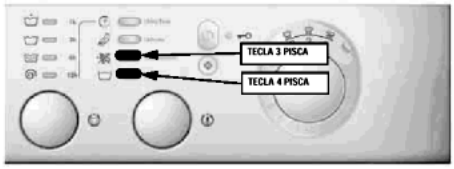

Exemplo Fault F03

n1040327: Modification of basket cross on Teverola 1200 rpm Washing machines.

From serial no. 40504.0001, all 1200 rpm washing machines produced in the Teverola factory have been equipped with a basket cross having a H 17 mm shaft in place of H 20 mm.



Cruscotto - Tableau de borde - Belde - Control panel
Painel frontal - Quadro Mandos - Kontrol paneli

The modification has involved using a new pulley (code C00066080), which has the same outer diameter as the previous one (210 mm), but a different central fixing hole (H 17 mm in place of H 20 mm).

n1040334: INDESIT Led and Digit modules with side connector.

From serial no. 40802.0001, WIL and WISE models produced in the Teverola factory are gradually being equipped with LED and DIGIT modules with connector on the side instead of on the top, near the microprocessor.

The new modules are:
C00143085 - LED MODULE ASSEMBLY 2 KNOBS WITH CONNECTOR EDG IND.EVOII;
C00143332 - LED MODULE ASSEMBLY 3 KNOBS WITH CONNECTOR EDG IND.EVOII;
C00143086 - DIGIT MODULE ASSEMBLY WITH CONNECTOR EDG IND.EVOII.

Premodified modules C00096997, C00096998 and C00096999 will continue to be available until stocks run out, after which they will be interchangeable with the new modules that will be provided with a specific wiring to enable interchangeability (C00114634).

Brembate (cod.ind 91...) - s/n 40802.0001
Comunanza (cod.ind. 80...) - s/n 40818.0001
Teverola (cod.ind 46...) - s/n 40824.0001

WIDE126DE cod. comm. 31982 Matr. 40818.0001;
WIDE127UK cod. comm. 30563 Matr. 40818.0001;
WIDL102UK cod. comm. 30536 Matr. 40818.0001;
WIDL102UK cod. comm. 30536 Matr. 40818.0001;
WIDL106AUS cod. comm. 32305 Matr. 40906.0001;
WIDL106EX cod. comm. 31966 Matr. 40818.0001;

WIDL126DE cod. comm. 31980 Matr. 40818.0001;
WIDL126EX cod. comm. 30570 Matr. 40818.0001;
WIDL126FR cod. comm. 30534 Matr. 40818.0001;
WIDL126SDE cod.comm.31981 Matr.40818.0001;
WIDL126SEX cod.comm.31983 Matr.40818.0001;
WIDL126SUK cod.comm.30599 Matr.40818.0001;
WIDL126UK cod. comm. 30538 Matr. 40818.0001;
WIDL146DE cod.comm. 31979 Matr.40818.0001;
WIDL146EX cod.comm. 30573 Matr.40818.0001;
WIDL146UK cod.comm. 30567 Matr.40818.0001;
WIDL86EX cod.comm. 31965 Matr.40818.0001;
WIE107EX cod. comm. 30548 Matr. 40910.0001 ;
WIE107IT cod. comm. 30222 Matr. 40927.0001;
WIE107XSEX cod. comm. 30549 Matr. 40818.0001;
WIE127EX cod. comm. 30551 Matr. 40910.0001 ;
WIE127UK cod. comm. 30028 Matr. 40906.0001 ;
WIE127XEX cod. comm. 30552 Matr. 40818.0001;
WIE127XSEX cod. comm. 30550 Matr. 40818.0001;
WIE127SDE cod. comm. 30468 Matr. 40818.0001;
WIE137SUK cod. comm. 30202 Matr. 40818.0001;
WIE147DE cod. comm. 30478 Matr. 40818.0001;
WIE147UK cod. comm. 33625 Matr. 40805.0001;
WIE147XEX cod. comm. 30554 Matr. 40818.0001;
WIE148NL cod. comm. 30450 Matr. 40818.0001;
WIE157SUK cod. comm. 30203 Matr. 40818.0001;
WIE167DE cod. comm. 30480 Matr. 40818.0001;
WIE167UK cod. comm. 30204 Matr. 40818.0001;
WIE168NL cod. comm. 30451 Matr. 40818.0001;
WIL101TK cod. comm. 30492 Matr. 40824.0001;
WIL105DE cod. comm. 30455 Matr. 40908.0001;
WIL105EU cod. comm. 30233 Matr. 40825.0001;
WIL105EX cod.comm.30356 Matr. 40802.0001;
WIL105SEX cod.comm.31072 Matr. 40818.0001;
WIL105XEX cod. comm. 30539 Matr. 40818.0001;
WIL106IT cod. comm. 30144 Matr. 40824.0001;
WIL106IT cod. comm. 30144 Matr. 40824.0001;
WIL12FR cod. comm.30001 Matr. 40903.0001;
WIL125DE cod. comm. 30459 Matr. 40904.0001;
WIL125EX cod. comm. 30540 Matr. 40903.0001 ;
WIL126NL cod. comm. 30443 Matr. 40903.0001;
WIL123SUK cod. comm. 30199 Matr. 40818.0001;
WIL133UKTE cod. comm. 33624 Matr. 40908.0001;
WIL14FR cod. comm. 30140 Matr. 40818.0001;
WIL143DE cod.comm.32252 Matr. 40802.0001;
WIL143SUK comm.30200 Matr. 408180001;
WIL145CH cod. comm. 30463 Matr. 40818.0001;
WIL145DE cod. comm. 30463 Matr. 40818.0001;
WIL145DETE cod. comm. 33178 Matr. 40915.0001;
WIL145EU cod.comm.33622 Matr. 40802.0001;
WIL145XEX cod. comm. 30542 Matr. 40818.0001;
WIL146NLTE cod.comm.32540 Matr. 40802.0001;
WIL146NL cod.comm.30448 Matr. 40818.0001;
WIL153UK cod.comm.30020 Matr. 40818.0001;
WIL162DE cod. comm. 30466 Matr. 40818.0001;
WIL163DE cod. comm. 32253 Matr. 40818.0001;
WIL163SUK cod. comm. 30201 Matr. 40904.0001;
WIL165DE cod. comm. 30465 Matr. 40818.0001;

WIL165XEX cod. comm. 30543 Matr. 40818.0001;
WIL166NL cod. comm. 30449 Matr. 40818.0001;
WIL62EX cod. comm. 30526 Matr. 40806.0001;
WIL62XEX cod. comm. 30527 Matr. 40818.0001;
WIL66IT cod. comm. 30146 Matr. 40806.0001;
WIL81TK cod.comm.30490 Matr. 40802.0001;
WIL85EX cod. comm. 30354 Matr. 40909.0001 ;
WIL85XEX cod. comm. 30539 Matr. 40818.0001;
WIL85XSEX cod. comm. 30530 Matr. 40818.0001;
WIL86IT cod.comm.30145 Matr. 40803.0001;
WIL95EX cod. comm. 31546 Matr. 40818.0001;
WIL95KW cod. comm. 30535 Matr. 40806.0001;
WILM64IT cod. comm. 30235 Matr. 40914.0001;
WISE107IT cod. comm. 30232 Matr. 40818.0001;
WISE107PL cod. comm. 30569 Matr. 40818.0001;
WISE107SEX cod. comm. 30441 Matr. 40818.0001;
WISE107XEX cod. comm. 30571 Matr. 40818.0001;
WISE127XEX cod. comm. 30574 Matr. 40818.0001;
WISE87PL cod. comm. 30568 Matr. 40818.0001;
WISL10FR cod. comm. 30141 Matr. 40818.0001;
WISL105PL cod. comm. 30557 Matr. 40818.0001;
WISL105XEX cod. comm. 30566 Matr. 40818.0001;
WISL125XEX cod. comm. 30560 Matr. 40818.0001;
WISL62XEX cod. comm. 30555 Matr. 40818.0001;
WISL65PL cod. comm. 30556 Matr. 40818.0001;
WISL66IT cod. comm. 30142 Matr. 40818.0001;
WISL85PL cod. comm.30562 Matr. 40818.0001;
WISL86IT cod. comm. 30085 Matr. 40804.0001;
WISL85XEX cod. comm. 30564 Matr. 40818.0001;

n1040335: Modification of basket cross on Teverola 1200 rpm Washing.

From serial no. 40831.0001, all 1200 rpm washing machines produced in the Teverola factory have been equipped with a basket cross having a H 20 mm shaft in place of H 17 mm.
The modification has involved using a new pulley (code C00074211), which has the same outer diameter as the previous one (210 mm), but a different central fixing hole (H 20 mm in place of H 17 mm).

n1040356: Polar White Factory 46 (Teverola)

From serial no. 50228.0001, the new "Polar White" is used on all washing machines produced in factory 46 in place of White 27.
The third last number of the Industrial Code given on the rating plate of the modified models is 9 (e.g. 46302230900).
To determine the new Polar White codes, it is necessary to know the industrial code or serial number of the appliance being repaired.
The new items, which bear the initials "PW" in place of "B27", are not aesthetically interchangeable with premodification items

as the whites are different. Both colours will be available for some time.
The items affected by this modification are:
Body, rear panel, top, control panel, handles, buttons, knobs, knob disc, door and plinth.

n1040372: Introduction of new shock absorbers and expanders.

From serial no. 50725.0001, new shock absorbers and expanders have been introduced.

New codes:
C00140670 - shock absorber
C00118593 - expander

Premodification codes
C00097259 - shock absorber
C00055037 - expander

The new items can also be used (but not separately) when replacing shock absorber 100N - C00097259; in this case, it will be necessary to replace both shock absorbers / expanders using kit C00140744, which is composed of two new shock absorbers and two new expanders.

List of appliances affected by this modification
22484AB84PT
23295W63IT
23308W93TEX
23310W83TEX
23317W83SP
23320W83TK
23321W83TTK
23330W93UK
23332W104TEX
23334W103UK
23335W113UK
23337W103TTK
23386W104NL
23781AB95EU
23879AB95AUS
23909AB63EX5060HZ
23910AL109K60HZ
24415W104SP
24600W103NL
24833W83DE
24834W104DE
25379W9521E
25474W104TBE
25885W63TAUS
25886W83TAUS
26878WA6IT
26879WA8IT
26880WA10IT
27094AB107PT
27299AL102PFR

27639WA6PT
27640WA8PT
27641WA10PT
27647WE8EX
27648WE10EX
27699W85FR
27700W105FR
27757WP67EX
27761WP100EX
27914AB84IT
28016WA105UK
28119AB66IT
28193W104TCH
28305WE8IT.1
28306WE10IT.1
28382WAP61EX
28383W84TTK
28400W104TTK
28479AV82TK
28480AVL85TK
28481AV102TK
28482AVL105TK
28484AVD8TK
28485AVD10TK
28626W101UK
28674W83FR
28676W107FR
28876AL88EU
28877AL109EU
28940AVL68ITTE
29378LNA1000FR
29540W81EX
29541W101EX
29549WP80EX
29999LISA100FR
30000WI10FR
30001WIL12FR
30018WIL113UK
30028WIE127UK
30055AVL6EIT
30056AVL8EIT
30062AVL62EX60HZ
30063AVL61EX115/60
30092AVL66PIT
30093AVL86PIT
30139WI8FR
30144WIL106IT
30145WIL86IT
30146WIL66IT
30196WI101UK
30197WI121UK
30206AVL105SK
30222WIE107IT
30223WIE87IT
30228WIV80IT
30229WIV60IT
30233WIL105EU

30234WIL85EU
30235WILM64IT
30331W12GE
30352WI81EX
30353WI82EX
30354WIL85EX
30355WI101EX
30356WIL105EX
30357AVL100PR
30361AVL95AUS
30443WIL126NL
30444WIE128NL
30455WIL105DE
30459WIL125DE
30460WIE127DE
30484WI70TK
30486WI80TK
30488WI100TK
30490WIL81TK
30492WIL101TK
30503WI62AUS
30507WI82SING
30513WI82AUS
30515WI82EX60HZ
30517WI102PL
30520WI105EX
30522WI102EX
30523WI102AUS
30525WI122EX
30526WIL62EX
30535WIL95KW
30540WIL125EX
30545WIE87EX
30548WIE107EX
30551WIE127EX
30611AVL64EU
30612AVL65PT
31813WI8EU
31922WI102EU
31923WI122EU
31969WI600IT
31970AV102CSI
32251WIL123DE
32252WIL143DE
32538WI102CH
32539WIL125CH
32571WIL146NLTE
32572WIE148NLTE
32859LISA111FR
32860WI11FR
32861WIL13FR
33178WIL145DETE
33179WIE147DETE
33180AVL145DETE
33244AVL62EO
33612AVL145EUTE
33613WIL103IT

33622WIL145EU
33623WIE147EU
33624WIL133UKTE
33625WIE147UKTE
33685AVL62KW
33742WIA121UK
33754WIA122EX
33962WIL14NL
33968AV6EU
33979AVF10TK
34056WIL146SPIT
34214AVF8TK
34238WIL14FRTE
34412WIAV60IT
34413WIA600EU
34415WIAV80IT
34438WIA60TK
34439WIA82EX
34440WIA80TK
34442WIA82EX60HZ
34443WIA8EU
34444WIA100TK
34445WIA102PL
34446WIA102EX
34447WIA101EU
34448WIA102CH
34449WIA121EU
34450WIL8FR
34451WIL11FR
34452LISA10FR
34453WIE12FR
34471WIL1000OT
34472WIL1200OT
34479AVL14FR
34483WIA101UK
34486WIA101EX
34507WIL62AUS
34508WIL82AUS
34509WIL102AUS
34515WIU61CSI
34516WIU81CSI
34517WIU102CSI
34907WIL103UK
35010WIU82CSI
35248WIL10FR
35249WIE10FR
35397WIL85EXTE
35398AVL62EXTE
35399AVL82EUTE
35400AVL88ITTE
35913AVF88EUTE
35918AVL66PITTE
35919AVL84EUTE
35920WIL105EXTE
35921WIL85PLTE
35974AV8IT
35975AV10IT

36241WIL125NL
36243WIL124NL
36536AVL95EXTE
36537AVL125EUTE
36593WIA110EU
36594WIL105PLTE
36595WIL126ITTE
36596WIL113UKTE
36684AVL105EU
36685WIE107PLTE
36768AVL120FRTE
36887WIL106SPEU
37014WILB12EU
37335WIA64IT
37732WIA9FR
37916AVL82AG
38059LISA11FR



n1040386: Modification of 280 mm - 1200RPM transmission unit.

Appliances from serial number 51027.0001 have been equipped with a new transmission unit affecting the motor, belt and pulley; these parts are not interchangeable individually with the premodification parts.

New P/Ns:
C00141664 - Elastic belt 1205J5/1208J5
C00064527 - DRIVEN PULLEY D=280 MM H= 17MM;

C00141663 - 1200RPM P52 EVO2 commutator motor

Premodification P/Ns:
C00082812 - Elastic belt 1061 H8
C00074211 - Pulley D=210 mm H=20 mm;
C00094185 - 1200RPM motor 2040M3

The appliances affected by the modification are shown below, together with the first industrial code on which the modification was introduced.

46300010902 - WIL 12 (FR)
46300281502 - WIE 127 (UK)
46304590902 - WIL 125 (DE)
46304600902 - WIE 127 (DE)
46305400902 - WIL 125 (EX)
46305510902 - WIE 127 (EX)
46322510902 - WIL 123 (DE)
46337420102 - WIA 121 (UK)
46337540902 - WIA 122 (EX)
46339610902 - WIL 12 (NL)
46344490002 - WIA 121 (EU)
46344510902 - WIL 11 (FR)
46344530902 - WIE 12 (FR)
46344720302 - WIL 1200 OT (EU)
46362410002 - WIL 125 (NL)
46362430002 - WIL 124 (NL)
46365370002 - AVL 125 (EU) (TEV)
46365930002 - WIA 110 (EU)
46365950002 - WIL 126 (IT) (TE)
46365960002 - WIL 113 (UK) (TE)
46367680002 - AVL 120 (FR) (TE)
46370140002 - WILB 12 (EU)
46380590002 - LISA 11 (FR)

n4007j00: Rear feet changed

From Serial Number 70403.0001 the two rear feet changed with new code C00254045, the cabinet fixing has been modified.

The new feet are not interchangeable with premodification.

CABINET
The spare part code isn't changed, in the warehouse stock we have the new cabinet.
If you fix it on premodification models you need to use the new feet.

n4008c01: Smart Card - LVB/DRYERS

Beginning April 2008 spare parts warehouse started to manage the EVOII modules with eeprom fixed, these can only be

programmed with smart card/palmare/pc.

Attention!! The premodification with eeprom socket can be programmed with smart card/palmare/pc using a blank eeprom or with pre programmed eeprom.

Spare parts of modules with eeprom fixed/eeprom socket:


C00265676 with eeprom fixed - C00143068 with eeprom socket - for models with conducibility sensor
C00254298 with eeprom fixed - C00143068 with eeprom socket - for models without conducibility sensor
C00254297 with eeprom fixed - C00259941 with eeprom socket
C00254531 with eeprom fixed - C00143058 with eeprom socket
C00254297 with eeprom fixed - C00143057 with eeprom socket - for models without blocking drum
C00265697 with eeprom fixed - C00143057 with eeprom socket - for models with blocking drum
C00254297 with eeprom fixed - C00143056 with eeprom socket
C00254530 with eeprom fixed - C00259738 with eeprom socket
C00254533 with eeprom fixed - C00143060 with eeprom socket
C00254535 with eeprom fixed - C00145013 with eeprom socket
C00254530 with eeprom fixed - C00145551 with eeprom socket
C00254529 with eeprom fixed - C00142293 with eeprom socket
C00257406 with eeprom fixed - C00143989 with eeprom socket
C00257409 with eeprom fixed - C00144151 with eeprom fixed
C00254530 with eeprom fixed - C00143069 with eeprom fixed

DRYERS
C00255835 with eeprom fixed - C00258789 with eeprom socket
C00255835 with eeprom fixed - C00194077 with eeprom socket


This notice has a "reference list" specific for each product where you can find the link between smart card and the eeprom code with the same software.

Electric schemes and links


Cod. 16001638000

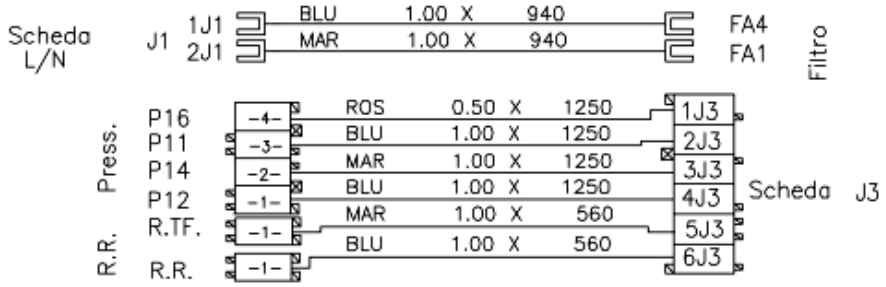


COMPLESSIVO A




COMPLESSIVO D1 MICRORITARDATORE

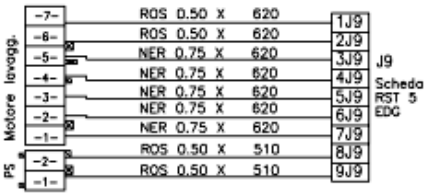

COMPLESSIVO L MOTORE + POMPA

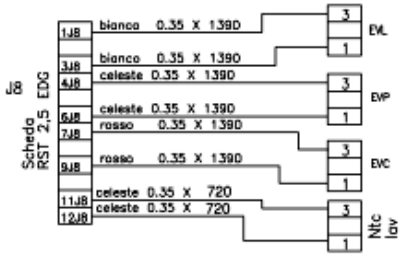

COMPLESSIVO C EVL + EVP + EVC



COMPLESSIVO X TERRA STANDARD



COMPLESSIVO B1 COMUNICAZIONE DISPLAY


16001638000

Legend

Legend: 16001638000

Electric schemes and links

Cod. 21500759100

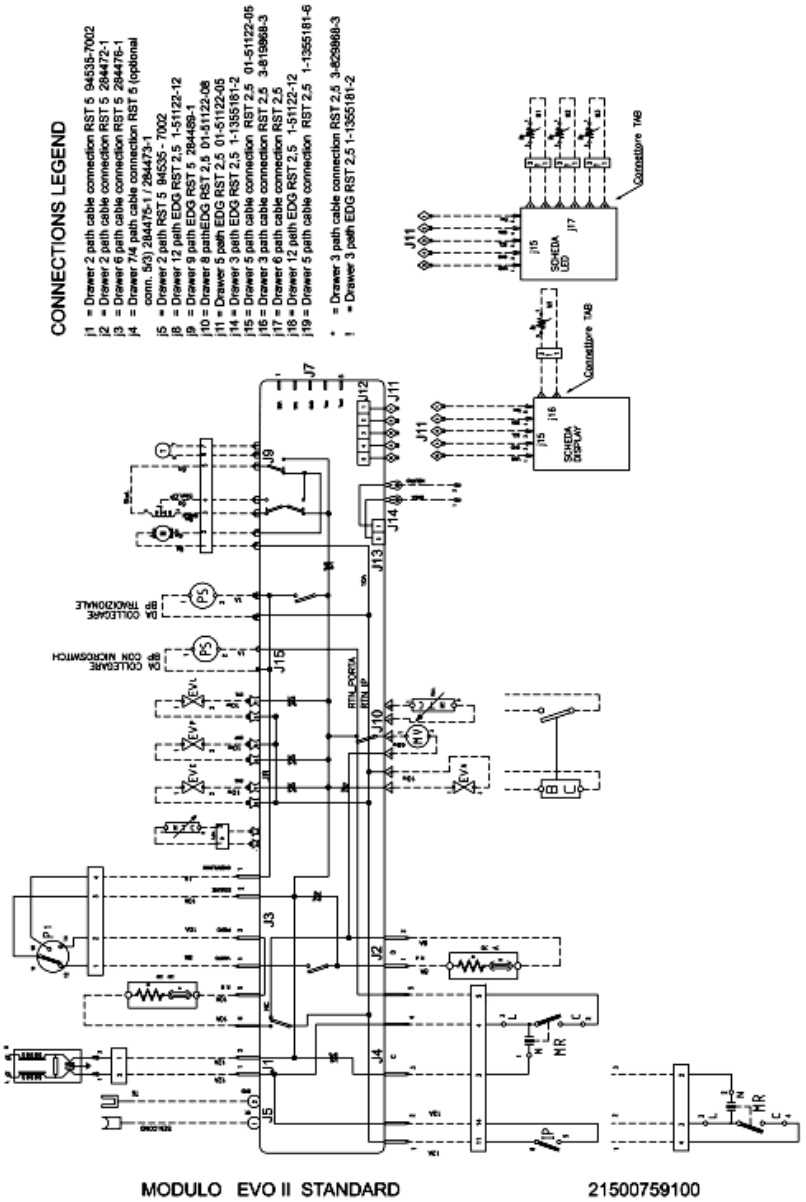

Legend

Legend: 21500759100