
INDESIT company

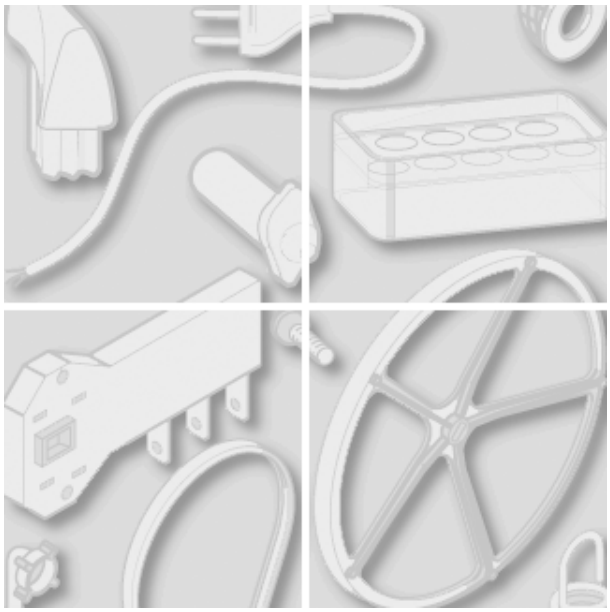

Model type:
LI680DUO

Commercial code:
F029514

General notes

Technical Documentation guidelines

You can find herewith some generic information to simplify cunsulting of technical documentation:

1. Models of same range share the same exploded views, which report the richest set of spare parts:generally, a model does not necessarly have a related spare part for each particular shown on exploded views.

2. Some spare parts can not be represented directly on the exploded views (instruction booklets, specific kit, etc...). You can find those codes in the spare parts list with the same reference of particular where spares are installed or with references 099, 999. Instruction booklets, once managed, appear with 000 reference.

3. On the higher right site of each exploded view there is a serial number which indicates the beginning of the production of certain range:some models might have more than an exploded view for a given category, each distinguished by a different serial no.and linked to another spare parts list, In this case, serial no. is required to supply the right spare part code. Exploded view to be considered is the one with a more recent serial no. but previous than the one of the model that needs assistance.

4.Exploded views might require further updates even after publishing. Addition of new spares will go on following the already existing numeration references. Revision number of an exploded view is shown into last four digits of serial number into upper right hand corner.

5.The spare parts list associated to an exploded view shows related codes of spares managed for a certain model; for each spare part other informations are available:


REF: reference no of spare into a table; SUBSTITUTE: list of spare(s) which can replace a code but that keeps same functional characteristics

INDUSTRIAL CODE: list of variables of a model (shown into model label) where such spare is used; NOTICE: code of information(s) to refer to complete technical intervention, track for changes or to find correct spare part code.

6. Some notices, into a same section are generic therefore cannot be directly linked to a spare part. In order to assist a model in the best way as possible, it is helpful to pay attention to all notices and constantly verify documentation updates

7.Technical documentation cover shows model name and its commercial codes

2210140 Exploded views

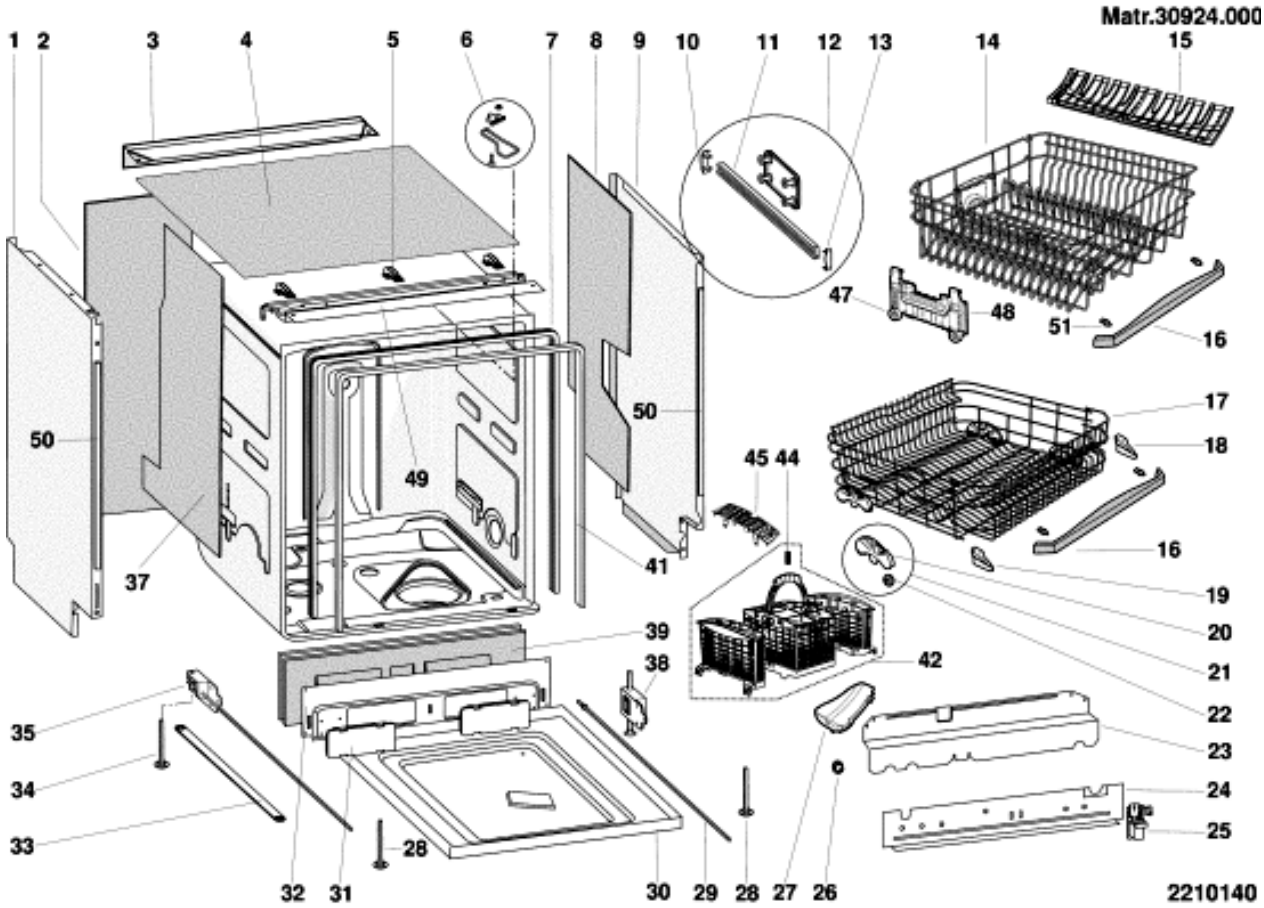


2210140 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
000	C00095274				instruction book it-gb-fr-d-nl-sp-p		
001	C00092827			1 x C00092835	left side panel lh zinc		
003	C00033591				rear support - top		
004	C00097300			1 x C00141314	insulation panel evo3	n1045127	
004	C00141310				upper panel polionda 60cm evo3	n1045127	
004	C00141314				upper panel insulation evo3	n1045127	
006	C00085024			1 x C00037135	catch plate (cabinet)		
				1 x C00297907			
				1 x C00297909			
				1 x C00297910			
007	C00116110			1 x C00141317	door seal - top and sides mm1608	n1045127	
007	C00141317				top and side door seal (1638mm)	n1045127	
008	C00076388	50121...			soundproofing lateral dx	n1045090	
009	C00092828			1 x C00092835	right side panel lh zinc		
010	C00094117				rail back stop evo3		
011	C00094116			1 x C00094112	basket runner - upper evo3		
012	C00094112				runner assembly		
013	C00094118				runner end stop		
014	C00094862			1 x C00109418	upper basket assembly adjustable	n1045069	37295140000
						n1045091	37295140100
014	C00114486		50323...	1 x C00109698	upper basket assembly adjustable	n1045091	37295140000
				1 x C00118140		n1045099	37295140100
014	C00118140	50324...		1 x C00108980	upper basket assembly adjustable		37295140200
015	C00087979			1 x C00114047	flap upper basket blue	n1045091	
				1 x C00114999			
015	C00114047			1 x C00114999	white flap upper basket evo3	n1045091	
016	C00094922			1 x C00114048	manche basket blue evo3	n1045091	
016	C00114048				handle basket 'blue satin' evo3	n1045091	
017	C00095118			1 x C00114489	lower basket evo3	n1045069	
						n1045091	
017	C00114489			1 x C00275698	lower basket evo3	n1045091	
018	C00094181				cap lower basket right evo3		
019	C00094187				cap lower basket left evo3		
020	C00086476				roller-lower basket body		
021	C00086474				roller-lower basket assembly		

2210140 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
022	C00086475				roller-lower basket		
023	C00091600				rear support - middle		
024	C00091598				lower rear support reflex		
025	C00078395			1 x C00076659 1 x C00143383	radio interference suppressor		
026	C00054830				drain hose fastener		
027	C00088301				grease box		
028	C00092555				foot 155mm		
029	C00082476				rear foot adjustment assembly		
030	C00092554			1 x C00118842	tray on bottom of tub 60cm		
031	C00054833				top for front support		
032	C00091599			1 x C00119016	front support lower 60cm		
033	C00076656				slide for foot		
034	C00092822				adjustable back foot		
035	C00092820				left rear foot adjustment assembly		
037	C00076387				soundproofing lh		
038	C00092821				rear foot adjustment assembly		
039	C00085284				front panel soundproofing 60cm		
041	C00054932				frame support for tub seal 60cm	n1045047	
042	C00086629			1 x C00114049	cutlery basket assy blue	n1045091	
042	C00114049				cutlery basket assy (blue satin)	n1045091 n4514h00	
043	C00086628				cutlery basket		
044	C00086484				spring for		
045	C00087980				cutlery basket top		
047	C00094191			1 x C00109840	upper basket roller evo3		
048	C00094223			1 x C00109417	set door handle evo3		
049	C00079013				door spring adjuster		
050	C00086602				edge cover right		
050	C00086603				edge cover left		
051	C00086481				plug door handle		
099	C00036547				anti condensation strip - worktop		

2210220 Exploded views

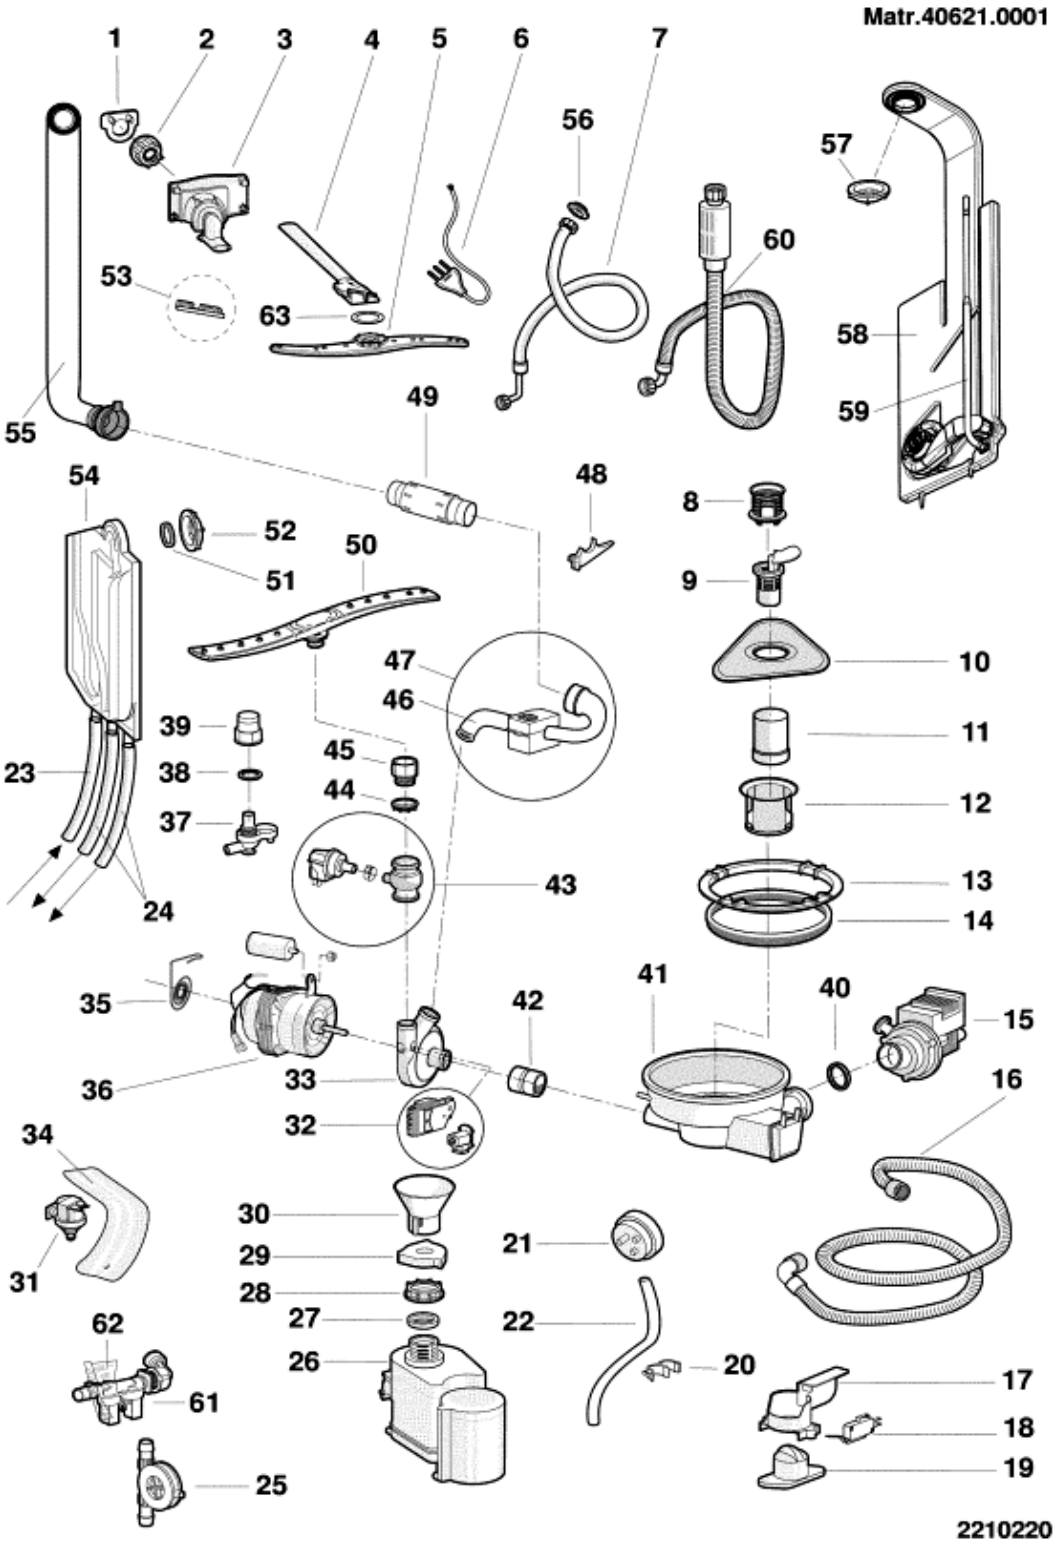

2210220 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
001	C00054925				upper was basket guide casing		
002	C00054862			1 x C00144315	ring-nut fasten.external hose top		
003	C00094134			1 x C00110526	water supply distribution assembly	n1045084	
				1 x C00110527			
003	C00110526				water supply distribution assembly		
004	C00054926			1 x C00110526	upper wash arm feed pipe	n1045084	
				1 x C00110527			
004	C00110527				upper wash arm feed pipe		
005	C00075746				upper wash arm curved set		
006	C00083706			1 x C00143371	supply cable schuko		
				1 x C00144229			
008	C00094158			1 x C00142344	filter grid evo3	n1045083	
009	C00054863			1 x C00142344	central filter		
009	C00094156			1 x C00142344	central filter basket/retainer evo3	n1045083	
010	C00054851			1 x C00145075	outlet filter stainless lvs2000		
011	C00081164			1 x C00142344	filter cylindrical		
011	C00094164			1 x C00142344	filter cylindrical evo3	n1045083	
012	C00061929				outer fine rotating polyester filter		
013	C00054854				sump fixing ferrule		
014	C00054828				gasket - sump fixing ring		
015	C00143739				drain pump 230v 50hz evo3 rohs		
016	C00054869				drain hose		
017	C00081162				container - overflow unit		
018	C00037205			1 x C00143107	microswitch		
019	C00058843				float - overflow unit		
020	C00095801				pressure hose clip evo3		
021	C00094151			1 x C00143740	pressure switch 90 71 evo3		
022	C00094154				pipe pressostat lvs evo3		
023	C00094267				tube water inlet air-break/turbine	n1045085	
023	C00110612			1 x C00111855	tube water inlet electrovalve/air-	n1045085	
				1 x C00115348			
024	C00054868				tube - softener/sump l.(480mm)		
025	C00094172				turbine evo3	n1045085	
026	C00094171				water softener adjustable evo3		
027	C00103610				seal - softener/wash chamber		


2210220 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
028	C00041090			1 x C00144235	retaining ring - softener		
029	C00041088				salt cap		
030	C00005819				salt funnel		
032	C00077172			1 x C00141156	motor washing alternating		
033	C00076138			1 x C00088889	pump cover		
035	C00076628				tub spring		
036	C00087023			1 x C00088896	wash motor/pump assy 220v-45w		
037	C00094159		60903...		overflow connector evo3		
037	C00196353	60904...			overflow connector evo3		
038	C00075695				connection gasket overflow		
039	C00143580		60903...		bodytop overflow evo3 rohs		
039	C00196352	60904...		1 x C00094159 1 x C00143580	bodytop overflow evo3 rohs		
040	C00054917				seal 'o'ring (23,81x2,62)		
041	C00094143	50121...		1 x C00141158	set sump evo3	n1045090	
041	C00094602			1 x C00096409	set sump x turbo-dry evo3	n1045065	
041	C00096409		50120...		set sump x turbo-dry evo3	n1045065 n1045090	
042	C00079016				pipe rubber sump-pump		
043	C00094157		51114...	1 x C00142435 1 x C00144125	high pressure sensor assembly	n1045136	
043	C00142435	51115...			high pressure sensor assembly		
044	C00075057			1 x C00075111	cap corner for support washing		
045	C00066643			1 x C00075111	support - lower wash arm bush		
046	C00091568				hose circulating pump to heater		
047	C00091523			1 x C00143577	box sensing troubled kit markii-		
048	C00078394				outlet pump support		
049	C00057684				washing heating element 2000w		
050	C00094182				lower wash arm		
051	C00084600				o ring seal 38 mm		
052	C00054927			1 x C00144335	ring-nut for air-flow body		
053	C00056342				steel pin fixing upper wash arm	n1045084	
054	C00094174				water inlet air break evo3	n1045085	
054	C00110610			1 x C00115360	air break + turbine evo3	n1045085 n1045127	

2210220 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
054	C00141308			1 x C00141655	air break + turbine evo3	n1045127	
055	C00094152				external pipe (hidden heating		
057	C00094601		50120...		cap corner for turbo-dry evo3	n1045090	
058	C00094600			1 x C00096408	assembly turbo-dry evo3	n1045065	
058	C00096408		50120...		assembly turbo-dry evo3	n1045065	
						n1045090	
059	C00094603			1 x C00096410	tube turbo-dry/sump 520mm	n1045065	
059	C00096410		50120...		tube turbo-dry/sump 520mm	n1045065	
						n1045090	
060	C00083761				inlet hose - includes antioverflow		
061	C00084558			1 x C00143737	load electrovalve	n1045085	
061	C00087337				collar seal		
061	C00094168				2-way electrovalve 4lt/1 evo3	n1045085	
062	C00094160				protection electrovalve evo3		
063	C00098769				upper wash arm seal		
099	C00033026			1 x C00292523	ambljgon grease ta 100 gr.		
099	C00073917				clamp for pump cover		
099	C00077010				clamp washing heating element		
099	C00084479				hose clamp		
099	C00094150				clip pressure sensor evo3		
099	C00094162				pipe fixing band on turbine		

2210330 Exploded views

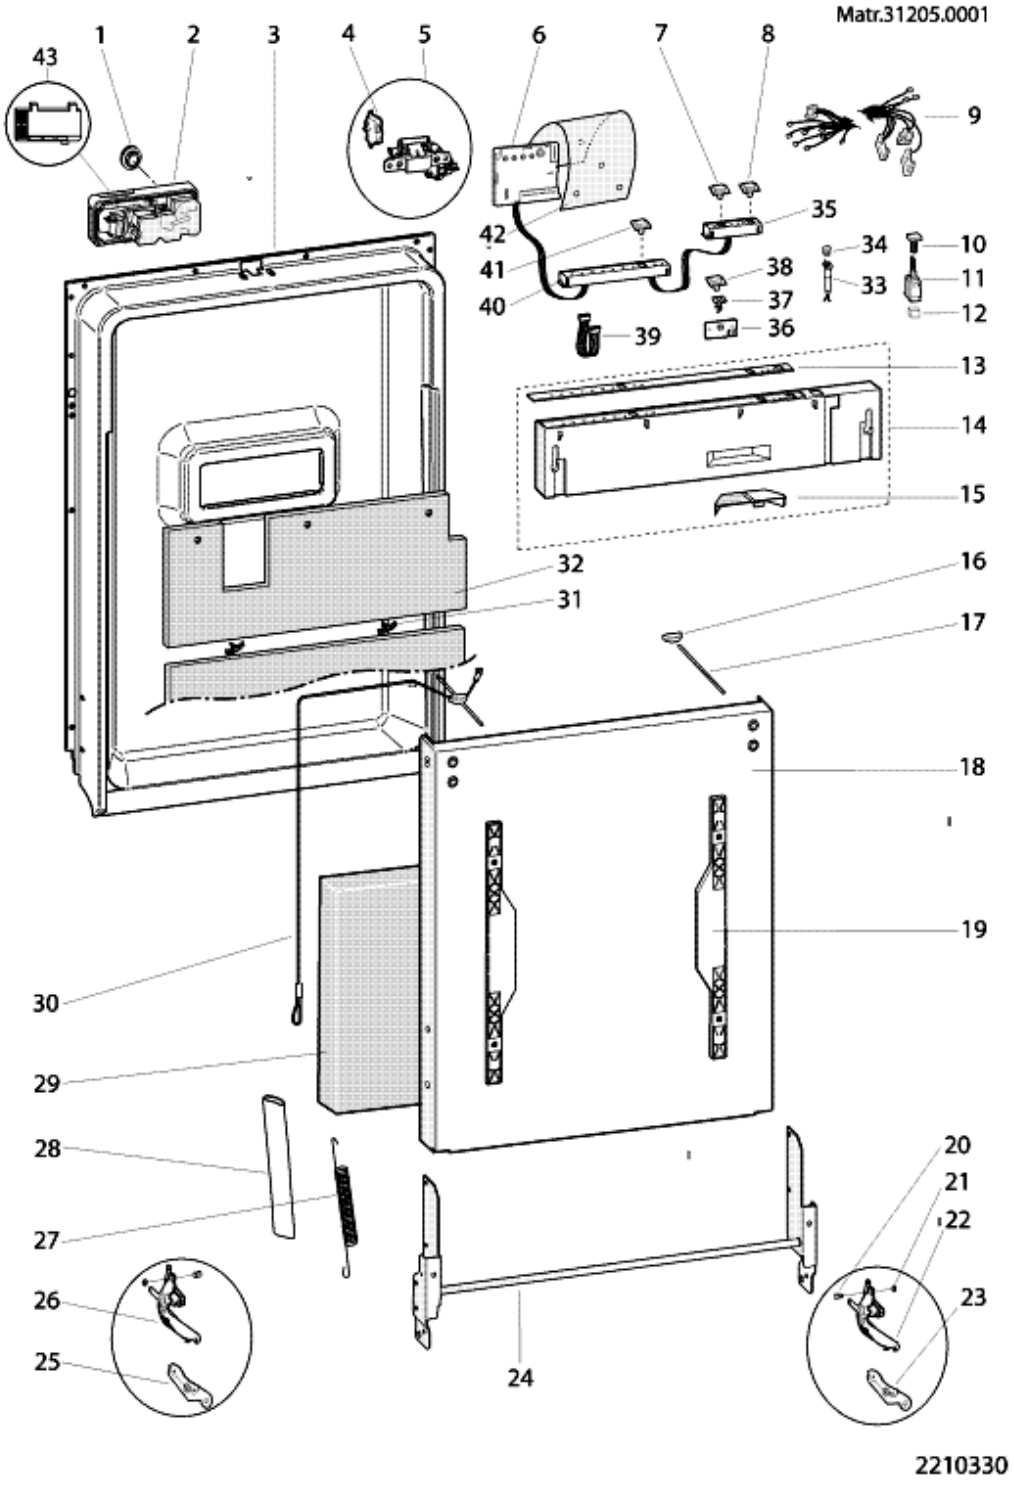

2210330 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
001	C00051755				rinse aid cap (pair) raised & flush		
002	C00094133			1 x C00143377	electrodispenser(lamp rinseaid-no		
003	C00091543			1 x C00290247	door seal lower 60cm		
003	C00095276		50323...		inner door panel stainless evo3	n1045099	37295140000
						n4509a00	37295140100
003	C00109698	50324...		1 x C00290243	inner door panel built-in		37295140200
004	C00085358				microswitch		
005	C00094128			1 x C00195887	locking assembly evo3		
006	C00095281		50120...	1 x C00097481	control card bit100.1 'd' +	n1045090	
006	C00108957				bracket for timer bit 100		
006	C00143219	50121...		1 x C00262777	timer bit100.1 'f3' rohs +	n1045090	
007	C00087050				push-button ariston		
008	C00087049				push-button ariston delay		
009	C00095283		50120...	1 x C00111353	wiring harness assembly	n1045090	
009	C00114552	50121...	51114...		wiring harness assembly	n1045090	
009	C00142437	51115...			wiring harness assembly		
010	C00053468				push-button		
011	C00041184		51114...		on-off switch (double pole) (dw)	n1045135	
011	C00140609	51115...			on-off switch (unipolar) lvs		
012	C00095278				terminal protection on/off switch		
013	C00095296				plat band control panel		
014	C00095293				dashboard+plat band control panel		
015	C00058094				protection lid handle		
016	C00054933				spring adjustment piece		
017	C00055000			1 x C00143736	special screw for spring		
018	C00095269				door panel zinc		
019	C00087431				door panel adhesive plastic strip		
020	C00048504				hinge pin		
021	C00058776				washer d = 6 mm		
022	C00085017				rh hinge		
023	C00085016				hinge cam+lh upper		
024	C00085014				hinge assembly		
025	C00085015				hinge cam+lh upper		
026	C00085018				lh hinge		
027	C00086467				door spring		

2210330 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
028	C00066426				tube hinge spring		
029	C00095273				door spacer	n1045088	
030	C00054936				spring adjustment wire		
031	C00087235				spring front panel soundproofing		
032	C00087216				front panel soundproofing 60cm		
033	C00051880				red pilot lamp		
034	C00100524				red pilot lamp lens		
035	C00087387			1 x C00143542	assembly support + card led dx		
036	C00086493			1 x C00143582	card extra dry		
037	C00085482				button lever		
038	C00086489				push-button extra		
039	C00087051				cable 8 ways		
040	C00095284			1 x C00143555	assembly support + card led sx		
041	C00085481				p - button cover		
042	C00095277				timer protection bit100		
043	C00098134				door detergent electrodispenser	n1045069	
044	C00140679				seal spring	n1045127	
099	C00076108			1 x C00012687	screw canoe klip		
099	C00084911			1 x C00304782	screw 3.5x9.5		
099	C00092251				fixing hole plug		
099	C00094120				fixing bolt inner door/dashboard		
099	C00094141				fixing screw inner/outer door		
099	C00095275			1 x C00256870	installation kit		
099	C00095896				inox door xdo (o.l.a.)##		
099	C00111286				transparent door lvs evo3 60cm ##		
099	C00284955				spacer door b.i. full integrated		

Notices

n1045048: BIT 100 CARD INITIALIZATION

Free-standing dishwasher

1- Close the door and switch the dishwasher on.
2- Wait for the test cycle to start (2 LEDs light up or "ROD" appears on dishwashers with display).
3- Wait 10 seconds (dishwasher will start to fill water...)
N.B. If the cycle fails to start the card has probably already initialized, so proceed to point 5.
4- To reset the test cycle turn the programme button to reset or hold down the start/reset button for 5 seconds. (Wait for the buzzer to beep three times or if the dishwasher does not have a buzzer, wait for the programme LEDs to switch off.)
5- To check the aforementioned steps have completed successfully, select a programme and see if it starts; (reset it after this check).
6- The dishwasher is ready for the customer.

Built-in dishwashers

1- Close the door and switch the dishwasher on.
2- Wait for the test cycle to start
3- Wait 10 seconds (the dishwasher will start to fill...)
N.B. If the cycle fails to start the card has probably already initialized, so proceed to point 5.
4- To reset the cycle, open the door (2 LEDs lit up) and press the programme button for three bips of the buzzer (or until the programme LEDs go off for dishwashers with no buzzer).
5- To check the aforementioned steps have completed successfully, press the select programme button and check that the indicator light beside the corresponding programme comes on.
6- The dishwasher is ready for thecustomer.

n1045065: Modification of Turbo-Dry Tube/Sump

From serial no. 30705.0001, the Turbo-Dry tube/Trap has been modified on EVO3 dishwashers with Turbo-Dry drying system.
The new tube has a smaller diameter.
The parts affected by this modification are:
TURBO-DRY ASSEMBLY: premodification 094600 new 096408
TURBO-DRY SUMP TRAP ASSEMBLY: premodification 094602 new 096409

TURBO-DRY TUBE/SUMP: premodification 094603 new 096410
The premodification tube will continue to be managed.
The premodification Turbo-Dry assembly and trap will be managed by the warehouse while stocks last, after which the new parts will have to used on premodification appliances as follows:
- TURBO-DRY ASSEMBLY REPLACEMENT: order the new assembly SAT code 096408 and premodification tube SAT code 094603.
- TURBO-DRY SUMP TRAP ASSEMBLY REPLACEMENT: order the new bowl SAT code 096409 and new tube SAT code 096410.

The models affected by this modification are:
LL65FR (28462);
LD87IT (28455);
LD87XIT (28458);
LL65XFR (29284);
LD87EU (28473);
LD87XEU (28474);
LD87FR (29285);
LI680DUO (29514);
LI700DUO (29515);
DWF70P (29794);
DWF70N (29795);
DWF70S (29796);
LD87UK (29396).

See figure N1045065FIG1.



n1045069: Modification of racks and dispenser lid on EVO3 dishwashers

---


To obtain better dissolving of the detergent during the wash cycle, the following modifications have been made to EVO3 dishwashers:
- new dispenser lid, replacement code 098134 (see figure N1045069FIG4) created;

- upper racks modified with lid catch angle changed from 9° to 16° (see figure N1045069FIG5);
- MultiSystem lower racks modified with insertion of a spacer wire at the electric dispenser (see figure N1045069FIG6).


The upper and lower racks have the same spare part codes as the premodification items; Replacements Warehouse stocks have been replaced.


Lid installation instructions:
1) prise the lid out of the dispenser seat using a small screwdriver at point A (figure N1045069FIG1);
2) replace the lid, checking that release spring B (figure N1045069FIG2) is in place; before fitting the new lid load the spring from position 1 to position 2 (figure N1045069FIG2);
3) fit the lid in its special seat and check for correct operation (figure N1045069FIG3).
Lid closing may be harder for the first few cycles after replacement, due to settling of the material.

N1045069FIG1

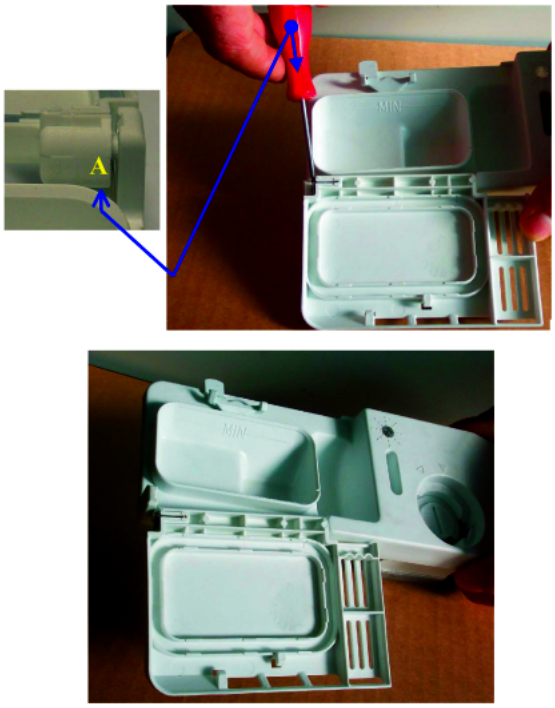

N1045069FIG2

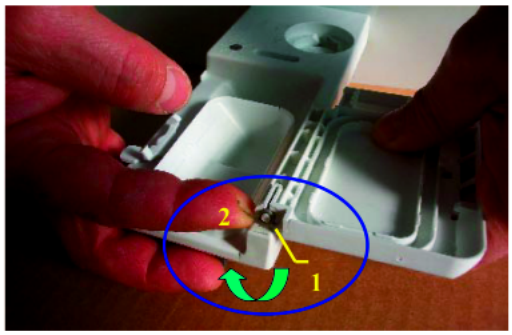


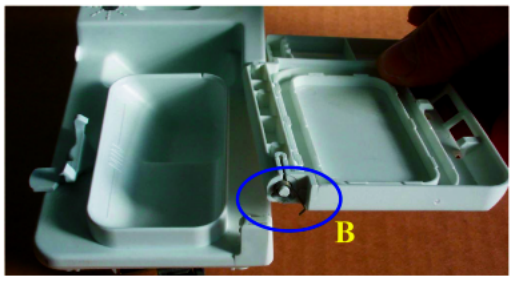


N1045069FIG3



N1045069FIG4

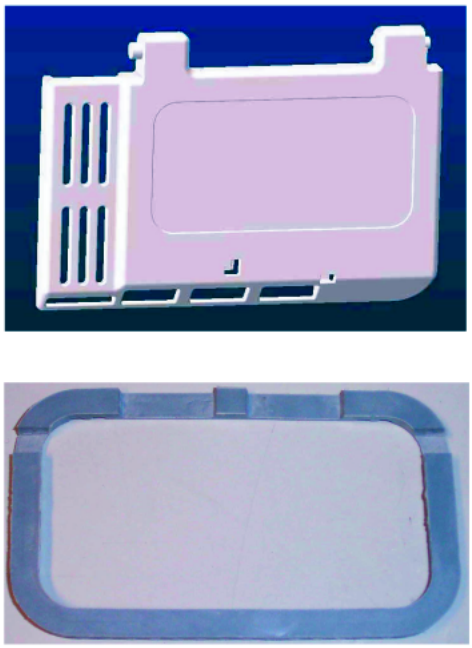


N1045069FIG5

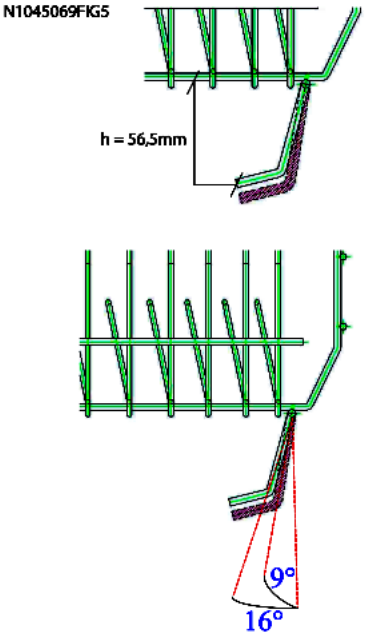

n1045075: Unification of Timer BIT 100 Service codes 097431 and 095281 with 097481.

BIT 100 "P2" TIMER (210097637.XX) Service code 097431 has been replaced with BIT 100 "E2" TIMER (210097877.02) Service code 097481.
BIT 100 "D" TIMER (210093806.XX) Service code 095281 has been replaced with BIT 100 "E2" TIMER (210097877.02) Service code 097481.

N1045069FIG6

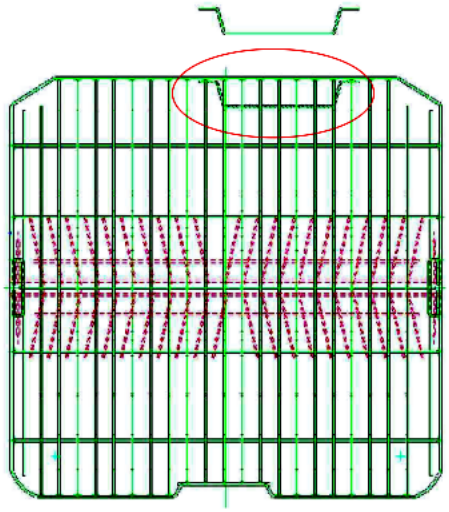

Replacement of Service codes 097431 and 095281 with 097481 is only possible with BIT 100 "E2" TIMER card code 210097877.02.

The card code is printed on an adhesive label located on the box or on the card itself (illustration N1045075FIG1).

Possible 210097877.XX card spares with modification index below 02 cannot be used for replacing, but can be used on the relevant INDESIT models (giving the BIT 100 "E2" TIMER Service code 097481 in the spare part list) until stocks last.


Stocks of Service code 097481 in the Spare Part Warehouse have been replaced with card 210097877.02.

n1045082: Timer Bit 100 programmes for Evo3 60cm dishwashers

Table N1045082FIG1 shows information relevant to the programmes of the following Timer Bit 100 for Evo 3 60 cm dishwashers:
Timer BIT 100 - E1 - Service code 097890 (rohs 143206);
Timer BIT 100 - E2 - Service code 097481 (rohs 143207);
Timer BIT 100 - E3 - Service code 099892 (rohs 143208);
Timer BIT 100 - S1 - Service code 109875 (rohs 143211).

PROGRAMMES:
1) Energico or Super Wash or Intensive
2) Normal or Daily
3) Eco (Ciclo per Istituti)
4) Rapido
5) Ammollo
6) Cristalli
7) Special Guest

N1045075FIG1

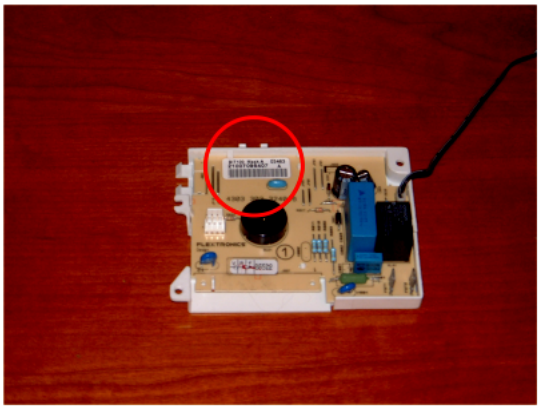

8) Just you
9) Duo-Wash o Crystal and Pot

PROGRAMME PHASES:
A) Pre-wash
B) Pre-wash
C) Wash
D) Rinse
E) Rinse
F) Rinse
G) Drying

PROGRAMME MODIFICATIONS ARE INDICATED IN RED.

n1045083: Modification of filters on EVO3 60 cm dishwashers

All dishwasher models affected by this modification have been equipped with the items listed below, in order to solve the drain pump clooging problem.

Introduction of:
Cylindrical plastic filter code 081164
Central filter code 054863

Elimination of:
Cylindrical plastic filter code 094164


TIMER BIT 100 - EVO 3

PROGRAMS	PROGRAM PHASES											
	A	B	C	D	E	F	G	Time	Effective Time	Kwh	L
1	X	40°C	65°C	cold	cold	65°C	✓	120'	125'	1,4	23,0
2	X	X (ex:cold)	55°C	cold	X	70°C	✓	72'	85'	1,25	16,0
3	cold	cold	50°C	X	X	65°C	✓	130'	138'	1,05	18,0
4	X	X	47°C (ex:40°C)	62°C	X	X	extradry	24'	38'	0,7	10,0
5	cold	X	X	X	X	X	X	12'	12'	0,01	4,0
6	X	X	52°C (ex:55°C)	45°C	X	65°C	✓	96'	98'	1,16	16,0
7	X	X	X	X	X	65°C	✓	36'	38'	0,8	6,0
8	X	X	50°C	67°C	X	X	✓	40'	40'	0,9	10,0
9	cold	X	52°C (ex:55°C)	45°C	X	65°C	✓	108'	110	1,18	18,0

Central filter code 094156
Central filter grid code 094158

The modification has been introduced progressively, starting from serial no. 40516.0001.

N1045083FIG1

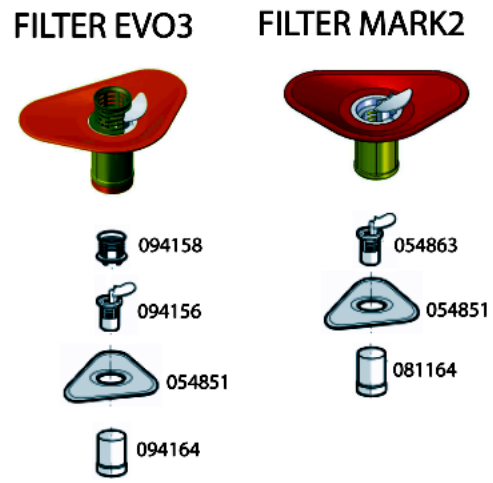

n1045084: Elimination of duct fixing pin code 056342

Duct fixing pin code 056342 has been eliminated from all dishwashers affected by this note, modifying the connection between the feeder-distribution assembly and the internal duct.

Introduced items:
Internal duct 110527
Feeder-distribution assembly 110526

Eliminated items:
Internal duct 054926
Feeder-distribution assembly 094134 (EX 054871)
Duct fixing pin 056342

The modification has been introduced progressively, starting from serial no. 40517.0001.

n1045085: Introduction of new litre counter turbine integrated on air-break.

All dishwashers affected by this note have been equipped with a new litre counter turbine on the air-break.
Picture N1045085FIG1 illustrates the premodification structure, picture N1045085FIG2 the new structure.

Items affected by the modification.

AIR-BREAK:
new 110610;
premodification 094174;
the new item features a new integrated litre counter turbine and its water supply hose has a smaller diameter.

LITRE COUNTER TURBINE code 094172 has been eliminated.

SOLENOID VALVES:
new:
1-WAY code 110611;
2-WAY code 084558(Rohs 143737);
premodification:
1-WAY code 094227;
2-WAY code 094168;
the new solenoid valves have a smaller diameter drain hose fitting.

HOSES:
new solenoid valve hose/air-break code 110612;
premodification turbine hose/air-break code 094267;
premodification solenoid valve hose/air-break code 094267;
the new hose has a smaller internal diameter.

WIRING:
the litre counter turbine connecting cable is longer, but since the connector is the same, the new item can be used in place of the


premodification one.


Affected models with related modification introduction serial numbers:
BCI 450 - 30386 s/n 41001.0001;
BFI 620 - 30708 s/n 41001.0001;
BFI 680 - 30715 s/n 40902.0001;
BFV 620 B - 30718 s/n 41001.0001;
BFV 620 K - 30717 s/n 41001.0001;
BFV 620 W - 30719 s/n 41001.0001;
BFV 620 X - 30720 s/n 41001.0001;
DI 6 - 29930 s/n 41001.0001;
DI 620 A - 29932 s/n 40830.0001;
DI 620 - 29931 s/n 41001.0001.
DI 620 UK - 30351 s/n 41001.0001;
DI 630 A - 30369 s/n 41001.0001;
DV 620 BK - 29927 s/n 41001.0001;
DV 620 BK UK - 30349 s/n 41001.0001;
DV 620 K IX UK - 30350 s/n 41001.0001;
DV 620 WH - 29928 s/n 41001.0001;
DV 620 WH UK - 30348 s/n 41001.0001;
DV 630 A BR - 30695 s/n 40830.0001;
DV 630 A IX - 30693 s/n 40830.0001;
DV 630 A WH - 30694 s/n 40830.0001;
DV 640 A IX - 30368 s/n 40830.0001;
DV 650 A IX - 30696 s/n 40830.0001;
DV 650 A WH - 30697 s/n 40830.0001;
DV 670 A BR - 30701 s/n 40830.0001;
DV 670 A IX - 30699 s/n 40830.0001;
DV 670 A WH - 30700 s/n 40830.0001;
DV 620 IX - 29929 s/n 40531.0001;
DVG 621 BK - 33220 s/n 40830.0001;
DVG 621 IX - 33212 s/n 40830.0001;
DVG 621 WH - 33221 s/n 40830.0001;
DWM 55 A - 29793 s/n 41001.0001;
DWT 10 P.2 - 32228 s/n 40830.0001;
FDW 20 P - 33182 s/n 41001.0001;
FDW 80 G - 33189 s/n 41001.0001;
FDW 80 P - 33187 s/n 41001.0001;
FDW 80 T - 33188 s/n 41001.0001;
FDW 85 A - 33190 s/n 41001.0001;
FDW 60 G - 33185 s/n 41001.0001;
FDW 60 P - 33183 s/n 41001.0001;
FDW 60 T - 33184 s/n 41001.0001;
FDW 65 A - 33186 s/n 41001.0001;
IDE 100 (EU) - 30666 s/n 41001.0001;
IDE 100 S (IT) - 30216 s/n 41001.0001;
IDE 100 SK - 30758 s/n 41001.0001;
IDE 1000 UK - 30044 s/n 41001.0001;
IDE 1005 S UK - 30045 s/n 41001.0001;
IDE 44 EU - 30423 s/n 40911.0001;
IDE 44 UK - 30394 s/n 40916.0001;
IDL 40 DE - 32308 s/n 41001.0001;
IDL 40 EU - 30417 s/n 41001.0001;
IDL 40 FR - 30403 s/n 41001.0001;
IDL 40 S UK - 31956 s/n 41001.0001;
IDL 40 UK - 30393 s/n 41001.0001;
IDL 42 DE - 32309 s/n 40830.0001;

IDL 42 EU - 30419 s/n 40911.0001;
IDL 42 FR - 30404 s/n 40911.0001;
IDL 50 EU.2 - 32006 s/n 40916.0001;
IDL 50 SK.2 - 32221 s/n 41001.0001;
IDL 500 FR - 30014 s/n 40916.0001;
IDL 505 S UK.2 - 32001 s/n 41001.0001;
IDL 51 (EU) - 31075 s/n 40906.0001;
IDL 51 EU.2 - 32217 s/n 40906.0001;
IDL 55 (DE) - 30561 s/n 40909.0001;
IDL 55 (EU) - 30634 s/n 40916.0001;
IDL 55 (IT) - 30212 s/n 40916.0001;
IDL 55 DE.2 - 32220 s/n 40909.0001;
IDL 55 EU.2 - 32215 s/n 40917.0001;
IDL 55 S (DE) - 30565 s/n 40909.0001;
IDL 55 S (IT) - 30213 s/n 40916.0001;
IDL 55 S DE.2 - 32224 s/n 40909.0001;
IDL 57 (PT) - 31086 s/n 40916.0001;
IDL 60 (EU) - 30644 s/n 40909.0001;
IDL 60 (IT) - 30214 s/n 41001.0001;
IDL 60 EU.2 - 32216 s/n 40909.0001;
IDL 60 NL.2 - 32219 s/n 41001.0001;
IDL 60 S (EU) - 30647 s/n 40909.0001;
IDL 60 S EU.2 - 32225 s/n 40909.0001;
IDL 60 SK - 30755 s/n 41001.0001;
IDL 60 SK.2 - 32222 s/n 41001.0001;
IDL 61 (EU) - 30680 s/n 41001.0001;
IDL 61 EU.2 - 32218 s/n 41001.0001;
IDL 62 (EU) - 30686 s/n 40911.0001;
IDL 62 EU.2 - 32223 s/n 40911.0001;
IDL 63 S NL.2 - 32226 s/n 41001.0001;
IDL 70 (EU) - 30654 s/n 40902.0001;
IDL 70 (IT) - 30215 s/n 41001.0001;
IDL 70 D EU - 30600 s/n 41001.0001;
IDL 700 FR - 30016 s/n 41001.0001;
IDL 700 UK - 30042 s/n 41001.0001;
IDL 7021 (SP) - 30603 s/n 40902.0001;
IDL 710 FR - 30017 s/n 41001.0001;
IDL 75 (EU) - 30661 s/n 41001.0001;
IDL 75 EU.2 - 32627 s/n 41001.0001;
IDL 75 S (EU) - 30604 s/n 41001.0001;
IDL 75 S EU.2 - 32845 s/n 41001.0001;
IDL B2 EU - 32271 s/n 40917.0001;
IDL 500 UK.2 - 31984 s/n 40524.0001 ;
IDL 50 EU - 30217 s/n 40531.0001;
IDL 550 FR - 30015 s/n 40531.0001;
IDL 705 SUK - 30043 s/n 40531.0001;
L 6047 FR - 33150 s/n 40830.0001;
L 61 (IT) - 28169 s/n 40917.0001;
L 61 AG - 29907 s/n 40917.0001;
L 61 EU - 28470 s/n 40917.0001;
L 63 (IT) - 28453 s/n 41001.0001;
L 63 AUS - 29912 s/n 41001.0001;
L 63 EU - 29544 s/n 40909.0001;
L 63 SK - 31080 s/n 41001.0001;
L 63 SK.2 - 32227 s/n 41001.0001;
L 63 X (IT) - 28904 s/n 41001.0001;
L 63 X AUS - 29913 s/n 41001.0001;

L 64 AUS - 29914 s/n 41001.0001;
L 64 X AUS - 29915 s/n 41001.0001;
LD 85 (IT) - 28454 s/n 41001.0001;
LD 85 X (IT) - 28457 s/n 41001.0001;
LD 87 (IT) - 28455 s/n 41001.0001;
LD 87 EU - 28473 s/n 41001.0001;
LD 87 FR - 29285 s/n 41001.0001;
LD 87 X (IT) - 28458 s/n 41001.0001;
LD 87 X AUS - 29918 s/n 41001.0001;
LD 87 X EU - 28474 s/n 41001.0001;
LD 87 X SK - 29692 s/n 41001.0001;
LI 420 - 30392 s/n 40830.0001;
LI 460 - 30370 s/n 40830.0001;
LI 480 A - 30371 s/n 40830.0001;
LI 660 A - 30304 s/n 40830.0001;
LI 700 DUO - 29515 s/n 40830.0001;
LI 620 - 29511 s/n 40714.0001;
LI 640 A - 29512 s/n 40531.0001;
LI 670 DUO - 29513 s/n 40603.0001;
LI 680 DUO - 29514 s/n 40607.0001;
LIQ 700 DUO JADE - 29952 s/n 40830.0001;
LL 40 EU - 30408 s/n 41001.0001;
LL 42 EU - 30411 s/n 40907.0001;
LL 420 FR - 30397 s/n 40907.0001;
LL 43 S EU - 30412 s/n 40907.0001;
LL 62 FR - 30614 s/n 41001.0001;
LL 62 X FR - 30615 s/n 41001.0001;
LL 63 EU - 29909 s/n 41001.0001;
LL 63 FR - 28460 s/n 41001.0001;
LL 63 TK - 28471 s/n 41001.0001;
LL 63 X EU - 30174 s/n 41001.0001;
LL 64 X AUS - 29917 s/n 41001.0001;
LL 64 77 - 31940 s/n 41001.0001;
LL 64 AG - 29908 s/n 40920.0001;
LL 64 AUS - 29916 s/n 41001.0001;
LL 64 DE - 31941 s/n 41001.0001;
LL 64 EU - 29545 s/n 41001.0001;
LL 64 SK - 29690 s/n 41001.0001;
LL 64 X EU - 29546 s/n 41001.0001;
LL 65 (IT) - 28903 s/n 41001.0001;
LL 65 EU - 29547 s/n 40906.0001;
LL 65 FR - 28462 s/n 41001.0001;
LL 65 TK - 28472 s/n 41001.0001;
LL 65 X EU - 29910 s/n 40906.0001;
LL 65 X FR - 29284 s/n 41001.0001;
LL 6546 FR - 33151 s/n 40916.0001;
LV 460 A BK - 30379 s/n 40830.0001;
LV 460 A IX - 30377 s/n 40830.0001;
LV 460 A WH - 30378 s/n 40830.0001;
LV 460 BK - 30375 s/n 40920.0001;
LV 460 IX - 30372 s/n 40920.0001;
LV 460 WH - 30373 s/n 40920.0001;
LV 620 BK - 29939 s/n 41001.0001;
LV 620 IX - 29941 s/n 41001.0001;
LV 620 WH - 29940 s/n 41001.0001;
LV 640 A BK - 29942 s/n 40902.0001;
LV 640 A IX - 29946 s/n 40902.0001;

LV 640 A R AN - 29944 s/n 40902.0001;
LV 640 A R OW - 29945 s/n 40902.0001;
LV 640 A WH - 29943 s/n 40902.0001;
LV 650 A ALU - 29922 s/n 41001.0001;
LV 650 A BK - 29925 s/n 41001.0001;
LV 650 A IX - 29921 s/n 41001.0001;
LV 650 A OW - 29923 s/n 41001.0001;
LV 650 A WH - 29924 s/n 41001.0001;
LV 660 A BK FR - 30300 s/n 40902.0001;
LV 660 A IX FR - 30301 s/n 40902.0001;
LV 660 A WH FR - 30299 s/n 40902.0001;
LV 670 DUO ALU - 29926 s/n 41001.0001;
LV 670 DUO AN - 29947 s/n 41001.0001;
LV 670 DUO IX - 29948 s/n 41001.0001;
LV 670 R AN - 30302 s/n 40830.0001;
LV 670 R OW - 30303 s/n 40830.0001;
LV 680 DUO IX - 29949 s/n 41001.0001;
LVI 12-44 AN - 29564 s/n 40830.0001;
LVI 12-44 IX - 29562 s/n 40830.0001;
LVI 12-44 WH - 29563 s/n 40830.0001;
LVI 12-55 AN - 29567 s/n 41001.0001;
LVI 12-55 IX - 29565 s/n 41001.0001;
LVI 12-55 WH - 29566 s/n 41001.0001;
LVI 12-66 AN - 29570 s/n 41001.0001;
LVI 12-66 IX - 29568 s/n 41001.0001;
LVI 12-66 M BA - 29573 s/n 41001.0001;
LVI 12-66 M GI - 29571 s/n 41001.0001;
LVI 12-66 M VA - 29572 s/n 41001.0001;
LVI 12-66 WH - 29569 s/n 41001.0001;
LVO 670 DUO IX - 30848 s/n 40830.0001;
LVO 680 DUO IX - 29951 s/n 40902.0001;
LVR 640 A AN - 33614 s/n 40902.0001;
LVR 640 A OW - 33615 s/n 40902.0001;
LVR 670 AN - 33616 s/n 40830.0001;
LVR 670 OW - 33617 s/n 40830.0001;
LVTI 12-55 - 29574 s/n 41001.0001;
LVTI 12-66 - 29575 s/n 41001.0001;
SDW 60 P - 31010 s/n 40906.0001;
XLV 670 DUO IX - 29950 s/n 41001.0001.

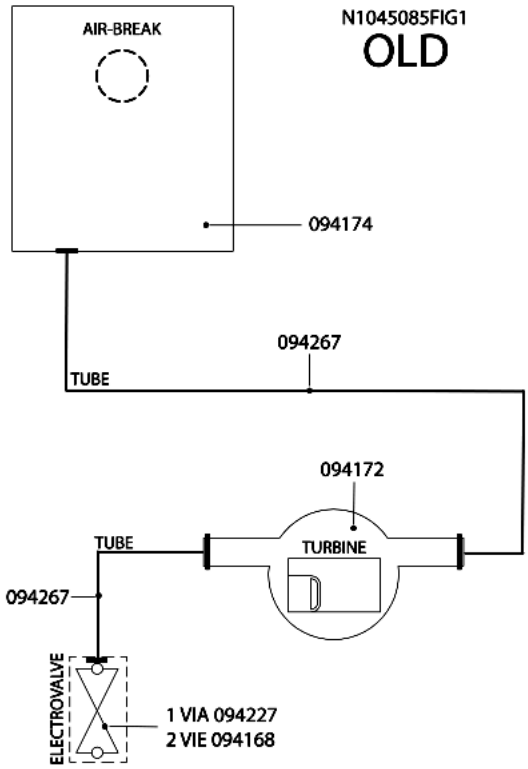

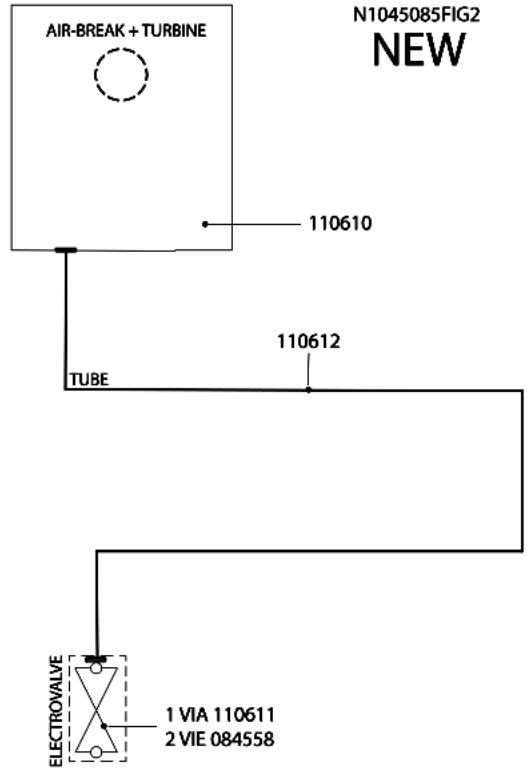

n1045090: Elimination of Turbo Dry drying system

The Turbo Dry drying system has been eliminated from all dishwashers affected by this bulletin.

ELIMINATED PARTS:
Turbo Dry Assembly P/N 096408
Turbo Dry ring nut P/N 094601
Turbo Dry Hose / Sump P/N 096410
Turbo Dry sump trap assembly P/N 096409

PARTS INTRODUCED:
Sump trap assembly P/N 094143
RH lateral sound insulation P/N 076388

This modification also concerns the timer and wiring; the following list shows the affected models with the relevant modification start serial numbers.

FDW60P (commercial code 33183)
Serial no.: 41011.0001
Wiring: premodification 114457 - new 114458
Bit 100 Timer: premodification 097481(Rohs 143207)‘E2'- new114403 (Rohs 143209) E4'

FDW60T (commercial code 33184)
Serial no.: 41011.0001
Wiring: premodification 114457 - new 114458
Bit 100 Timer: premodification 097481(Rohs 143207) ‘E2' - new 114403(Rohs 143209) ‘E4'

FDW60G (commercial code 33185)
Serial no.: 41011.0001
Wiring: premodification 114457 - new 114458
Bit 100 Timer: premodification 097481(Rohs 143207)‘E2' - new 114403(Rohs 143209) ‘E4'

FDW65A (commercial code 33186)
Serial no.: 41011.0001
Wiring: premodification 114457 - new 114458
Bit 100 Timer: premodification 097481(Rohs 143207)‘E2'- new 114403(Rohs 143209) ‘E4'

FDW20P (commercial code 33182)
Serial no: 41020.0001
Wiring: premodification 114574 - new 112933
Bit 100 Timer: premodification 109875(Rohs 143211)‘S1'-new114767(Rohs144314)‘E5'

LL65XFR (commercial code 29284)
Serial no.: 41102.0001
Wiring: premodification 114457 - new 114458
Bit 100 Timer: premodification 097481(Rohs 143207)‘E2' – new 14403(Rohs143209) ‘E4'

IDL61EU (commercial code 30680)
Serial no.: 41102.0001
Wiring: premodification 114567 - new 112915
Bit 100 Timer: premodification 097481(Rohs 143207) ‘E2' - new 114403(Rohs143209) ‘E4'

IDL61EU.2 (commercial code 32218)
Serial no.: 41102.0001
Wiring: premodification 114567 - new 112915
Bit 100 Timer: premodification 109875(Rohs 143211)‘S1' - new 114403(Rohs143209) ‘E4'

IDL70IT (commercial code 30215)
Serial no.: 41102.0001
Wiring: premodification 114565 - new 112901

Bit 100 Timer: premodification 097481(Rohs 143207)‘E2' - new 114403(Rohs143209) ‘E4'

IDL75EU.2 (commercial code 32627)
Serial no.: 41102.0001
Wiring: premodification 114565 - new 112901
Bit 100 Timer: premodification 097481(Rohs 143207)‘E2' - new 114403(Rohs143209) ‘E4'

IDL75SEU.2 (commercial code 32845)
Serial no.: 41102.0001
Wiring: premodification 114565 - new 112901
Bit 100 Timer: premodification 097481(Rohs 143207)‘E2' - new 114403(Rohs143209) ‘E4'

IDL75EU (commercial code 30661)
Serial no.: 41102.0001
Wiring: premodification 114565 - new 112901
Bit 100 Timer: premodification 097481(Rohs 143207)‘E2' - new 114403(Rohs143209) ‘E4'

IDL75SEU (commercial code 30604)
Serial no.: 41102.0001
Wiring: premodification 114565 - new 112901
Bit 100 Timer: premodification 097481(Rohs 143207)‘E2' - new 114403(Rohs143209) ‘E4'

IDL710FR (commercial code 30017)
Serial no.: 41102.0001
Wiring: premodification 114563m - new 114633
Bit 100 Timer: premodification 097481(Rohs 143207)‘E2' - new 114403(Rohs143209) ‘E4'

LL65FR (commercial code 28462)
Serial no: 41103.0001
Wiring: premodification 114457 - new 114458
Bit 100 Timer: premodification 097481(Rohs 143207)‘E2' - new 114403(Rohs143209) ‘E4'

LVZ680DUOIX (commercial code 33662)
Serial no: 41223.0001
Wiring: premodification 114494 – new 115692
Bit 100 Timer: premodification 111884(Rohs 143217)‘F1’ – new 115691(Rohs 143219) ‘F3’

LZ700DUOIX (commercial code 33663)
Serial no: 41223.0001
Wiring: premodification 113150 – new 115693
Bit 100 Timer: premodification 111884(Rohs 143217)‘F1’ – new 115691(Rohs 143219) ‘F3’

BFI680 (commercial code 30715)
Serial no: 50121.0001
Wiring: premodification 111353 - new 114552
Bit 100 Timer: premodification 097481(Rohs 143207)'E2' - new 115691(Rohs 143219) 'F3'

LI680DUO (commercial code 29514)
Serial no: 50121.0001
Wiring: premodification 111353 - new 114552
Bit 100 Timer: premodification 097481(Rohs 143207)'E2' - new 115691(Rohs 143219) 'F3'

LI700DUO (commercial code 29515)
Serial no: 50121.0001
Wiring: premodification 111353 - new 114552
Bit 100 Timer: premodification 097481(Rohs 143207) 'E2'-new115691(Rohs 143219)'F3'

LIQ700DUOTI (commercial code 33970)
Serial no: 50121.0001
Wiring: premodification 111353 - new 114552
Bit 100 Timer: premodification 097481(Rohs 143207)'E2' -new115691(Rohs 143219)'F3'

LVA12-56AN (commercial code 33610)
Serial no: 50206.0001
Wiring: premodifica 112165 – new 116170
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

LVA12-56WH (commercial code 33611)
Serial no: 50206.0001
Wiring: premodifica 112165 – new 116170
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

LVI12-66IX (commercial code 29568)
Serial no: 50206.0001
Wiring: premodifica 113039 – new 116172
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

LVI12-66MGI (commercial code 29571)
Serial no: 50206.0001
Wiring: premodifica 113039 – new 116172
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

LVX12-67IX (commercial code 33950)
Serial no: 50207.0001
Wiring: premodifica 113039 – new 116172
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

LVX12-56AN (commercial code 33749)
Serial no: 50207.0001
Wiring: premodifica 112165 – new 116170
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

LVX12-56WH (commercial code 33750)
Serial no: 50207.0001
Wiring: premodifica 112165 – new 116170
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

LVX12-56IX (commercial code 33748)
Serial no: 50207.0001
Wiring: premodifica 112165 – new 116170
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

LVX12-67WH (commercial code 33952)
Serial no: 50207.0001
Wiring: premodifica 113039 – new 116172
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

LVX12-67AN (commercial code 33951)
Serial no: 50207.0001
Wiring: premodifica 113039 – new 116172
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

LVM12-67BA (commercial code 33953)
Serial no: 50207.0001

Wiring: premodifica 113039 – new 116172
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

LVM12-67GI (commercial code 33954)
Serial no: 50207.0001
Wiring: premodifica 113039 – new 116172
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

FDW80T (commercial code 33188)
Serial no: 50207.0001
Wiring: premodifica 114573 – new 116173
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

FDW80P (commercial code 33187)
Serial no: 50208.0001
Wiring: premodifica 114573 – new 116173
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

FDW85A (commercial code 33190)
Serial no: 50208.0001
Wiring: premodifica 114573 – new 116173
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

FDW80G (commercial code 33189)
Serial no: 50208.0001
Wiring: premodifica 114573 – new 116173
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

LD87XSK (commercial code 29692)
Serial no: 50214.0001
Wiring: premodifica 114546 – new 116174
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

LD87FR (commercial code 29285)
Serial no: 50214.0001
Wiring: premodifica 114551 – new 116173
Bit 100 Timer: premodifica 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

IDE1000UK.2 (commercial code 34121)
Serial no: 50214.0001
Wiring: premodifica 114052 – new 116175
Bit 100 Timer: premodifica 099892(Rohs 143208)‘E3’ – new 114403(Rohs 143209)‘E4’

IDE1005SUK.2 (commercial code 34122)
Serial no: 50214.0001
Wiring: premodifica 114052 – new 116175
Bit 100 Timer: premodifica 099892(Rohs 143208)‘E3’ – new 114403(Rohs 143209)‘E4’

LL6546FR (commercial code 33151)
Serial no: 50214.0001
Wiring: premodifica 112896 – new 116177
Bit 100 Timer: premodifica 111884(Rohs 143217)‘F1’ – new 115691(Rohs 143219)‘F3’

IDE100SK (commercial code 30758)
Serial no: 50216.0001
Wiring: premodifica 114566 – new 116179

Bit 100 Timer: premodifica 099892(Rohs 143208)‘E3’ – new 114403(Rohs 143209)‘E4’

IDE100SIT (commercial code 30216)
Serial no: 50217.0001
Wiring: premodifica 114566 – new 116179
Bit 100 Timer: premodifica 099892(Rohs 143208)‘E3’ – new 114403(Rohs 143209)‘E4’

IDE100EU (commercial code 30666)
Serial no: 50217.0001
Wiring : premodifica 114566 – new 116179
Bit 100 Timer: premodifica 099892(Rohs 143208)‘E3’ – new 114403(Rohs 143209)‘E4’

LVTI12-67 (commercial code 33955)
Serial no: 50218.0001
Wiring: premodifica 111353 – new 114552
Bit 100 Timer: premodifica 097481(Rohs 143207)‘E2’ – new 115691(Rohs 143219) ‘F3’

CISLI700DUO (commercial code 34142)
Serial no: 50224.0001
Wiring: old 111353 – new 114552
Bit 100 Timer: old 097481(Rohs 143207)‘E2’ – new 115691(Rohs 143219)‘F3’

LL68XFR (commercial code 34382)
Serial no: 50225.0001
Wiring: old 112896 – new 116177
Bit 100 Timer: old 111884(Rohs 143217)‘F1’ – new 115691(Rohs 143219)‘F3’

LD87IT (commercial code 28455)
Serial no: 50228.0001
Wiring: old 114546 – new 116174
Bit 100 Timer: old 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

LD87XIT (commercial code 28458)
Serial no: 50228.0001
Wiring: old 114546 – new 116174
Bit 100 Timer: old 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

LD87XEU (commercial code 28474)
Serial no: 50228.0001
Wiring : old 114546 – new 116174
Bit 100 Timer: old 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

LD87EU (cod. comm 28473)
Serial no: 50228.0001
Wiring: old 114546 – new 116174
Bit 100 Timer: old 111886(Rohs 143218)‘F2’ – new 116171(Rohs 143220)‘F4’

LD87XAUS (commercial code 29918)
Serial no: 50228.0001
Wiring: old 114551 – new 116173
Bit 100 Timer: old 111886(Rohs 143220)‘F2’ – new 116171(Rohs 143220)‘F4’

LL68FR (commercial code 34381)
Serial no: 50303.0001
Wiring: old 112896 – new 116177
Bit 100 Timer: old 111884(Rohs 143217)‘F1’ – new 115691(Rohs 143219)‘F3’

LV661AIX (commercial code 33945)
Serial no: 50704.0001
Wiring: old 113064 – new 119244
Bit 100 Timer: old 111886(Rohs 143220)‘F2’ – new 119420(Rohs 143221)‘F5’

LI661A (commercial code 33944)
Serial no: 60413.0001
Wiring: old 113080 – new 112909
Bit 100 Timer: old 099892(Rohs 143208)‘E3’ – new 119420(Rohs 143221)‘F5’

n1045091: Modification on: cutlery basket - upper basket folding shelf - basket handle.

Dishwashers affected by this bulletin have been equipped with the following parts:

-new cutlery basket colour SATIN BLUE replacement P/N 114049, premodification 086629 colour BLUE;
-new upper basket folding shelf, colour WHITE replacement P/N 114047, premodification 087979 colour BLUE;
-new upper/lower basket handle, colour SATIN BLUE, replacement P/N 114048, premodification 094922, colour BLUE.

Models LVO680DUOIX and BFT680X are exceptions, since on these two models two types of handle have been installed:
-new upper basket handle, colour SATIN BLUE, replacement P/N 114482, premodification 086480, colour BLUE;
-new lower basket handle, colour SATIN BLUE, replacement P/N 114048, premodification 094922, colour BLUE.

Also the following upper/lower basket combinations are affected by the modification:
Upper basket assemblies:
-new 114486 - premodification 109418 (EX 094862);
-new 114488 - premodification 109920.
Lower basket assemblies:
-new 114489 - premodification 095118.

The modification has been introduced starting from serial no. 41108.0001.

n1045099: Different position of electric distributor.

The position of the electric distributor has been changed as shown in the attached illustration.
The new machines have a new industrial code.

Introduced items:
C00118140 upper rack
C00109698 inside door


Premodification items:
C00114486 upper rack
C00095276 inside door

The following list shows the affected models with the relevant modification start serial numbers.

cc 34754 s/n 50414.0001 BFZ680X
cc 33616 s/n 50406.0001 LVR670AN
cc 33617 s/n 50422.0001 LVR670OW
cc 34142 s/n 50407.0001 CISLI700DUO
cc 30715 s/n 50325.0001 BFI680
cc 29514 s/n 50324.0001 LI680DUO
cc 33970 s/n 50324.0001 LIQ700DUOTI
cc 29515 s/n 50316.0001 LI700DUO
cc 33662 s/n 50316.0001 LVZ680DUOIX

N1045076FIG1

Mark II

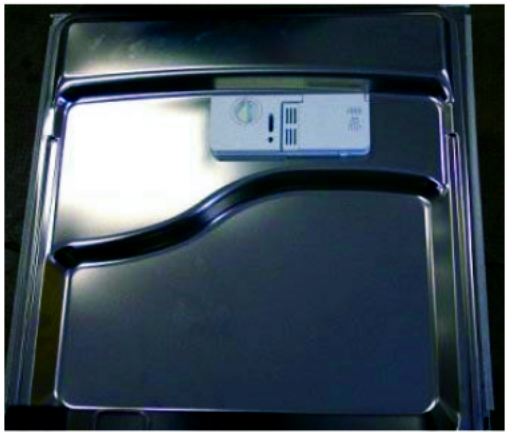

n1045127: New airbreak - solution of water spurts leaking from base LVS 60 CM

From serial number 50930.0001, to solve the problem of water spurts emitted from the lower right and left side of the door the following modifications were introduced in production:

1-Airbreak without insert to allow the necessary pressure venting
2-Honeycomb top panel to protect the kitchen unit from any steam emitted (only on built-under models)
3-Tank seal length increased by 3 cm to improve water tightness
4-Die-cut roof sound-deadening panel
5-Three clips for correct fixing of the tank base seal (in production from serial number 50701.0001)

New parts:
C00141308 - Airbreak
C00141310 - Honeycomb top panel (built-under versions only)

C00141317 - Tank seal
C00141314 - Roof sound-deadening panel
C00140679 - Tank base seal fixing clip

Premodification parts
C00110610 - Airbreak
C00116110 - Tank seal
C00097300 - Roof sound-deadening panel

1) AIRBREAK REPLACEMENT
It is mandatory to use the new part; in the event of replacement with premodification appliances proceed as follows:
- replace the airbreak with the new part C00141308
- if present, refit the roof sound-deadening panel after cutting out a 10x10 cm square from the rear left-hand corner
- on the built-under version, fit honeycomb panel C00141310 on the top of the appliance
- replace tank seal with the new seal P/N C00141317

WARNING: when replacing an airbreak without a litre-counter turbine use exclusively the same type of part (P/N C00094174 - all the relevant details are given in bulletin n1045085)

2) CHANGING THE TANK SEAL
On appliances with serial number from 40101.0001 to 50930.0001, you can use the new tank seal P/N C00141317 after cutting 1.5 cm off each end.

n1045135: New single-pole On/Off switch

The two-pole On/Off switch has been replaced by the single-pole switch.

New parts
Wiring
C00140609 - single-pole On/Off switch
C00063971 - single-pole On/Off switch
C00140607 - single-pole On/Off switch

Premodification parts
Wiring
C00041184 - two-pole On/Off switch
C00058465 - two-pole On/Off switch
C00096884 - two-pole On/Off switch

Models/serial nos. affected by modification:
cc29511 - s/n 60316.0001 - LI620
cc29930 - s/n 60323.0001 - DI6
cc29931 - s/n 60320.0001 - DI620
cc29943 - s/n 60401.0001 - LV640AWH
cc30300 - s/n 60401.0001 - LV660ABKFR
cc30301 - s/n 60401.0001 - LV660AIXFR
cc32006 - s/n 60305.0001 - IDL50EU.2
cc32215 - s/n 60306.0001 - IDL55EU.2
cc32221 - s/n 60307.0001 - IDL50SK.2
cc32271 - s/n 60322.0001 - IDLB2EU

cc33223 - s/n 60222.0001 - DVG622IX
cc33614 - s/n 60401.0001 - LVR640AAN
cc34119 - s/n 60307.0001 - IDL55IT.2
cc34120 - s/n 60309.0001 - IDL55SIT.2
cc34457 - s/n 60222.0001 - IDL502FR.2
cc34499 - s/n 60222.0001 - IDL50SEU.2
cc34518 - s/n 60222.0001 - L63EU.2
cc34865 - s/n 60222.0001 - IDL500FR.2
cc35314 - s/n 60306.0001 - IDL57PT.2
cc39329 - s/n 60222.0001 - IDL506FR.2
cc39330 - s/n 60306.0001 - IDL556FR.2
cc39331 - s/n 60306.0001 - IDL556SFR.2
cc30351 - s/n 60320.0001 - DI620UK
cc30708 - s/n 60401.0001 - BFI620
cc33182 - s/n 60222.0001 - FDW20P
cc34501 - s/n 60222.0001 - IDL535SUK.2
cc30715 - s/n 51115.0001 - BFI680
cc34753 - s/n 51115.0001 - BFQ700T/1
cc29514 - s/n 51115.0001 - LI680DUO
cc29515 - s/n 51115.0001 - LI700DUO
cc33970 - s/n 51115.0001 - LIQ700DUOTI
cc33955 - s/n 51115.0001 - LVTI12-67
cc37869 - s/n 51115.0001 - LI680PLUS
cc37873 - s/n 51115.0001 - LIQ700TIPLUS
cc34142 - s/n 51115.0001 - CISLI700DUO
cc37872 - s/n 51118.0001 - LI700PLUS
cc28472 - s/n 51121.0001 - LL65TK.2
cc33186 - s/n 51121.0001 - FDW65A
cc34380 - s/n 51121.0001 - LL66XFR
cc33183 - s/n 51122.0001 - FDW60P
cc33185 - s/n 51125.0001 - FDW60G
cc33184 - s/n 51201.0001 - FDW60T

n1045136: introduction of new high pressure sensor

In modified products the connector going to the high pressure sensor is part of the wiring assembly (see picture N1045136FIG1). In premodification products the high pressure sensor is connected to the wiring assembly by a cable that is part of code C00094157 (see pictures N1045136FIG2-3).

New parts
Wiring
C00142435 - high pressure sensor

Premodification parts
Wiring
C00094157 - high pressure sensor + cable


The new parts are not individually interchangeable with premodification ones.

Models / serial nos. affected by the modification:


cc29511 - s/n 60316.0001 - LI620
cc29930 - s/n 60323.0001 - DI6
cc29931 - s/n 60320.0001 - DI620
cc29943 - s/n 60401.0001 - LV640AWH
cc30300 - s/n 60401.0001 - LV660ABKFR
cc30301 - s/n 60401.0001 - LV660AIXFR
cc32006 - s/n 60305.0001 - IDL50EU.2
cc32215 - s/n 60306.0001 - IDL55EU.2
cc32220 - s/n 60306.0001 - IDL55DE.2
cc32221 - s/n 60307.0001 - IDL50SK.2
cc32224 - s/n 60401.0001 - IDL55SDE.2
cc32271 - s/n 60322.0001 - IDLB2EU
cc33223 - s/n 60222.0001 - DVG622IX
cc33614 - s/n 60401.0001 - LVR640AAN
cc34119 - s/n 60307.0001 - IDL55IT.2
cc34120 - s/n 60309.0001 - IDL55SIT.2
cc34457 - s/n 60222.0001 - IDL502FR.2
cc34458 - s/n 60306.0001 - IDL552FR.2
cc34499 - s/n 60222.0001 - IDL50SEU.2
cc34518 - s/n 60222.0001 - L63EU.2
cc34865 - s/n 60222.0001 - IDL500FR.2
cc35314 - s/n 60306.0001 - IDL57PT.2
cc39329 - s/n 60222.0001 - IDL506FR.2
cc39330 - s/n 60306.0001 - IDL556FR.2
cc39331 - s/n 60306.0001 - IDL556SFR.2
cc30351 - s/n 60320.0001 - DI620UK
cc30708 - s/n 60401.0001 - BFI620
cc33182 - s/n 60222.0001 - FDW20P
cc34501 - s/n 60222.0001 - IDL535SUK.2
cc30715 - s/n 51115.0001 - BFI680
cc34753 - s/n 51115.0001 - BFQ700T/1
cc29514 - s/n 51115.0001 - LI680DUO
cc29515 - s/n 51115.0001 - LI700DUO
cc33970 - s/n 51115.0001 - LIQ700DUOTI
cc33955 - s/n 51115.0001 - LVTI12-67
cc37869 - s/n 51115.0001 - LI680PLUS
cc37873 - s/n 51115.0001 - LIQ700TIPLUS
cc34142 - s/n 51115.0001 - CISLI700DUO
cc37872 - s/n 51118.0001 - LI700PLUS
cc28472 - s/n 51121.0001 - LL65TK.2
cc33186 - s/n 51121.0001 - FDW65A
cc34380 - s/n 51121.0001 - LL66XFR
cc33183 - s/n 51122.0001 - FDW60P
cc33185 - s/n 51125.0001 - FDW60G
cc33184 - s/n 51201.0001 - FDW60T
cc30299 - s/n 60418.0001 - LV660AWHFR
cc29939 - s/n 60421.0001 - LV620BK
cc29940 - s/n 60421.0001 - LV620WH
cc29941 - s/n 60421.0001 - LV620IX
cc29946 - s/n 60422.0001 - LV640AIX
cc29942 - s/n 60424.0001 - LV640ABK
cc29512 - s/n 60501.0001 - LI640A
cc33942 - s/n 60501.0001 - LI641A
cc40916 - s/n 60502.0001 - L6064EU
cc40911 - s/n 60502.0001 - L6061EU
cc37341 - s/n 60502.0001 - L62IT.2
cc35316 - s/n 60502.0001 - L61EU.2

cc29907 - s/n 60502.0001 - L61AG
cc34283 - s/n 60529.0001 - IDL52EU.2
cc41049 - s/n 60605.0001 - L65IT
cc42062 - s/n 60701.0001 - DI650A


N1045136FIG1

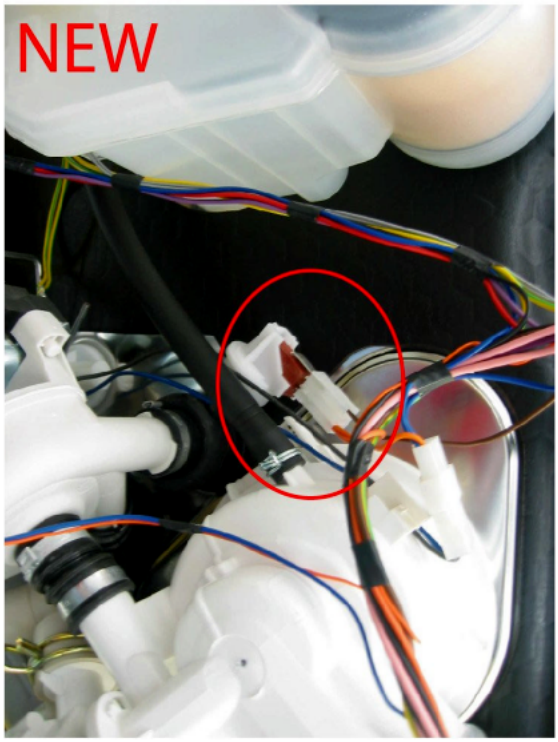

N1045136FIG2

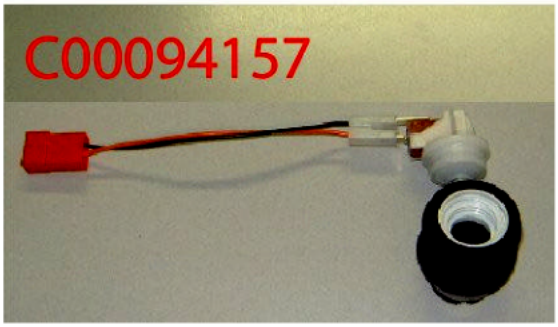


N1045136FIG3

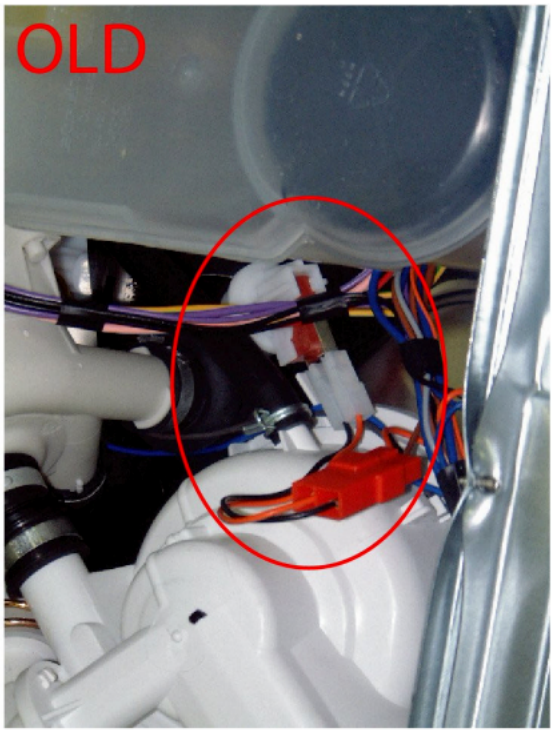

Electric schemes and links

Cod. 16001651900

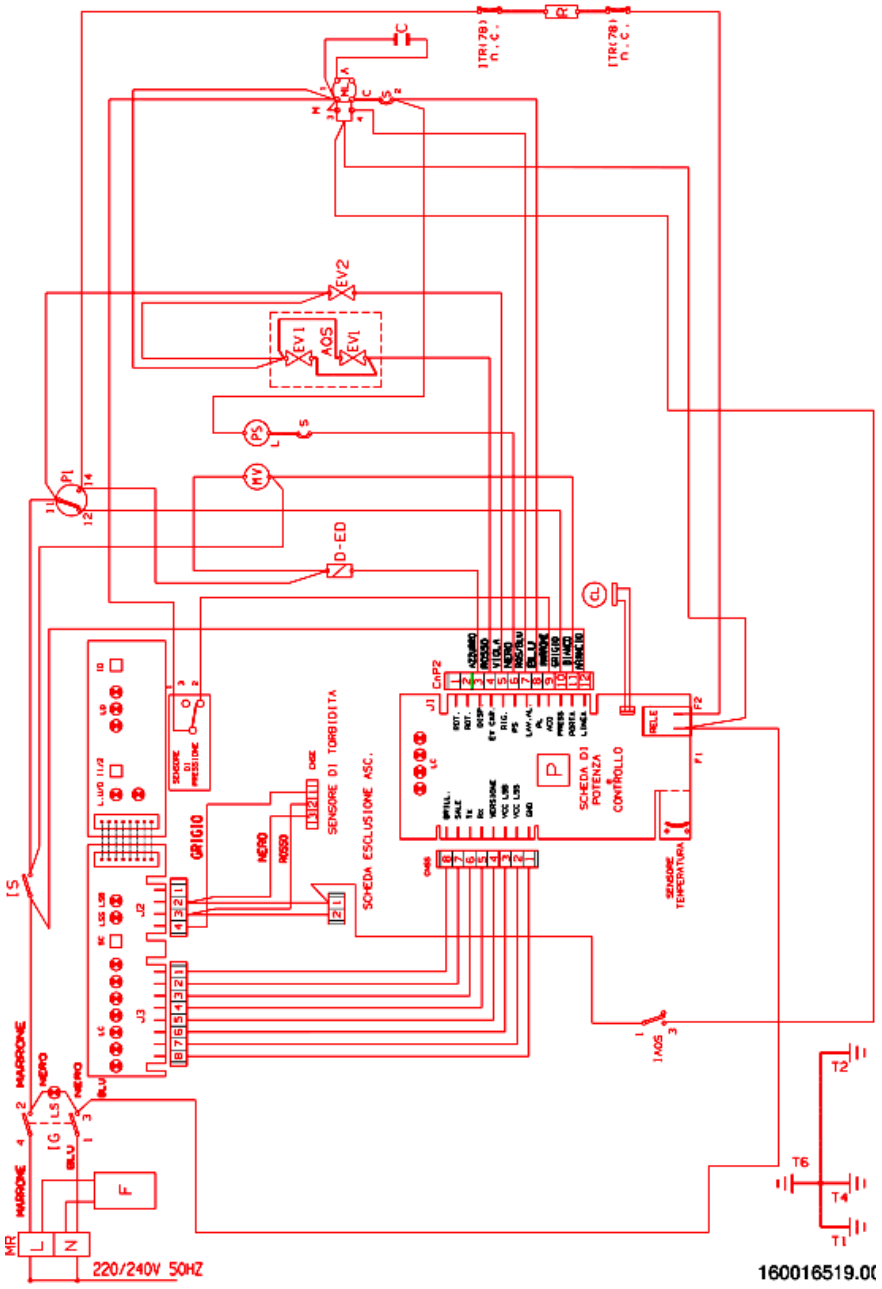

Legend

Legend: 16001651900

A..	Timer contact	LPA	Door open
AQS	Aquastop electrovalve	LPR	Prewash LED
B..	Timer contact	LRI	Rinse LED
C	Condensor	LS	Mains LED -Pilot lampe On/Off
C..	Timer contact	LSB	Polisher LED
CL	Slow cam	LSC	Cycle ranning lamp
CM	Wash pump motor connector	LSE	Acquastop LED
CN	Connector	LSS	Salt LED
CV	Fast cam	LV	Fan off lamp
D-ED	Dispenser - Electric dosing device	M	Terminal box
D..	Timer contact	MB	Polisher dip-switch
DB	Brightener dispenser	ME	Acquastop dip-switch
DD	Display - Detergent dispenser	ML	Wash motor
E1	Cold water electrovalve	MM	Handle dip-switch
E2	Regeneration electrovalve	MP	Door dip-switch
E3	Hot water electrovalve	MR	Delay-timer motor - Terminal board
ECO	Saving switch	MT	Timer motor
ED	Detergent/Brightener dispenser	MTR	Fast forward timer motor
EV1	Cold water electrovalve MM- Handle dip-switch	MV	Motor fan
EV1/2	Half-load electrovalve	P	Pressure switch
EV2	Regeneration electrovalve	P..	Pressure switch contact
EV3	Hot water electrovalve	P1	Stage 1 pressure
EVC	Hot water electrovalve	P2	Stage 2 pressure switch
EVF	Cold water electrovalve	PAP	High pressure switch
EVR	Regeneration water electrovalve	PO	Overflow pressure switch
F	Anti-interference filter ML- Wash motor	PS	Drain pump
FA	Radio interferences	PULS	Push-button panel
I1	On/Off switch - Plus cycle switch -IEC cycle	R	Heating element
I1/2	Switch half-load	R.D.	Delay rotary selector
I2	Fast switch -IEC cycle switch (standard) -	RA	Heating element drying
I2H	2-hour delay switch	ROT D	Delay rotary selector
I3	Saving switch- Switch for cycle with no pre-	ROT.	Rotary selector
I4	Switch for cycle fresh dirty	S	Motor overload cutout

I4H	4-hour delay switch	SC	Selector cycli
I5-ICR	Fast cycle switch	SS	Salt detector
I6	Soak cycle switch	ST	START
I6H	6-hour delay switch	T..	Delay-tymer contact
IAQS	Aquastop switch	T1	Power supply earth cable -Thermostat 45?C
ID	Switch display	T2	Lid earth -Thermostat 55?C
IE	Saving switch	T3	Timer earth -Thermostat 65?C
IEXD	Exstra dray switch	T36	36?C N.O. Thermostat
IG	Main switch	T4	Heating element earth
IMV	Off motor fan switch	T46	46?C N.O. Thermostat
IP	High temperature switch	T5	Drain pump earth
IS	Cut-off switch	T57	57?C N.O. Thermostat
ISB	Polisher led switch	T6	Wash motor earth
ISS	Salt LED switch	T8	External lid earth
ITR	Heating element switch	TE	Relay switch
L	Mains LED	THP	Thermoprotector
L1	Cycle 1 lamp	TM	Timer
L1/2	Lamp cjcle half-load	TS	Safety thermostat
L2	Cycle 2 lamp	TS 40	Thermostat 40 ?C
L3	Cycle 3 lamp	TS 50	Thermostat 50 ?C
L4	Cycle 4 lamp	TS 62	Thermostat 62 ?C
L5	Cycle 5 lamp	TS1	Min. temperature thermostat
L6	Cycle 6 lamp	TS2	Max. temperature thermostat
LA	Drying LED	TT	Terminal box support earth
LAQ	Aquastop on lamp	Tcp	nner-door earthing connection
LC	Cycle ranning lamp	Tfa	Radio interference
LD	Delay activated lamp	Tml	Pump wash motor earthing connection
LE	Saving cycle	Tpg	Large door earthing connection
LH2	2-hour delay lamp	Tpi	Inspection door earthing connection
LH4	4-hour delay lamp	Tpr	Pressure switch
LH6	6-hour delay lamp	Tps	Discharge pump earthing connection
LL	Wash LED	Tr	Heating element
LP	High temperature LED	Tte	Delay-timer earthing connection