
INDESIT company

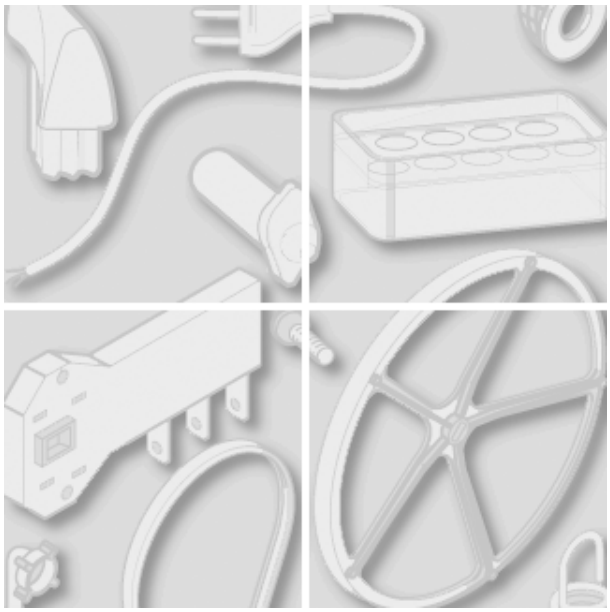

Model type:
IDL50EU.2

Commercial code:
F032006

General notes

Technical Documentation guidelines

You can find herewith some generic information to simplify cunsulting of technical documentation:

1. Models of same range share the same exploded views, which report the richest set of spare parts:generally, a model does not necessarly have a related spare part for each particular shown on exploded views.

2. Some spare parts can not be represented directly on the exploded views (instruction booklets, specific kit, etc...). You can find those codes in the spare parts list with the same reference of particular where spares are installed or with references 099, 999. Instruction booklets, once managed, appear with 000 reference.

3. On the higher right site of each exploded view there is a serial number which indicates the beginning of the production of certain range:some models might have more than an exploded view for a given category, each distinguished by a different serial no.and linked to another spare parts list, In this case, serial no. is required to supply the right spare part code. Exploded view to be considered is the one with a more recent serial no. but previous than the one of the model that needs assistance.

4.Exploded views might require further updates even after publishing. Addition of new spares will go on following the already existing numeration references. Revision number of an exploded view is shown into last four digits of serial number into upper right hand corner.

5.The spare parts list associated to an exploded view shows related codes of spares managed for a certain model; for each spare part other informations are available:


REF: reference no of spare into a table; SUBSTITUTE: list of spare(s) which can replace a code but that keeps same functional characteristics

INDUSTRIAL CODE: list of variables of a model (shown into model label) where such spare is used; NOTICE: code of information(s) to refer to complete technical intervention, track for changes or to find correct spare part code.

6. Some notices, into a same section are generic therefore cannot be directly linked to a spare part. In order to assist a model in the best way as possible, it is helpful to pay attention to all notices and constantly verify documentation updates

7.Technical documentation cover shows model name and its commercial codes

2220110 Exploded views

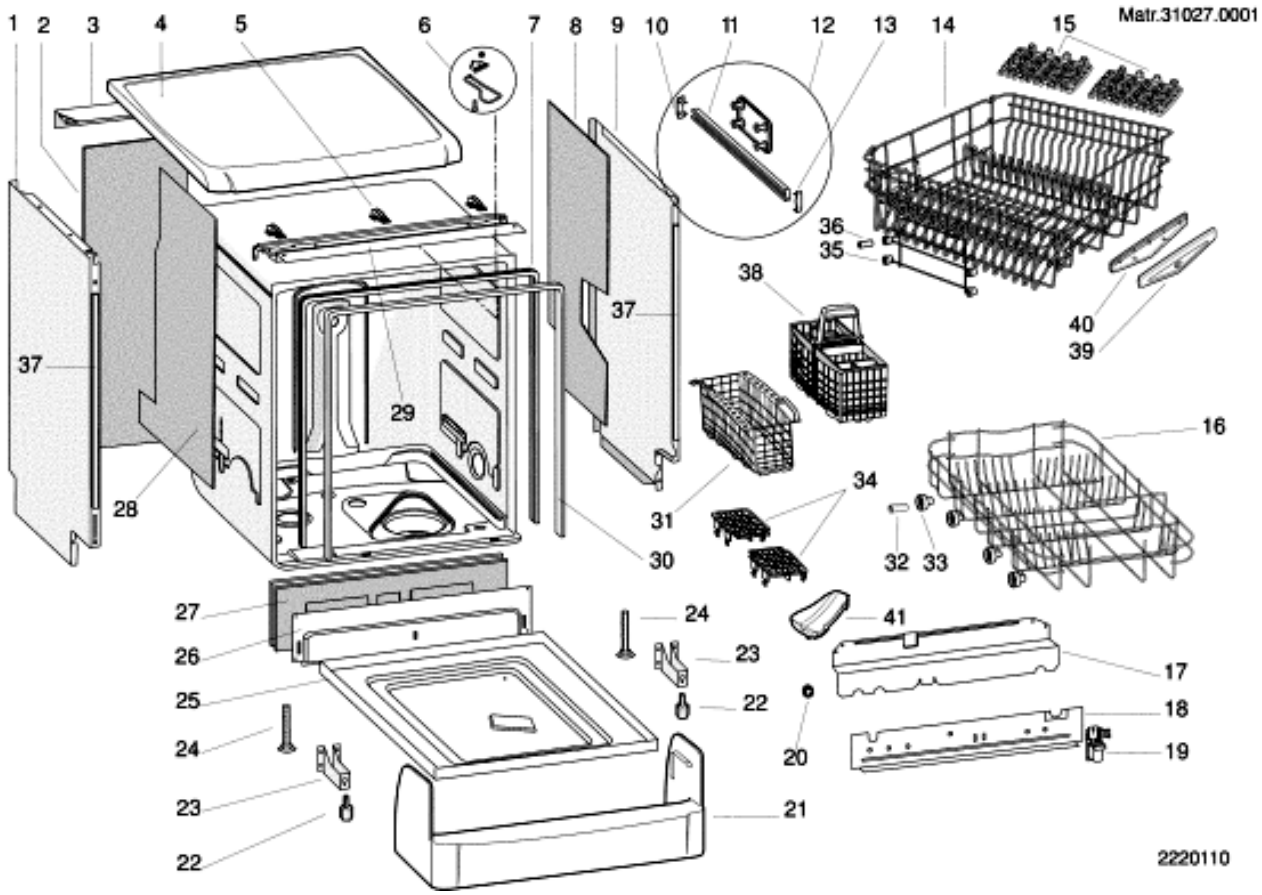


2220110 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
000	C00098028				instruction book it-gb-fr-de-nl-es-		
000	C00099843				instruction book bu-pl-hr-sb-sl-tk		
001	C00092417	60406...		1 x C00093154	left side panel lh polar		37320060900
001	C00092823		60405...	1 x C00092833	left side panel lh white27		37320060000
							37320060100
002	C00075715				rear cover		
003	C00033591				rear support - top		
004	C00097478		60405...	1 x C00142986	cover white27 'indesit evo3'		37320060000
							37320060100
004	C00142986	60406...			cover white(pw) 'indesit evo3'		37320060900
005	C00057504				hook - top cover retention		
006	C00085024			1 x C00037135	catch plate (cabinet)		
				1 x C00297907			
				1 x C00297909			
				1 x C00297910			
007	C00116110			1 x C00141317	door seal - top and sides mm1608	n1045127	
007	C00141317				top and side door seal (1638mm)	n1045127	
009	C00092418	60406...		1 x C00093154	right side panel polar		37320060900
009	C00092824		60405...	1 x C00092833	right side panel white27		37320060000
							37320060100
010	C00094117				rail back stop evo3		
011	C00094116			1 x C00094112	basket runner - upper evo3		
012	C00094112				runner assembly		
013	C00094118				runner end stop		
014	C00108980			1 x C00297566	upper basket noclik/clak markii		
015	C00053522			1 x C00056438	flap upper basket white27		
016	C00056397			1 x C00054825	lower basket 'lsv61ix'		
017	C00091600				rear support - middle		
018	C00091601				lower rear support hot or cold		
019	C00076659			1 x C00143383	radio interference suppressor		
020	C00054830				drain hose fastener		
021	C00097476		60405...	1 x C00143005	plinth panel swell white27 indesit		37320060000
							37320060100
021	C00143005	60406...			plinth panel swell		37320060900
022	C00056414			1 x C00104611	adjustable foot - all plastic	n1045080	

2220110 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
022	C00109991				adjustable foot	n1045080	
023	C00056010				foot support x		
024	C00092555				foot 155mm	N1045072	
025	C00092554			1 x C00118842	tray on bottom of tub 60cm		
026	C00091599			1 x C00119016	front support lower 60cm		
029	C00079013				door spring adjuster		
030	C00054932				frame support for tub seal 60cm	n1045047	
032	C00104638				basket roller axis		
033	C00056347				lower basket wheel		
034	C00078869				cutlery basket divider		
035	C00094191			1 x C00109840	upper basket roller evo3		
036	C00094189				roller axle upper basket		
037	C00082457				sponge		
038	C00079023			1 x C00094297	cutlery basket		
042	C00054833				top for front support		
099	C00094138				lower basket buffer evo3		

2220210 Exploded views

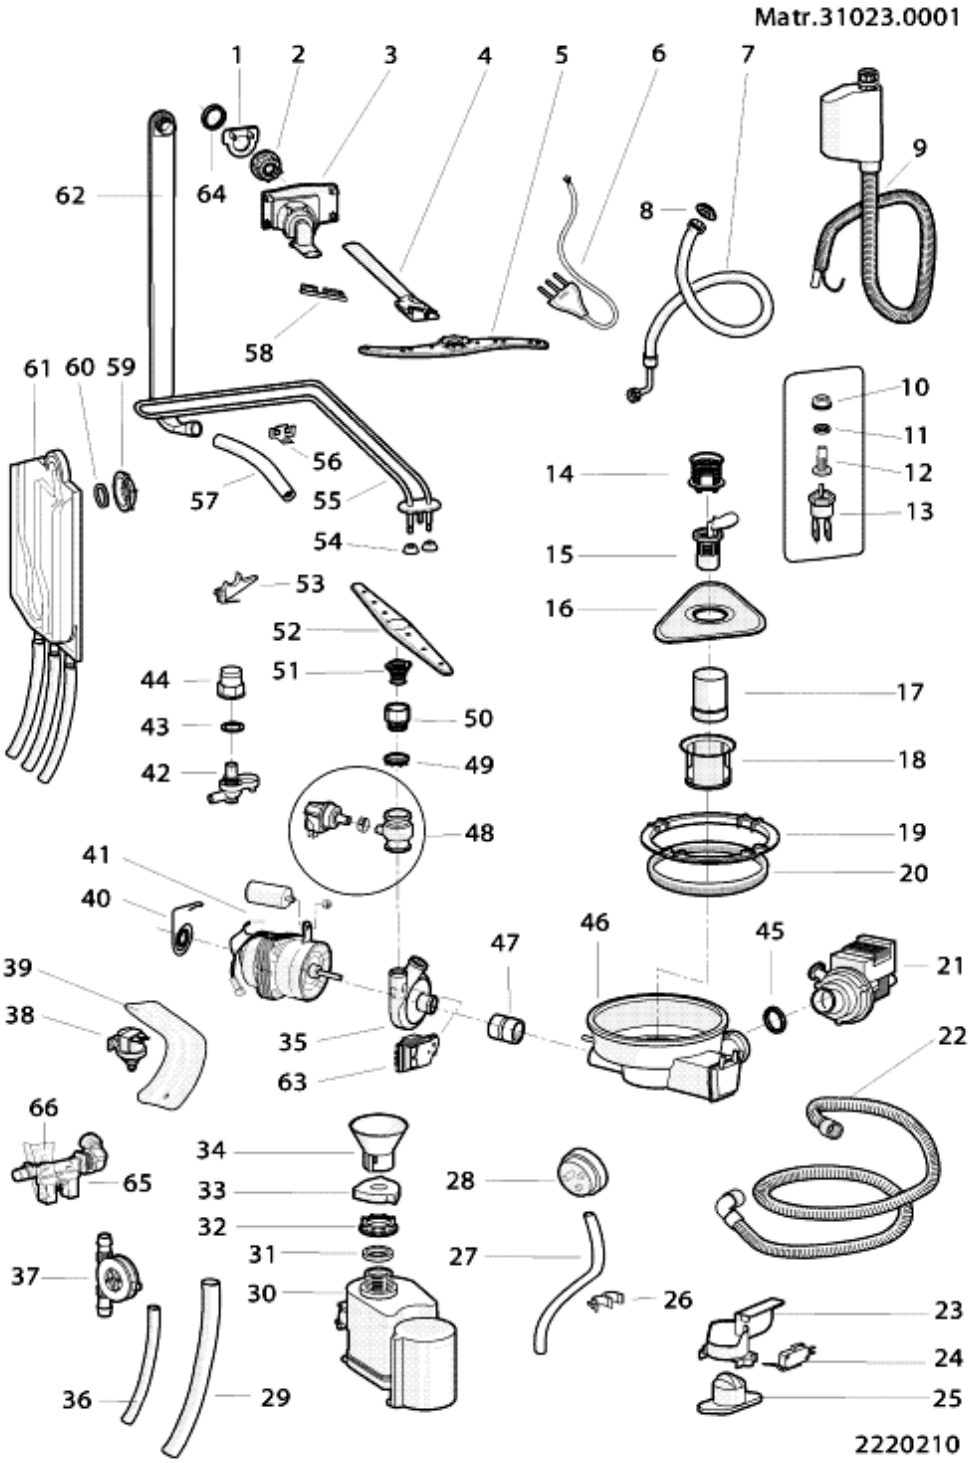

2220210 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
001	C00054925				upper was basket guide casing		
002	C00144315				top spray arm nut with seal (rohs)		
003	C00094134			1 x C00110526 1 x C00110527	water supply distribution assembly	n1045084	
003	C00110526				water supply distribution assembly		
004	C00054926			1 x C00110526 1 x C00110527	upper wash arm feed pipe	n1045084	
004	C00110527				upper wash arm feed pipe		
005	C00075746				upper wash arm curved set		
006	C00143371			1 x C00280937	supply cable schuko rohs		
007	C00009415			1 x C00144176	mains inlet hose hot 1500mm		
008	C00018315			1 x C00005781	sealing washer+filter - mains inlet		
010	C00097871				lock nut m8 + washer 'lvs'		
011	C00063792				seal o-ring		
012	C00063791				temperature sensor		
013	C00041086				thermostat safety 78ønc (dw)		
013	C00063788			1 x C00097871	lock nut m8 inox		
013	C00063790				washer d.8 mm inox		
014	C00094158			1 x C00142344	filter grid evo3	n1045083	
015	C00054863			1 x C00142344	central filter		
015	C00094156			1 x C00142344	central filter basket/retainer evo3	n1045083	
016	C00145075				stainless steel outlet filter		
017	C00081164			1 x C00142344	filter cylindrical		
017	C00094164			1 x C00142344	filter cylindrical evo3	n1045083	
018	C00061929				outer fine rotating polyester filter		
019	C00054854				sump fixing ferrule		
020	C00054828				gasket - sump fixing ring		
021	C00118767	60305...		1 x C00143766	drain pump v220-240 50hz		
021	C00143739		60304...		drain pump 230v 50hz evo3 rohs	n1045133	
022	C00054869				drain hose		
023	C00081162				container - overflow unit		
024	C00143107				microswitch acquastop rohs		
025	C00058843				float - overflow unit		
026	C00095801				pressure hose clip evo3		
027	C00094154				pipe pressostat lvs evo3		

2220210 Spare parts list


Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
028	C00143740				pressure switch 90 71 evo3 rohs		
029	C00094267				tube water inlet air-break/turbine	n1045085	
029	C00110612			1 x C00111855 1 x C00115348	tube water inlet electrovalve/air-	n1045085	
030	C00094171				water softener adjustable evo3		
031	C00103610				seal - softener/wash chamber		
032	C00144235				retaining ring - softener rohs		
033	C00041088				salt cap		
034	C00005819				salt funnel		
035	C00055005				pump cover		
036	C00054868				tube - softener/sump l.(480mm)		
037	C00094172				turbine evo3	n1045085	
038	C00094227				electrovalve 1e 1u evo3	n1045085	
038	C00110611				inlet valve	n1045085	
039	C00094160				protection electrovalve evo3		
040	C00076628				tub spring		
041	C00076627				wash motor/pump assy 220v-60w		
042	C00094159		60903...		overflow connector evo3		
042	C00196353	60904...			overflow connector evo3		
043	C00075695				connection gasket overflow		
044	C00143580		60903...		bodytop overflow evo3 rohs		
044	C00196352	60904...		1 x C00094159 1 x C00143580	bodytop overflow evo3 rohs		
045	C00054917				seal 'o'ring (23,81x2,62)		
046	C00094143			1 x C00141158	set sump evo3		
047	C00079016				pipe rubber sump-pump		
048	C00094157		60304...	1 x C00142435 1 x C00144125	high pressure sensor assembly	n1045136	
048	C00142435	60305...			high pressure sensor assembly		
049	C00144189				cap corner for supp.wash.blade		
050	C00144196				support - lower wash arm bush		
051	C00066642			1 x C00075111	ring-nut for fastening bottom		
052	C00075108				lower wash arm inox 60cm		
054	C00074714				terminal protection - heating		
055	C00046319			1 x C00066598	heating element 2000w/230v		

2220210 Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
056	C00054872				support bracket - heating element		
057	C00076233				pump junction pipe		
058	C00056342				steel pin fixing upper wash arm	n1045084	
059	C00054927			1 x C00144335	ring-nut for air-flow body		
060	C00084600				o ring seal 38 mm		
061	C00094174				water inlet air break evo3	n1045085	
061	C00110610			1 x C00115360	air break + turbine evo3	n1045085 n1045127	
061	C00141308			1 x C00141655	air break + turbine evo3	n1045127	
062	C00056001				upper wash arm feed pipe		
067	C00098769				upper wash arm seal		
099	C00033026			1 x C00292523	ambljgon grease ta 100 gr.		
099	C00073917				clamp for pump cover		
099	C00075879				clamp		
099	C00084479				hose clamp		
099	C00094150				clip pressure sensor evo3		
099	C00094162				pipe fixing band on turbine		

2220310B Exploded views

Matr.40311.0001

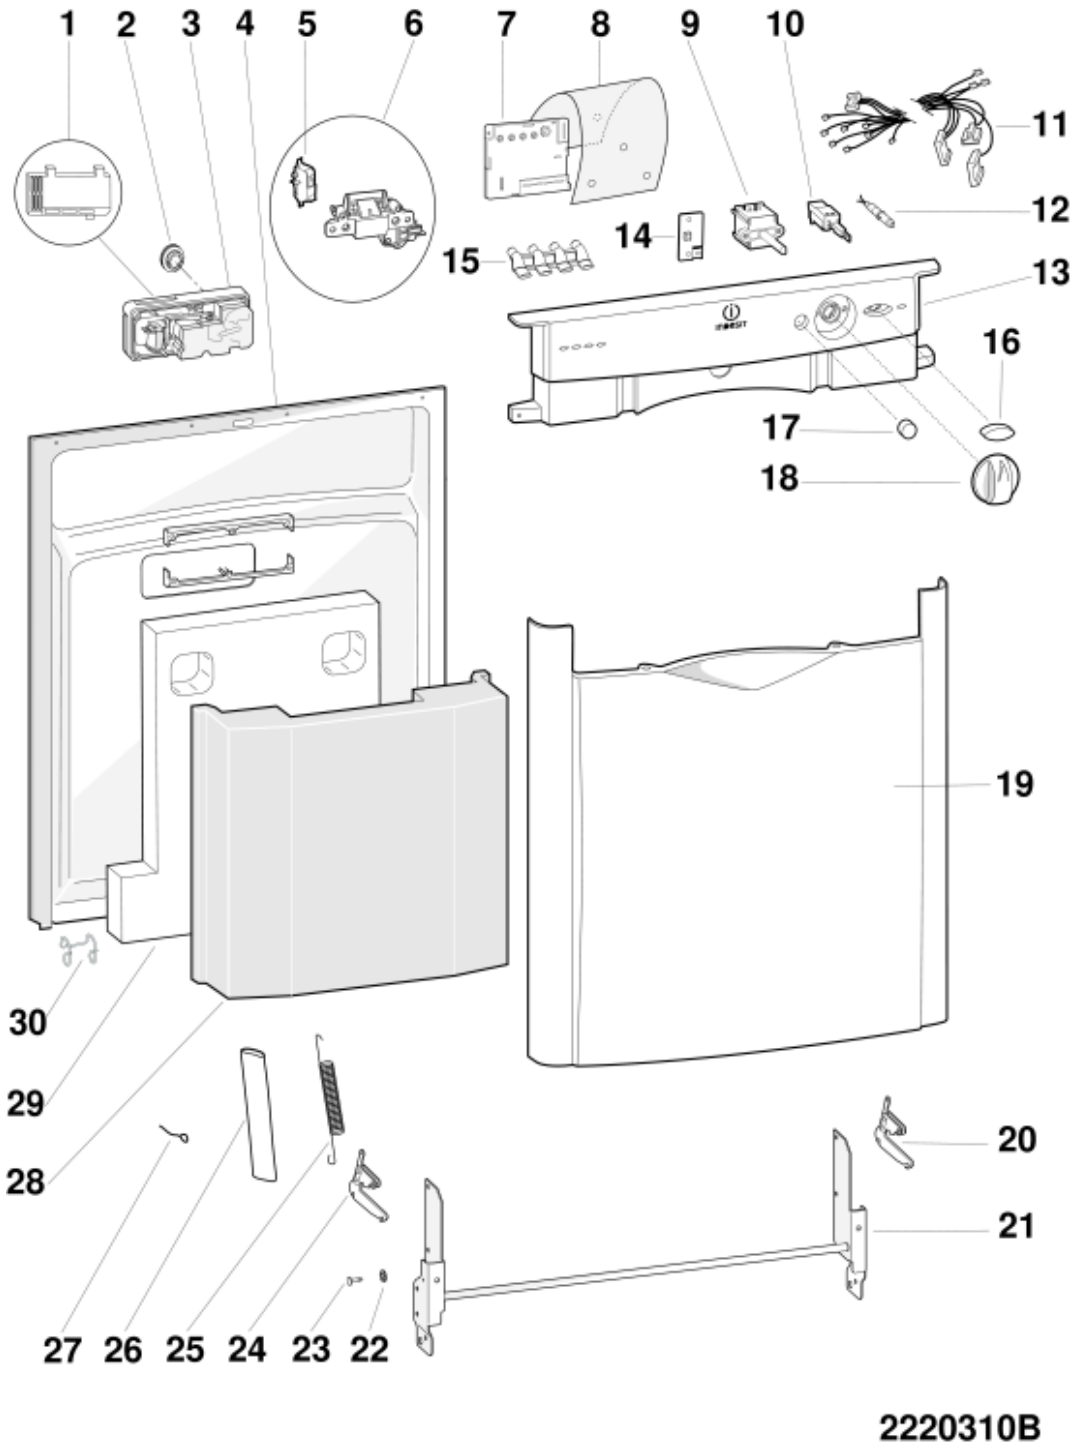

2220310B

Spare parts list

Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
001	C00098134				door detergent electrodispenser		
002	C00051755				rinse aid cap (pair) raised & flush		
003	C00094133			1 x C00143377	electrodispenser(lamp rinseaid-no		
004	C00091543			1 x C00290247	door seal lower 60cm		
004	C00108981			1 x C00290242	inner door panel		
005	C00085358				microswitch		
006	C00094128			1 x C00195887	locking assembly evo3		
007	C00108957				bracket for timer bit 100		
007	C00143207				timer bit100.1 'e2' rohs +	n1045079	
007	C00143211				timer bit100.1 's1' rohs +	n1045079	
009	C00084910			1 x C00084912	8 functions selector		
010	C00096884		60304...	1 x C00142650	on-off switch (double pole)	n1045135	
010	C00140607	60305...			on-off switch (unipolar)		
011	C00112915		60304...		wiring harness assembly		
011	C00143758	60305...			parallel wiring harness assembly		
012	C00096881			1 x C00112262	pilot light red 230v ra2,5 ind.		
013	C00098029		60405...	1 x C00143015	dashboard white27 idl50eu		37320060000 37320060100
013	C00143015	60406...			dashboard white(pw)		37320060900
014	C00143541				start/reset pcb card		
015	C00097419				light track lamp 'indesit' evo3		
016	C00097418		60405...	1 x C00143006	white27 push button on-off indesit		37320060000 37320060100
016	C00143006	60406...			on-off push button - white		37320060900
017	C00097417		60405...		white push-button start		37320060000 37320060100
017	C00143007	60406...			white(pw) push-button indesit		37320060900
018	C00097475		60405...	1 x C00143003	knob white27 indesit evo3		37320060000 37320060100
018	C00143003	60406...			knob - white		37320060900
019	C00097474		60405...	1 x C00143000	white27 door shell bowed indesit		37320060000 37320060100
019	C00143000	60406...			bowed outer door shell - white		37320060900
020	C00065127			1 x C00054815	hinge item, right		
021	C00096996				hinge assembly 'lvs evo3'		

2220310B Spare parts list


Ref.	Code	From	To S/N	Substitute	Description	Notice	Industrial
022	C00058776				washer d = 6 mm		
023	C00048504				hinge pin		
024	C00065128			1 x C00054817	hinge item, left		
025	C00075689				door spring		
026	C00066426				tube hinge spring		
027	C00075693				gaffel x door spring		
028	C00108978				door spacer assy indesit evo3		
030	C00140679				seal spring	n1045127	
099	C00076108			1 x C00012687	screw canoe klip		
099	C00084911			1 x C00304782	screw 3.5x9.5		
099	C00094120				fixing bolt inner door/dashboard		
099	C00094141				fixing screw inner/outer door		
099	C00111286				transparent door lvs evo3 60cm ##		

Notices

N1045072: Introduction of fixed rear foot H=31mm on free-standing models.

From serial no. 40218.0001, free-standing dishwashers affected by this modification have been equipped with new fixed rear feet (H=31mm).
The new foot replaces the adjustable one (H=155mm) Service code 092555; on the EVO3 range with TurboDry the new foot replaces the adjustable foot (H=95mm) Service code 094605.
The Spare Part Warehouse will continue to manage only 155mm and 95mm adjustable feet as they are interchangeable with the fixed 31mm foot.
The three feet are shown in illustration N1045072FIG1.

N1045072FIG1

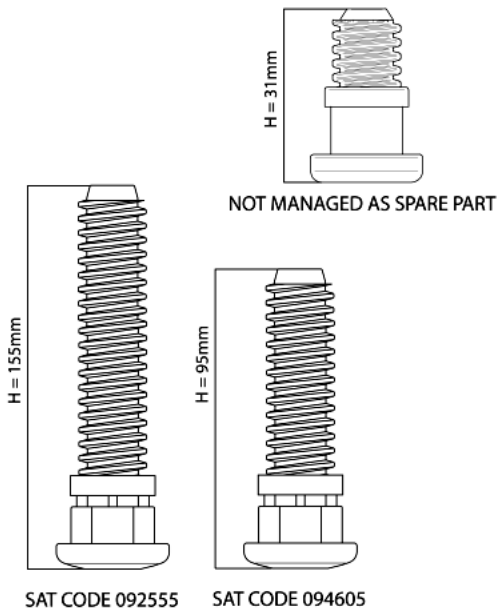

n1045048: BIT 100 CARD INITIALIZATION

Free-standing dishwasher

1- Close the door and switch the dishwasher on.
2- Wait for the test cycle to start (2 LEDs light up or "ROD" appears on dishwashers with display).
3- Wait 10 seconds (dishwasher will start to fill water...)
N.B. If the cycle fails to start the card has probably already initialized, so proceed to point 5.
4- To reset the test cycle turn the programme button to reset or hold down the start/reset button for 5 seconds. (Wait for the buzzer to beep three times or if the dishwasher does not have a buzzer, wait for the programme LEDs to switch off.)
5- To check the aforementioned steps have completed successfully, select a programme and see if it starts; (reset it after this check).
6- The dishwasher is ready for the customer.

Built-in dishwashers

1- Close the door and switch the dishwasher on.
2- Wait for the test cycle to start
3- Wait 10 seconds (the dishwasher will start to fill...)
N.B. If the cycle fails to start the card has probably already initialized, so proceed to point 5.
4- To reset the cycle, open the door (2 LEDs lit up) and press the programme button for three bips of the buzzer (or until the programme LEDs go off for dishwashers with no buzzer).
5- To check the aforementioned steps have completed successfully, press the select programme button and check that the indicator light beside the corresponding programme comes on.
6- The dishwasher is ready for thecustomer.

n1045079: Introduction of timer BIT100 'S1'

All models affected by this note have been equipped with timer BIT100 S1 spare part code 109875, which is not interchangeable with the premodification item.
The wiring assemblies have been modified with the introduction of a model recognition resistance. The new wiring assemblies are not interchangeable with the old ones.
All INDESIT FREE-STANDING models have maintained the same wiring assembly, as it is already provided with the model recognition resistance.

Given below is the list of affected models with related modification introduction serial numbers and spare part codes of modified items:

IDL505SUK.2 commercial code 32001 (S/n 40423.0001);
IDL500UK.2 commercial code 31984 (S/n 40423.0001);
IDL500UK.2T commercial code 32554 (S/n 40423.0001);
IDL50EU.2 commercial code 32006 (S/n 40423.0001);
IDL50SK.2 commercial code 32221 (S/n 40423.0001);
IDL51EU.2 commercial code 32217 (S/n 40423.0001);
IDL61EU.2 commercial code 32218 (S/n 40423.0001);
IDL500FR commercial code 30014 (S/n 40423.0001);
IDL50EU commercial code 30217 (S/n 40423.0001);
Timer: premodification 097481 (rohs 143207), new 109875 (rohs 143211).

L63EU commercial code 29544 (S/n 40423.0001);
DWF40P.2 commercial code 32229 (S/n 40427.0001);
Timer: premodification 097890 (rohs 143206), new 109875 (rohs 143211);
Wiring : premodification 094729, new 109952.

DV640AIX commercial code 30368 (S/n 40423.0001);
Timer: premodification 097890 (rohs 143206), new 109875 (rohs 143211);
Wiring: premodification 099260, new 109953.

DV620WH commercial code 29928 (S/n 40505.0001);
DV620WHUK commercial code 30348 (S/n 40505.0001);
DV620BK commercial code 29927 (S/n 40505.0001);
DV620BKUK commercial code 30349 (S/n 40505.0001);
DV620IX commercial code 29929 (S/n 40505.0001);
DV620KIXUK commercial code 30350 (S/n 40512.0001);
Timer: premodification 097890 (rohs 143206), new 109875 (rohs 143211);
Wiring: premodification 097091, new 110292.

DV630AIX commercial code 30693 (S/n 40602.0001);
DV630AWH commercial code 30694 (S/n 40602.0001);
DV630ABR commercial code 30695 (S/n 40602.0001);
DV650AIX commercial code 30696 (S/n 40602.0001);
DV650AWH commercial code 30697 (S/n 40602.0001);
DV650ABR commercial code 30698 (S/n 40602.0001);
Timer: premodification 097890 (rohs 143206), new 109875 (rohs 143211);
Wiring: premodification 099606, new 111098.


L61EU commercial code 28470 (S/n 40506.0001);
L61IT commercial code 28169 (S/n 40506.0001);
L61AG commercial code 29907 (S/n 40506.0001);
Timer: premodification 097890 (rohs 143206), new 109875 (rohs 143211);
Wiring: premodification 094237, new 110293.

LVI12-44AN commercial code 29564 (S/n 40510.0001);
LVI12-44IX commercial code 29562 (S/n 40510.0001);
LVI12-44WH commercial code 29563 (S/n 40510.0001);
Timer: premodification 097890 (rohs 143206), new 109875 (rohs 143211);
Wiring: premodification 096883, new 110498.

n1045080: Modification of front feet on free-standing DW.

From serial no. 40413.0001, free-standing dishwashers affected by this modification have been equipped with new front feet Service code 109991 in place of 056414.
The new foot is shown in fig. N1045080FIG1.

N1045080FIG1

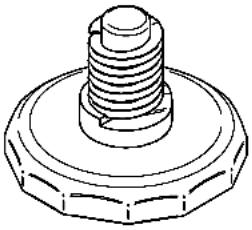

SAT CODE 109991

n1045083: Modification of filters on EVO3 60 cm dishwashers

All dishwasher models affected by this modification have been equipped with the items listed below, in order to solve the drain pump clooging problem.

Introduction of:
Cylindrical plastic filter code 081164
Central filter code 054863

Elimination of:
Cylindrical plastic filter code 094164
Central filter code 094156
Central filter grid code 094158


The modification has been introduced progressively, starting from serial no. 40516.0001.

n1045084: Elimination of duct fixing pin code 056342

Duct fixing pin code 056342 has been eliminated from all dishwashers affected by this note, modifying the connection between the feeder-distribution assembly and the internal duct.

Introduced items:
Internal duct 110527
Feeder-distribution assembly 110526

N1045083FIG1

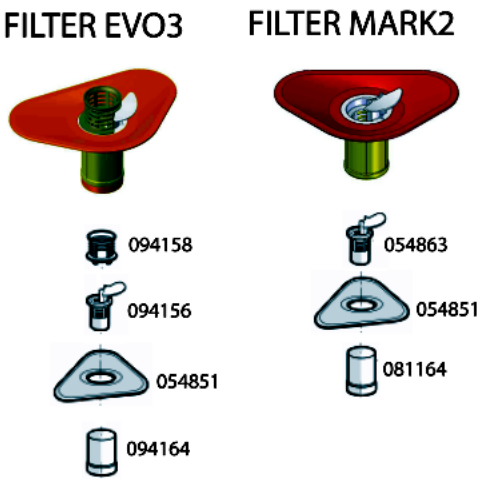

Eliminated items:
Internal duct 054926
Feeder-distribution assembly 094134 (EX 054871)
Duct fixing pin 056342

The modification has been introduced progressively, starting from serial no. 40517.0001.

n1045085: Introduction of new litre counter turbine integrated on air-break.

All dishwashers affected by this note have been equipped with a new litre counter turbine on the air-break.
Picture N1045085FIG1 illustrates the premodification structure, picture N1045085FIG2 the new structure.

Items affected by the modification.

AIR-BREAK:
new 110610;
premodification 094174;
the new item features a new integrated litre counter turbine and its water supply hose has a smaller diameter.

LITRE COUNTER TURBINE code 094172 has been eliminated.

SOLENOID VALVES:
new:
1-WAY code 110611;

2-WAY code 084558(Rohs 143737);
premodification:
1-WAY code 094227;
2-WAY code 094168;
the new solenoid valves have a smaller diameter drain hose fitting.

HOSES:
new solenoid valve hose/air-break code 110612;
premodification turbine hose/air-break code 094267;
premodification solenoid valve hose/air-break code 094267;
the new hose has a smaller internal diameter.


WIRING:
the litre counter turbine connecting cable is longer, but since the connector is the same, the new item can be used in place of the premodification one.


Affected models with related modification introduction serial numbers:
BCI 450 - 30386 s/n 41001.0001;
BFI 620 - 30708 s/n 41001.0001;
BFI 680 - 30715 s/n 40902.0001;
BFV 620 B - 30718 s/n 41001.0001;
BFV 620 K - 30717 s/n 41001.0001;
BFV 620 W - 30719 s/n 41001.0001;
BFV 620 X - 30720 s/n 41001.0001;
DI 6 - 29930 s/n 41001.0001;
DI 620 A - 29932 s/n 40830.0001;
DI 620 - 29931 s/n 41001.0001.
DI 620 UK - 30351 s/n 41001.0001;
DI 630 A - 30369 s/n 41001.0001;
DV 620 BK - 29927 s/n 41001.0001;
DV 620 BK UK - 30349 s/n 41001.0001;
DV 620 K IX UK - 30350 s/n 41001.0001;
DV 620 WH - 29928 s/n 41001.0001;
DV 620 WH UK - 30348 s/n 41001.0001;
DV 630 A BR - 30695 s/n 40830.0001;
DV 630 A IX - 30693 s/n 40830.0001;
DV 630 A WH - 30694 s/n 40830.0001;
DV 640 A IX - 30368 s/n 40830.0001;
DV 650 A IX - 30696 s/n 40830.0001;
DV 650 A WH - 30697 s/n 40830.0001;
DV 670 A BR - 30701 s/n 40830.0001;
DV 670 A IX - 30699 s/n 40830.0001;
DV 670 A WH - 30700 s/n 40830.0001;
DV 620 IX - 29929 s/n 40531.0001;
DVG 621 BK - 33220 s/n 40830.0001;
DVG 621 IX - 33212 s/n 40830.0001;
DVG 621 WH - 33221 s/n 40830.0001;
DWM 55 A - 29793 s/n 41001.0001;
DWT 10 P.2 - 32228 s/n 40830.0001;
FDW 20 P - 33182 s/n 41001.0001;
FDW 80 G - 33189 s/n 41001.0001;
FDW 80 P - 33187 s/n 41001.0001;
FDW 80 T - 33188 s/n 41001.0001;
FDW 85 A - 33190 s/n 41001.0001;
FDW 60 G - 33185 s/n 41001.0001;
FDW 60 P - 33183 s/n 41001.0001;
FDW 60 T - 33184 s/n 41001.0001;

FDW 65 A - 33186 s/n 41001.0001;
IDE 100 (EU) - 30666 s/n 41001.0001;
IDE 100 S (IT) - 30216 s/n 41001.0001;
IDE 100 SK - 30758 s/n 41001.0001;
IDE 1000 UK - 30044 s/n 41001.0001;
IDE 1005 S UK - 30045 s/n 41001.0001;
IDE 44 EU - 30423 s/n 40911.0001;
IDE 44 UK - 30394 s/n 40916.0001;
IDL 40 DE - 32308 s/n 41001.0001;
IDL 40 EU - 30417 s/n 41001.0001;
IDL 40 FR - 30403 s/n 41001.0001;
IDL 40 S UK - 31956 s/n 41001.0001;
IDL 40 UK - 30393 s/n 41001.0001;
IDL 42 DE - 32309 s/n 40830.0001;
IDL 42 EU - 30419 s/n 40911.0001;
IDL 42 FR - 30404 s/n 40911.0001;
IDL 50 EU.2 - 32006 s/n 40916.0001;
IDL 50 SK.2 - 32221 s/n 41001.0001;
IDL 500 FR - 30014 s/n 40916.0001;
IDL 505 S UK.2 - 32001 s/n 41001.0001;
IDL 51 (EU) - 31075 s/n 40906.0001;
IDL 51 EU.2 - 32217 s/n 40906.0001;
IDL 55 (DE) - 30561 s/n 40909.0001;
IDL 55 (EU) - 30634 s/n 40916.0001;
IDL 55 (IT) - 30212 s/n 40916.0001;
IDL 55 DE.2 - 32220 s/n 40909.0001;
IDL 55 EU.2 - 32215 s/n 40917.0001;
IDL 55 S (DE) - 30565 s/n 40909.0001;
IDL 55 S (IT) - 30213 s/n 40916.0001;
IDL 55 S DE.2 - 32224 s/n 40909.0001;
IDL 57 (PT) - 31086 s/n 40916.0001;
IDL 60 (EU) - 30644 s/n 40909.0001;
IDL 60 (IT) - 30214 s/n 41001.0001;
IDL 60 EU.2 - 32216 s/n 40909.0001;
IDL 60 NL.2 - 32219 s/n 41001.0001;
IDL 60 S (EU) - 30647 s/n 40909.0001;
IDL 60 S EU.2 - 32225 s/n 40909.0001;
IDL 60 SK - 30755 s/n 41001.0001;
IDL 60 SK.2 - 32222 s/n 41001.0001;
IDL 61 (EU) - 30680 s/n 41001.0001;
IDL 61 EU.2 - 32218 s/n 41001.0001;
IDL 62 (EU) - 30686 s/n 40911.0001;
IDL 62 EU.2 - 32223 s/n 40911.0001;
IDL 63 S NL.2 - 32226 s/n 41001.0001;
IDL 70 (EU) - 30654 s/n 40902.0001;
IDL 70 (IT) - 30215 s/n 41001.0001;
IDL 70 D EU - 30600 s/n 41001.0001;
IDL 700 FR - 30016 s/n 41001.0001;
IDL 700 UK - 30042 s/n 41001.0001;
IDL 7021 (SP) - 30603 s/n 40902.0001;
IDL 710 FR - 30017 s/n 41001.0001;
IDL 75 (EU) - 30661 s/n 41001.0001;
IDL 75 EU.2 - 32627 s/n 41001.0001;
IDL 75 S (EU) - 30604 s/n 41001.0001;
IDL 75 S EU.2 - 32845 s/n 41001.0001;
IDL B2 EU - 32271 s/n 40917.0001;
IDL 500 UK.2 - 31984 s/n 40524.0001 ;

IDL 50 EU - 30217 s/n 40531.0001;
IDL 550 FR - 30015 s/n 40531.0001;
IDL 705 SUK - 30043 s/n 40531.0001;
L 6047 FR - 33150 s/n 40830.0001;
L 61 (IT) - 28169 s/n 40917.0001;
L 61 AG - 29907 s/n 40917.0001;
L 61 EU - 28470 s/n 40917.0001;
L 63 (IT) - 28453 s/n 41001.0001;
L 63 AUS - 29912 s/n 41001.0001;
L 63 EU - 29544 s/n 40909.0001;
L 63 SK - 31080 s/n 41001.0001;
L 63 SK.2 - 32227 s/n 41001.0001;
L 63 X (IT) - 28904 s/n 41001.0001;
L 63 X AUS - 29913 s/n 41001.0001;
L 64 AUS - 29914 s/n 41001.0001;
L 64 X AUS - 29915 s/n 41001.0001;
LD 85 (IT) - 28454 s/n 41001.0001;
LD 85 X (IT) - 28457 s/n 41001.0001;
LD 87 (IT) - 28455 s/n 41001.0001;
LD 87 EU - 28473 s/n 41001.0001;
LD 87 FR - 29285 s/n 41001.0001;
LD 87 X (IT) - 28458 s/n 41001.0001;
LD 87 X AUS - 29918 s/n 41001.0001;
LD 87 X EU - 28474 s/n 41001.0001;
LD 87 X SK - 29692 s/n 41001.0001;
LI 420 - 30392 s/n 40830.0001;
LI 460 - 30370 s/n 40830.0001;
LI 480 A - 30371 s/n 40830.0001;
LI 660 A - 30304 s/n 40830.0001;
LI 700 DUO - 29515 s/n 40830.0001;
LI 620 - 29511 s/n 40714.0001;
LI 640 A - 29512 s/n 40531.0001;
LI 670 DUO - 29513 s/n 40603.0001;
LI 680 DUO - 29514 s/n 40607.0001;
LIQ 700 DUO JADE - 29952 s/n 40830.0001;
LL 40 EU - 30408 s/n 41001.0001;
LL 42 EU - 30411 s/n 40907.0001;
LL 420 FR - 30397 s/n 40907.0001;
LL 43 S EU - 30412 s/n 40907.0001;
LL 62 FR - 30614 s/n 41001.0001;
LL 62 X FR - 30615 s/n 41001.0001;
LL 63 EU - 29909 s/n 41001.0001;
LL 63 FR - 28460 s/n 41001.0001;
LL 63 TK - 28471 s/n 41001.0001;
LL 63 X EU - 30174 s/n 41001.0001;
LL 64 X AUS - 29917 s/n 41001.0001;
LL 64 77 - 31940 s/n 41001.0001;
LL 64 AG - 29908 s/n 40920.0001;
LL 64 AUS - 29916 s/n 41001.0001;
LL 64 DE - 31941 s/n 41001.0001;
LL 64 EU - 29545 s/n 41001.0001;
LL 64 SK - 29690 s/n 41001.0001;
LL 64 X EU - 29546 s/n 41001.0001;
LL 65 (IT) - 28903 s/n 41001.0001;
LL 65 EU - 29547 s/n 40906.0001;
LL 65 FR - 28462 s/n 41001.0001;
LL 65 TK - 28472 s/n 41001.0001;

LL 65 X EU - 29910 s/n 40906.0001;
LL 65 X FR - 29284 s/n 41001.0001;
LL 6546 FR - 33151 s/n 40916.0001;
LV 460 A BK - 30379 s/n 40830.0001;
LV 460 A IX - 30377 s/n 40830.0001;
LV 460 A WH - 30378 s/n 40830.0001;
LV 460 BK - 30375 s/n 40920.0001;
LV 460 IX - 30372 s/n 40920.0001;
LV 460 WH - 30373 s/n 40920.0001;
LV 620 BK - 29939 s/n 41001.0001;
LV 620 IX - 29941 s/n 41001.0001;
LV 620 WH - 29940 s/n 41001.0001;
LV 640 A BK - 29942 s/n 40902.0001;
LV 640 A IX - 29946 s/n 40902.0001;
LV 640 A R AN - 29944 s/n 40902.0001;
LV 640 A R OW - 29945 s/n 40902.0001;
LV 640 A WH - 29943 s/n 40902.0001;
LV 650 A ALU - 29922 s/n 41001.0001;
LV 650 A BK - 29925 s/n 41001.0001;
LV 650 A IX - 29921 s/n 41001.0001;
LV 650 A OW - 29923 s/n 41001.0001;
LV 650 A WH - 29924 s/n 41001.0001;
LV 660 A BK FR - 30300 s/n 40902.0001;
LV 660 A IX FR - 30301 s/n 40902.0001;
LV 660 A WH FR - 30299 s/n 40902.0001;
LV 670 DUO ALU - 29926 s/n 41001.0001;
LV 670 DUO AN - 29947 s/n 41001.0001;
LV 670 DUO IX - 29948 s/n 41001.0001;
LV 670 R AN - 30302 s/n 40830.0001;
LV 670 R OW - 30303 s/n 40830.0001;
LV 680 DUO IX - 29949 s/n 41001.0001;
LVI 12-44 AN - 29564 s/n 40830.0001;
LVI 12-44 IX - 29562 s/n 40830.0001;
LVI 12-44 WH - 29563 s/n 40830.0001;
LVI 12-55 AN - 29567 s/n 41001.0001;
LVI 12-55 IX - 29565 s/n 41001.0001;
LVI 12-55 WH - 29566 s/n 41001.0001;
LVI 12-66 AN - 29570 s/n 41001.0001;
LVI 12-66 IX - 29568 s/n 41001.0001;
LVI 12-66 M BA - 29573 s/n 41001.0001;
LVI 12-66 M GI - 29571 s/n 41001.0001;
LVI 12-66 M VA - 29572 s/n 41001.0001;
LVI 12-66 WH - 29569 s/n 41001.0001;
LVO 670 DUO IX - 30848 s/n 40830.0001;
LVO 680 DUO IX - 29951 s/n 40902.0001;
LVR 640 A AN - 33614 s/n 40902.0001;
LVR 640 A OW - 33615 s/n 40902.0001;
LVR 670 AN - 33616 s/n 40830.0001;
LVR 670 OW - 33617 s/n 40830.0001;
LVTI 12-55 - 29574 s/n 41001.0001;
LVTI 12-66 - 29575 s/n 41001.0001;
SDW 60 P - 31010 s/n 40906.0001;
XLV 670 DUO IX - 29950 s/n 41001.0001.

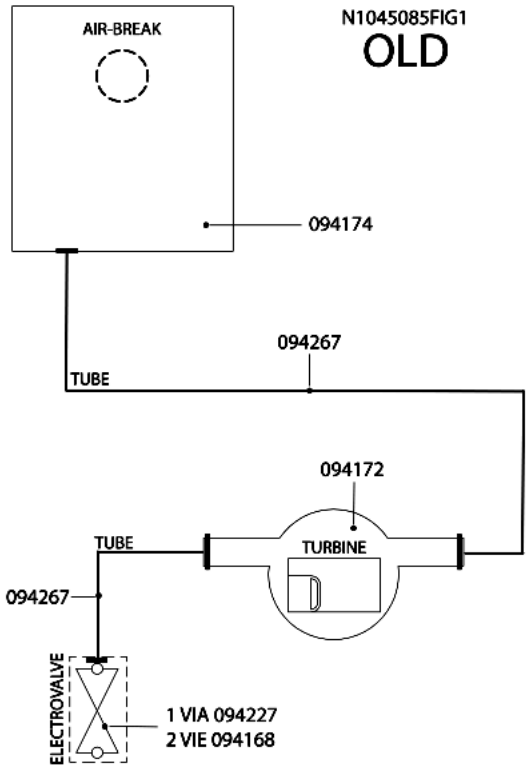

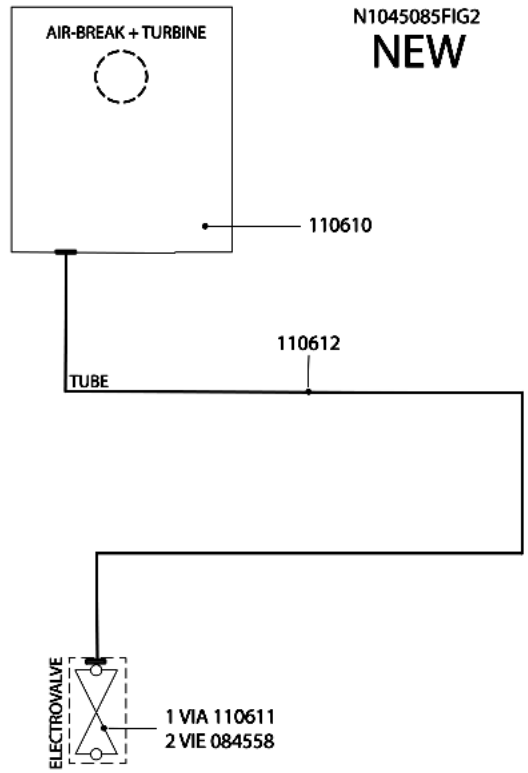

n1045127: New airbreak - solution of water spurts leaking from base LVS 60 CM

From serial number 50930.0001, to solve the problem of water spurts emitted from the lower right and left side of the door the following modifications were introduced in production:

1-Airbreak without insert to allow the necessary pressure venting
2-Honeycomb top panel to protect the kitchen unit from any steam emitted (only on built-under models)
3-Tank seal length increased by 3 cm to improve water tightness
4-Die-cut roof sound-deadening panel
5-Three clips for correct fixing of the tank base seal (in production from serial number 50701.0001)

New parts:
C00141308 - Airbreak
C00141310 - Honeycomb top panel (built-under versions only)
C00141317 - Tank seal
C00141314 - Roof sound-deadening panel
C00140679 - Tank base seal fixing clip

Premodification parts
C00110610 - Airbreak
C00116110 - Tank seal
C00097300 - Roof sound-deadening panel

1) AIRBREAK REPLACEMENT
It is mandatory to use the new part; in the event of replacement with premodification appliances proceed as follows:
- replace the airbreak with the new part C00141308
- if present, refit the roof sound-deadening panel after cutting out a 10x10 cm square from the rear left-hand corner
- on the built-under version, fit honeycomb panel C00141310 on the top of the appliance
- replace tank seal with the new seal P/N C00141317

WARNING: when replacing an airbreak without a litre-counter turbine use exclusively the same type of part (P/N C00094174 - all the relevant details are given in bulletin n1045085)

2) CHANGING THE TANK SEAL
On appliances with serial number from 40101.0001 to 50930.0001, you can use the new tank seal P/N C00141317 after cutting 1.5 cm off each end.

n1045133: New thermoprotected drain pump in parallel with wash electric pump

---

The drain pump electrical connection has been modified from a configuration in series with the wash electric pump to one in parallel.

The drain pump in series with the wash electric pump is fed through the wash electric pump causing a voltage drop equal to -15V (diagram N1045133-134FIG1).

The drain pump in series with the wash electric pump is electrically fed directly by the F-N line, without any voltage drop (diagram N1045133-134FIG1).

New parts:
Wiring in parallel
C00118767(Rohs 143766) - thermoprotected drain pump 220/240V 50HZ 26W - picture (N1045133-134FIG3)

Premodification parts:
Wiring in series

C00112306(Rohs 143739) - drain pump 230V 50HZ 22W - picture (N1045133-134FIG4)

The codes of the new and premodification wirings are given in note N1045129.


Important!!
The thermoprotected drain pump cannot be installed on premodification dishwashers.
The non-thermoprotected drain pump cannot be installed on modified dishwashers.

Models/serial nos. affected by modification:
cc29511 - s/n 60316.0001 - LI620
cc29930 - s/n 60323.0001 - DI6
cc29931 - s/n 60320.0001 - DI620
cc29943 - s/n 60401.0001 - LV640AWH
cc30300 - s/n 60401.0001 - LV660ABKFR
cc30301 - s/n 60401.0001 - LV660AIXFR
cc32006 - s/n 60305.0001 - IDL50EU.2
cc32215 - s/n 60306.0001 - IDL55EU.2
cc32220 - s/n 60306.0001 - IDL55DE.2
cc32221 - s/n 60307.0001 - IDL50SK.2
cc32224 - s/n 60401.0001 - IDL55SDE.2
cc32271 - s/n 60322.0001 - IDLB2EU
cc33223 - s/n 60222.0001 - DVG622IX
cc33614 - s/n 60401.0001 - LVR640AAN
cc34119 - s/n 60307.0001 - IDL55IT.2
cc34120 - s/n 60309.0001 - IDL55SIT.2
cc34457 - s/n 60222.0001 - IDL502FR.2
cc34458 - s/n 60306.0001 - IDL552FR.2
cc34499 - s/n 60222.0001 - IDL50SEU.2
cc34518 - s/n 60222.0001 - L63EU.2
cc34865 - s/n 60222.0001 - IDL500FR.2
cc35314 - s/n 60306.0001 - IDL57PT.2
cc36154 - s/n 60306.0001 - IDL553FR.2
cc39329 - s/n 60222.0001 - IDL506FR.2
cc39330 - s/n 60306.0001 - IDL556FR.2
cc39331 - s/n 60306.0001 - IDL556SFR.2
cc40041 - s/n 60414.0001 - IDL42EU.C
cc40220 - s/n 60430.0001 - IDL42FR.C
cc30299 - s/n 60418.0001 - LV660AWHFR
cc29939 - s/n 60421.0001 - LV620BK
cc29940 - s/n 60421.0001 - LV620WH
cc29941 - s/n 60421.0001 - LV620IX
cc29946 - s/n 60422.0001 - LV640AIX
cc29942 - s/n 60424.0001 - LV640ABK
cc29512 - s/n 60501.0001 - LI640A
cc33942 - s/n 60501.0001 - LI641A
cc40916 - s/n 60502.0001 - L6064EU
cc40911 - s/n 60502.0001 - L6061EU
cc37341 - s/n 60502.0001 - L62IT.2
cc35316 - s/n 60502.0001 - L61EU.2
cc29907 - s/n 60502.0001 - L61AG
cc34283 - s/n 60529.0001 - IDL52EU.2
cc41049 - s/n 60605.0001 - L65IT
cc23510 - s/n 70618.0001 - D61EX50-60
cc29912 - s/n 70320.0001 - L63AUS
cc29913 - s/n 70326.0001 - L63XAUS
cc29921 - s/n 70318.0001 - LV650AIX
cc29922 - s/n 70227.0001 - LV650AALU

cc29923 - s/n 70329.0001 - LV650AOW
cc29924 - s/n 70227.0001 - LV650AWH
cc29925 - s/n 70227.0001 - LV650ABK
cc30304 - s/n 70326.0001 - LI660A
cc30369 - s/n 70323.0001 - DI630A
cc32217 - s/n 70326.0001 - IDL51EU.2
cc33229 - s/n 70326.0001 - DVG652AIX
cc33616 - s/n 70326.0001 - LVR670AN
cc33617 - s/n 70326.0001 - LVR670OW
cc33751 - s/n 70326.0001 - LVX12-45IX
cc33944 - s/n 70329.0001 - LI661A
cc34502 - s/n 70326.0001 - IDL60SAUS.2
cc34519 - s/n 70115.0001 - IDTMEU
cc37546 - s/n 70326.0001 - L6049FR
cc40887 - s/n 70319.0001 - IDL600EU.2
cc40888 - s/n 70319.0001 - IDL600SEU.2
cc40889 - s/n 70129.0001 - IDL750SEU.2
cc40891 - s/n 70122.0001 - IDL750EU.2
cc41165 - s/n 70327.0001 - IDL63EU.2
cc41166 - s/n 70319.0001 - IDL6021EU.2
cc41203 - s/n 70326.0001 - IDL550SIT.2
cc41204 - s/n 70326.0001 - IDL600IT.2
cc41205 - s/n 70326.0001 - IDL600SIT.2
cc42061 - s/n 70326.0001 - DI623A
cc42062 - s/n 70301.0001 - DI650A
cc42063 - s/n 70326.0001 - DVG623BK
cc42065 - s/n 70325.0001 - DVG623WH
cc42242 - s/n 70326.0001 - IDL6049SK.2
cc43218 - s/n 70301.0001 - DI653A
cc43942 - s/n 70326.0001 - DVGN623BK
cc43944 - s/n 70326.0001 - DVGN623WH
cc47650 - s/n 70326.0001 - L64AUS
cc47651 - s/n 70326.0001 - L64XAUS
cc39332 - s/n 70301.0001 - IDL706FR.2
cc34459 - s/n 60306.0001 - IDL555SFR.2
cc32227 - s/n 60222.0001 - L63SK.2
cc33212 - s/n 60222.0001 - DVG621IX


N1045133/134FIG1


Drying pump connected electrically in series to the motor washing

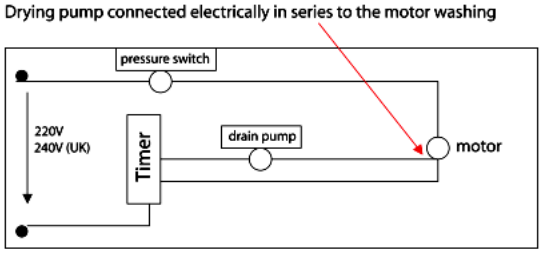

N1045133/134FIG2

Drying pump connected electrically in parallel to the motor washing

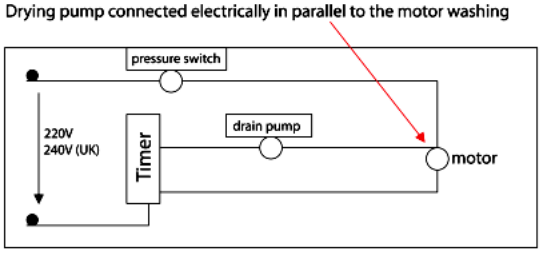

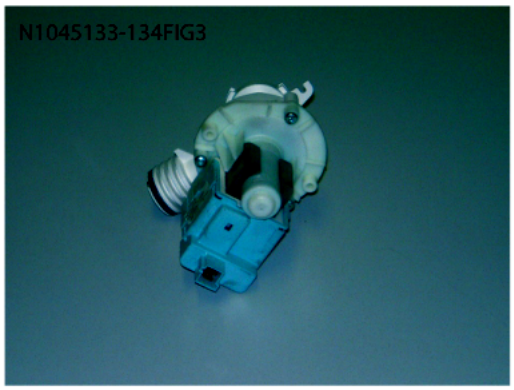



n1045135: New single-pole On/Off switch

The two-pole On/Off switch has been replaced by the single-pole switch.

New parts
Wiring
C00140609 - single-pole On/Off switch
C00063971 - single-pole On/Off switch
C00140607 - single-pole On/Off switch

Premodification parts
Wiring
C00041184 - two-pole On/Off switch
C00058465 - two-pole On/Off switch
C00096884 - two-pole On/Off switch

Models/serial nos. affected by modification:
cc29511 - s/n 60316.0001 - LI620
cc29930 - s/n 60323.0001 - DI6
cc29931 - s/n 60320.0001 - DI620
cc29943 - s/n 60401.0001 - LV640AWH
cc30300 - s/n 60401.0001 - LV660ABKFR
cc30301 - s/n 60401.0001 - LV660AIXFR
cc32006 - s/n 60305.0001 - IDL50EU.2
cc32215 - s/n 60306.0001 - IDL55EU.2
cc32221 - s/n 60307.0001 - IDL50SK.2
cc32271 - s/n 60322.0001 - IDLB2EU
cc33223 - s/n 60222.0001 - DVG622IX
cc33614 - s/n 60401.0001 - LVR640AAN
cc34119 - s/n 60307.0001 - IDL55IT.2
cc34120 - s/n 60309.0001 - IDL55SIT.2
cc34457 - s/n 60222.0001 - IDL502FR.2
cc34499 - s/n 60222.0001 - IDL50SEU.2
cc34518 - s/n 60222.0001 - L63EU.2
cc34865 - s/n 60222.0001 - IDL500FR.2
cc35314 - s/n 60306.0001 - IDL57PT.2
cc39329 - s/n 60222.0001 - IDL506FR.2
cc39330 - s/n 60306.0001 - IDL556FR.2
cc39331 - s/n 60306.0001 - IDL556SFR.2
cc30351 - s/n 60320.0001 - DI620UK
cc30708 - s/n 60401.0001 - BFI620
cc33182 - s/n 60222.0001 - FDW20P
cc34501 - s/n 60222.0001 - IDL535SUK.2
cc30715 - s/n 51115.0001 - BFI680
cc34753 - s/n 51115.0001 - BFQ700T/1
cc29514 - s/n 51115.0001 - LI680DUO
cc29515 - s/n 51115.0001 - LI700DUO
cc33970 - s/n 51115.0001 - LIQ700DUOTI
cc33955 - s/n 51115.0001 - LVTI12-67
cc37869 - s/n 51115.0001 - LI680PLUS
cc37873 - s/n 51115.0001 - LIQ700TIPLUS
cc34142 - s/n 51115.0001 - CISLI700DUO
cc37872 - s/n 51118.0001 - LI700PLUS
cc28472 - s/n 51121.0001 - LL65TK.2
cc33186 - s/n 51121.0001 - FDW65A
cc34380 - s/n 51121.0001 - LL66XFR
cc33183 - s/n 51122.0001 - FDW60P
cc33185 - s/n 51125.0001 - FDW60G
cc33184 - s/n 51201.0001 - FDW60T

n1045136: introduction of new high pressure sensor

In modified products the connector going to the high pressure sensor is part of the wiring assembly (see picture N1045136FIG1).
In premodification products the high pressure sensor is connected to the wiring assembly by a cable that is part of code C00094157 (see pictures N1045136FIG2-3).

New parts
Wiring
C00142435 - high pressure sensor


Premodification parts
Wiring
C00094157 - high pressure sensor + cable

The new parts are not individually interchangeable with premodification ones.


Models / serial nos. affected by the modification:
cc29511 - s/n 60316.0001 - LI620
cc29930 - s/n 60323.0001 - DI6
cc29931 - s/n 60320.0001 - DI620
cc29943 - s/n 60401.0001 - LV640AWH
cc30300 - s/n 60401.0001 - LV660ABKFR
cc30301 - s/n 60401.0001 - LV660AIXFR
cc32006 - s/n 60305.0001 - IDL50EU.2
cc32215 - s/n 60306.0001 - IDL55EU.2
cc32220 - s/n 60306.0001 - IDL55DE.2
cc32221 - s/n 60307.0001 - IDL50SK.2
cc32224 - s/n 60401.0001 - IDL55SDE.2
cc32271 - s/n 60322.0001 - IDLB2EU
cc33223 - s/n 60222.0001 - DVG622IX
cc33614 - s/n 60401.0001 - LVR640AAN
cc34119 - s/n 60307.0001 - IDL55IT.2
cc34120 - s/n 60309.0001 - IDL55SIT.2
cc34457 - s/n 60222.0001 - IDL502FR.2
cc34458 - s/n 60306.0001 - IDL552FR.2
cc34499 - s/n 60222.0001 - IDL50SEU.2
cc34518 - s/n 60222.0001 - L63EU.2
cc34865 - s/n 60222.0001 - IDL500FR.2
cc35314 - s/n 60306.0001 - IDL57PT.2
cc39329 - s/n 60222.0001 - IDL506FR.2
cc39330 - s/n 60306.0001 - IDL556FR.2
cc39331 - s/n 60306.0001 - IDL556SFR.2
cc30351 - s/n 60320.0001 - DI620UK
cc30708 - s/n 60401.0001 - BFI620
cc33182 - s/n 60222.0001 - FDW20P
cc34501 - s/n 60222.0001 - IDL535SUK.2
cc30715 - s/n 51115.0001 - BFI680
cc34753 - s/n 51115.0001 - BFQ700T/1
cc29514 - s/n 51115.0001 - LI680DUO
cc29515 - s/n 51115.0001 - LI700DUO
cc33970 - s/n 51115.0001 - LIQ700DUOTI

cc33955 - s/n 51115.0001 - LVTI12-67
cc37869 - s/n 51115.0001 - LI680PLUS
cc37873 - s/n 51115.0001 - LIQ700TIPLUS
cc34142 - s/n 51115.0001 - CISLI700DUO
cc37872 - s/n 51118.0001 - LI700PLUS
cc28472 - s/n 51121.0001 - LL65TK.2
cc33186 - s/n 51121.0001 - FDW65A
cc34380 - s/n 51121.0001 - LL66XFR
cc33183 - s/n 51122.0001 - FDW60P
cc33185 - s/n 51125.0001 - FDW60G
cc33184 - s/n 51201.0001 - FDW60T
cc30299 - s/n 60418.0001 - LV660AWHFR
cc29939 - s/n 60421.0001 - LV620BK
cc29940 - s/n 60421.0001 - LV620WH
cc29941 - s/n 60421.0001 - LV620IX
cc29946 - s/n 60422.0001 - LV640AIX
cc29942 - s/n 60424.0001 - LV640ABK
cc29512 - s/n 60501.0001 - LI640A
cc33942 - s/n 60501.0001 - LI641A
cc40916 - s/n 60502.0001 - L6064EU
cc40911 - s/n 60502.0001 - L6061EU
cc37341 - s/n 60502.0001 - L62IT.2
cc35316 - s/n 60502.0001 - L61EU.2
cc29907 - s/n 60502.0001 - L61AG
cc34283 - s/n 60529.0001 - IDL52EU.2
cc41049 - s/n 60605.0001 - L65IT
cc42062 - s/n 60701.0001 - DI650A


N1045136FIG1

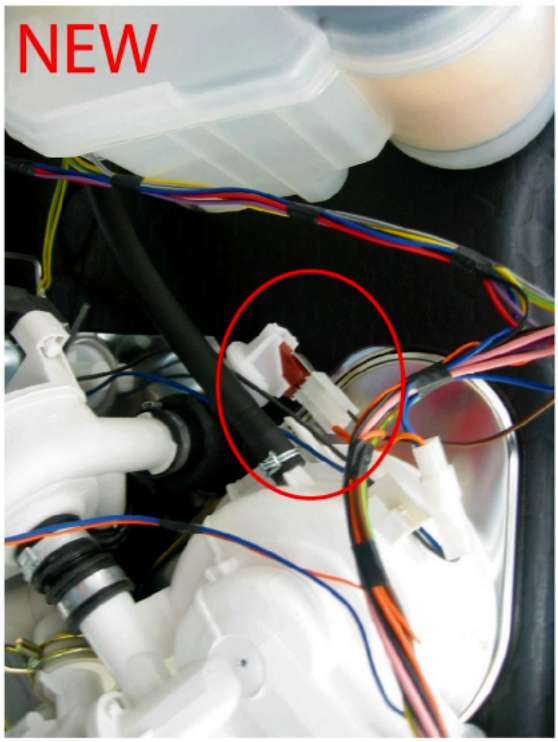

N1045136FIG2

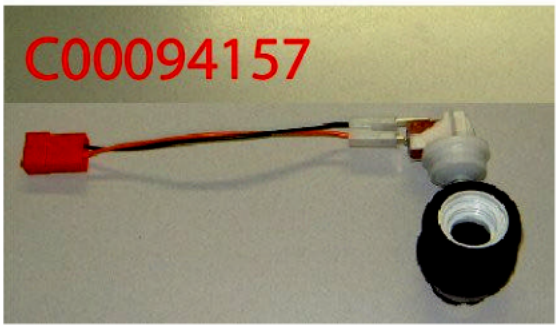

N1045136FIG3

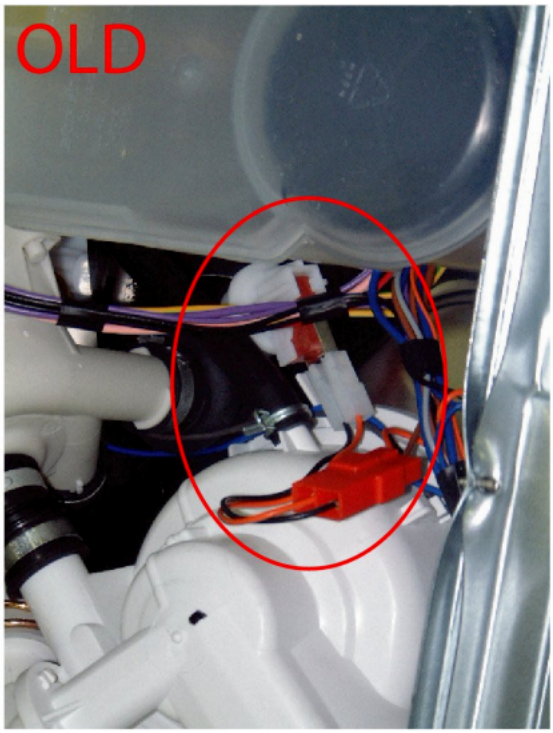


n1045138: Polar white on dishwashers Plant 37 (None)

The colour of the aesthetics on all dishwashers produced in Plant 37 (None) has been changed from white 27 to "polar white". The modified models have a new industrial part code recognisable by the number 9 as the third last digit (e.g. 7284730900).

The spare part codes of the new parts give the abbreviation "PW" in the description, unlike the premodification parts identified by the abbreviation "B27".

Electric schemes and links

Cod. 16001679101

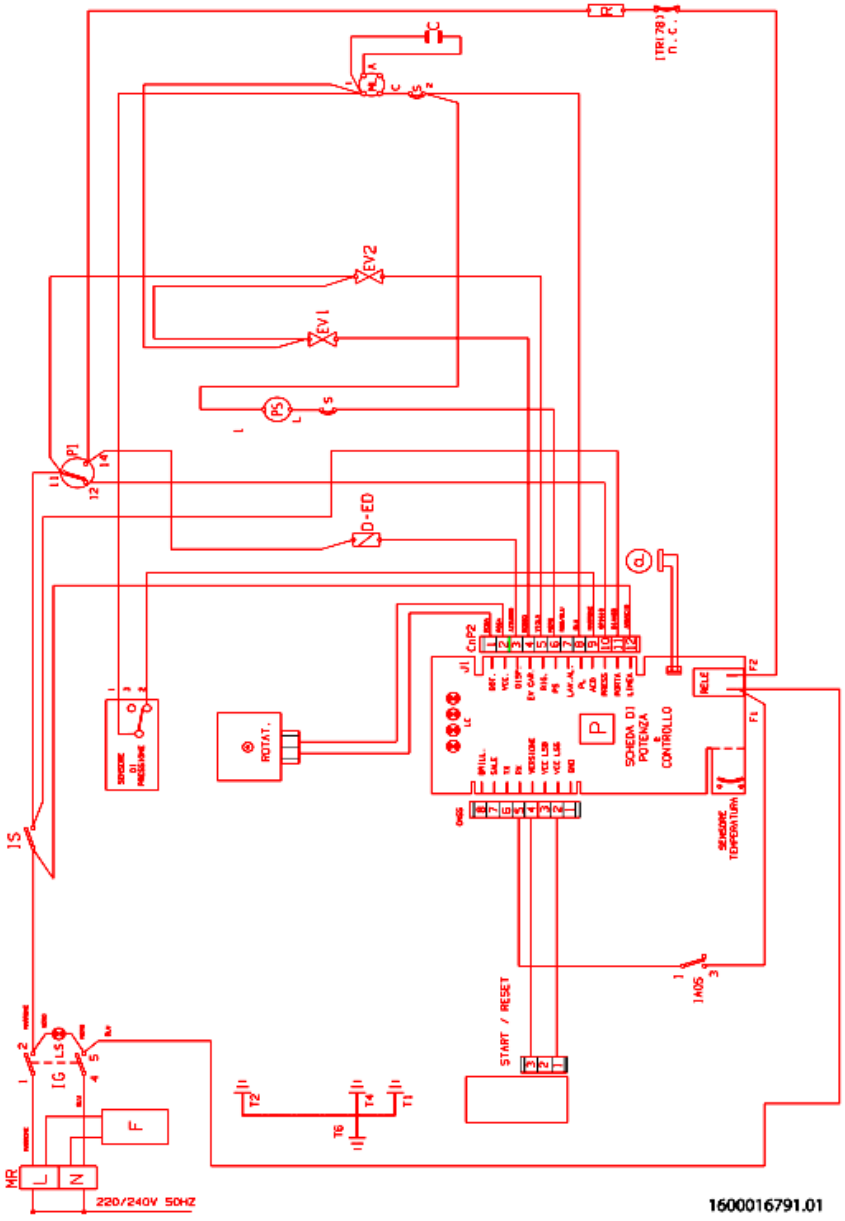

Legend

Legend: 16001679101

A..	Timer contact	LPA	Door open
AQS	Aquastop electrovalve	LPR	Prewash LED
B..	Timer contact	LRI	Rinse LED
C	Condensor	LS	Mains LED -Pilot lampe On/Off
C..	Timer contact	LSB	Polisher LED
CL	Slow cam	LSC	Cycle ranning lamp
CM	Wash pump motor connector	LSE	Acquastop LED
CN	Connector	LSS	Salt LED
CV	Fast cam	LV	Fan off lamp
D-ED	Dispenser - Electric dosing device	M	Terminal box
D..	Timer contact	MB	Polisher dip-switch
DB	Brightener dispenser	ME	Acquastop dip-switch
DD	Display - Detergent dispenser	ML	Wash motor
E1	Cold water electrovalve	MM	Handle dip-switch
E2	Regeneration electrovalve	MP	Door dip-switch
E3	Hot water electrovalve	MR	Delay-timer motor - Terminal board
ECO	Saving switch	MT	Timer motor
ED	Detergent/Brightener dispenser	MTR	Fast forward timer motor
EV1	Cold water electrovalve MM- Handle dip-switch	MV	Motor fan
EV1/2	Half-load electrovalve	P	Pressure switch
EV2	Regeneration electrovalve	P..	Pressure switch contact
EV3	Hot water electrovalve	P1	Stage 1 pressure
EVC	Hot water electrovalve	P2	Stage 2 pressure switch
EVF	Cold water electrovalve	PAP	High pressure switch
EVR	Regeneration water electrovalve	PO	Overflow pressure switch
F	Anti-interference filter ML- Wash motor	PS	Drain pump
FA	Radio interferences	PULS	Push-button panel
I1	On/Off switch - Plus cycle switch -IEC cycle	R	Heating element
I1/2	Switch half-load	R.D.	Delay rotary selector
I2	Fast switch -IEC cycle switch (standard) -	RA	Heating element drying
I2H	2-hour delay switch	ROT D	Delay rotary selector
I3	Saving switch- Switch for cycle with no pre-	ROT.	Rotary selector
I4	Switch for cycle fresh dirty	S	Motor overload cutout

I4H	4-hour delay switch	SC	Selector cycli
I5-ICR	Fast cycle switch	SS	Salt detector
I6	Soak cycle switch	ST	START
I6H	6-hour delay switch	T..	Delay-tymer contact
IAQS	Aquastop switch	T1	Power supply earth cable -Thermostat 45?C
ID	Switch display	T2	Lid earth -Thermostat 55?C
IE	Saving switch	T3	Timer earth -Thermostat 65?C
IEXD	Exstra dray switch	T36	36?C N.O. Thermostat
IG	Main switch	T4	Heating element earth
IMV	Off motor fan switch	T46	46?C N.O. Thermostat
IP	High temperature switch	T5	Drain pump earth
IS	Cut-off switch	T57	57?C N.O. Thermostat
ISB	Polisher led switch	T6	Wash motor earth
ISS	Salt LED switch	T8	External lid earth
ITR	Heating element switch	TE	Relay switch
L	Mains LED	THP	Thermoprotector
L1	Cycle 1 lamp	TM	Timer
L1/2	Lamp cjcle half-load	TS	Safety thermostat
L2	Cycle 2 lamp	TS 40	Thermostat 40 ?C
L3	Cycle 3 lamp	TS 50	Thermostat 50 ?C
L4	Cycle 4 lamp	TS 62	Thermostat 62 ?C
L5	Cycle 5 lamp	TS1	Min. temperature thermostat
L6	Cycle 6 lamp	TS2	Max. temperature thermostat
LA	Drying LED	TT	Terminal box support earth
LAQ	Aquastop on lamp	Tcp	nner-door earthing connection
LC	Cycle ranning lamp	Tfa	Radio interference
LD	Delay activated lamp	Tml	Pump wash motor earthing connection
LE	Saving cycle	Tpg	Large door earthing connection
LH2	2-hour delay lamp	Tpi	Inspection door earthing connection
LH4	4-hour delay lamp	Tpr	Pressure switch
LH6	6-hour delay lamp	Tps	Discharge pump earthing connection
LL	Wash LED	Tr	Heating element
LP	High temperature LED	Tte	Delay-timer earthing connection